Form 3160-5 (June 1990)

UNITED STATES DEPARTMENT OF THE INTERIOR

/KI	LUCIYCU	
/	21.14	FORM APPROVED
,	1711	Budget Bureau No. 1004-013:
		Expires: March 31, 1993
0.70	11 4 11	and Pheignstion and Serial No.

BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals 7. If Unit or CA, Agreement Designation SUBMIT IN TRIPLICATE 1. Type of Well Oil Well 8. Well Name and No. Pritchard #9 2. Name of Operator 9. API Well No. Attn: John Hampton Amoco Production Company 30 045 25601 3. Address and Telephone No. 10. Field and Pool, or Exploratory Area P.O. Box 800, Denver, Colorado 80201 Basin Fruitland Coal Gas 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. County or Parish, State 1030' FSL, 1015' FWL, Sec.1, T30N-R9W San Juan, New Mexico CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF ACTION TYPE OF SUBMISSION Notice of Intent Change of Plans Abandonment **New Construction** Recompletion Non-Routine Fracturing Subsequent Report Plugging Back Water Shut-Off Casing Repair Conversion to Injection Final Abandonment Notice Altering Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* Amoco Production Company intends to Plug and Abandon the subject well.

See Attached for procedure:

If you have any questions please call Julie Acevedo at 303-830-6003.

		APPROVED
14. I hereby cartify that the foregoing is true and correct Signed Managed 1129	Tide Sr. Staff Admin. Supv.	AS AMENDED
(This space for Federal or State office use) Approved by Conditions of approval, if any:	Tide	AREA MANAGER
	•	

PXA Procedures Pritchard #9

- 1. Check location for anchors. Install if necessary. Test anchors.
- 2. MIRUSU. Blow down well. Kill if necessary with water. NDWH. NUBOPE.
- 3. POOH with 2 3/8" tbg. RIH with bit and scrapper. RIH with tbg and cement retainer at 2450'. Establish rate into perforations at 2470' to 2582'. Squeeze perforations and open hole with 107 sx class B cement. Pull out of retainer and spot a cement plug to 2400'. (14 sx class B cement.) WOC. Tag TOC.
- 4. Load hole with 9lbs mud/POZ water to 1475'. Spot a cement plug from 1560' to 1300' with 74 sx cement.
- 5. Load hole with 9lbs mud/POZ water to 750'. Spot a cement plug from 750' to surface with 211 sx cement.
- 6. NDBOPE. Cut off casing and wellhead. Install PXA marker according to BLM or state requirements.
- 7. Turn over to John Schwartz for reclamation.
- 8. Rehabilitate location according to BLM or state requirements.

