In Lieu of Form 3160 (June 1990	DEPARTME	ED STATES NT OF INTERIOR ND MANAGEMENT	FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993
Do not us	SUNDRY NOTICE AND I	reentry to a different reservoir. Use "APPLICATION DI	5. Lease Designation and Serial No. SF-078765
	TO DRILL" for permit	t for such proposals	6. If Indian, Allottee or Tribe Name
SUBMIT IN TRIPLICATE			7. If Unit or CA, Agreement Designation ROSA UNIT
1.	Type of Well Oil Well X Gas Well Other	RECEIVER	8. Well Name and No. ROSA UNIT #180A
2.	Name of Operator WILLIAMS PRODUCTION COMPANY	DEC - 8 1999	9. API Well No. 30-045-29800
3.	Address and Telephone No. PO BOX 3102 MS 37-2, TULSA, OK 74101 (918) 573-6254 DISTL 3	10. Field and Pool, or Exploratory Area BLANCO MV
4.	Location of Well (Footage, Sec., T., R., M., or 1035' FNL & 1845' FWL, NE/4 NW/4 SEC 09	Survey Description)	11. County or Parish, State SAN JUAN, NM
CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA			
TYPE OF SUBMISSION		TYPE OF ACTION	
	Notice of Intent	Abandonment	Change of Plans New Construction
	X Subsequent Report	Recompletion Plugging Back	Non-Routine Fracturing Water Shut-Off
	Final Abandonment	Casing Repair Altering Casing	Conversion to Injection
		X Other COMPLETION OPERATIONS	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)
Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*			
11-20-1999 MOL and rig up. Spot all equipment. Unload and tally tubing. TIH with 3-7/8" bit on 2-3/8" tubing and tag cement at 6030'. Pick up swivel and clean out to PBTD. Circulate hole clean. POH to 5985' and prepare to spot acid			
11-21-1999 Rig up BJ and pressure test to 3500# - held OK. Spot 500 gal of 15% HCl at 5985'. TOH with tubing. Perforate Point Lookout at 5700, 03, 06, 09, 12, 15, 18, 24, 27, 30, 33, 36, 40, 43, 46, 49, 69, 75, 86, 94, 5800, 14, 46, 98, 5901, 28, 32, 50, 53, and 88. Total of 30 (0.38") holes			
11-22-1999 RU BJ & pressure test lines to 3500#. Balled off Point Lookout in 1000 gal of 15% HCl and 45 ball sealers. Good ball action and complete ball off to 3500#. Ran junk basket and retrieved 45 balls with 30 hits. Fraced PL with 80,000# of 20/40 sand at 1-2 ppg in 1855 bbl of slick water. Job completed at 1100 hrs. 11/22/99. ISIP = 250#, 15 min. = 0#. AIR = 75 BPM, MIR = 75 BPM, ATP = 3000#, MTP = 480#. Set 4-1/2" CIBP at 5676'. Pressure tested to 3500# - held OK. TIH with dump bailer and spot 12 gal of 28% HCl at 5630'. Perforate CH/MEN at 4497, 4500, 4672, 75, 78, 4818, 22, 5157, 5212, 15, 5300, 5435, 44, 80, 86, 96, 99, 5502, 09, 12, 22, 25, 28, 56, 5620, 23, 26, 29, 32, and 61. Total of 30 (0.38") holes. Ball off CH/MEN with 45 ball sealers in 1500 gal of 15% HCl. Ran junk basket and retrieved 45 balls with 20 hits. Fraced CH/MEN with 74,530# of 20/40 sand at 1-2 ppg in 1622 bbl of slick water. Job completed at 1630 hrs. 11/22/99. ISIP = 140#, 15 min = 0#. AIR = 85 BPM, MIR = 88 BPM, ATP = 3000#, MTP = 3140#. Rigged down frac crew. Rig up blooie line and compressor Continued on Back			
14.	I hereby certify that the foregoing is true and Signed Tracy Ross		Date November 29, 1999
(This space for Federal or State office use)			
	Approved by	Title	ACCEPTED FOR RECORD
	Conditions of approval, if any:		
Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States by false, ficultous or fraudulent statements or representations as to any matter within its jurisdiction.			
stateme	inco or representations as to any matter within its	,	TO THE PARTY OF TH

FARMINGTON FIELD OF FIGE BY_________

l

11-23-1999 TIH to liner top and unload well. TIH and clean out 35' of fill to CIBP. Blow well on bottom with soap sweeps. TOH and pitot test well at 1,374 MCFD. TIH with 3-7/8" bit to 4419'. Unload well with compressor

11-24-1999 TIH and tag 8' of fill. Pick up swivel and drill CIBP. Let head blow off. Push remainder of plug to PBTD. Cleaned out 135' of fill. Blow well on bottom and ran a soap sweep every 45 min. TOH and removed bit. Pitot test well at 4,235 MCFD. Left well flowing on its own

11-25-1999 TIH with production tubing and clean out to PBTD. Blow well with soap sweeps. Pull up and land 187 jts. (5815') of 2-3/8", 4.7#, J-55 EUE tubing with mule shoe on bottom and SN on top of bottom joint at 5827' KB. ND BOP and NU wellhead. Blow well around with the compressor. Well is producing dry gas. Rig down and release rig at 1730 hrs 11/25/99