UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

	Sundry Not	tices and Reports on Wel	ls	_
Type of Wel	1			5. Lease Number SF-078505 5. If Indian, All Tribe Name
			16 9 mg 7	. Unit Agreement
Name of Ope	rator			,
RESOL	ŊĠŢQN	JAN	1 2001	
RESUL	RCES OIL	& GAS COMPANY	Elizan El	
Address 5 E	hone No. of Opera	O C	S107 3 8	. Well Name & Nu
		1 87499 (505) 326-9700	ne 🦪	Seymour #1B API Well No.
	s, rarmingcom, m.	1 0,433 (303) 420-3,00 100-		30-045-30021
Location of	Well, Footage, S	Sec., T, R, M	1	.0. Field and Pool
1797'FNL, 1	085'FEL, Sec. 25,	T-31-N, R-9-W, NMPM		Blanco MV/Basi
			1	1. County and Sta
				San Juan Co, N
. CHECK APPR	OPRIATE BOX TO IN	DICATE NATURE OF NOTICE	, REPORT, OTH	ER DATA
Type of Sub	mission	Type of Ac	tion	
Not	ice of Intent	Abandonment _ Recompletion	Change of	
X Sub	sequent Report	Plugging Back	New Constr	e Fracturing
	1 11 11 11	Casing Repair	Water Shut	
Fin	al Abandonment	Altering Casing _		
		X Other -		
. Describe	Proposed or Comp	oleted Operations		
8-3-00	RU W/L. Ran CBL	./GR/CCL @ 7938' to surf	ace. 1 st stage	TOC @ 5244'
0 3 00	Chana ball	+ 0 40014 ond		100 0 3211 .
10-7-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP t er sqz holes @ 3913'. Cm dloride, 0.3% Halad-344,	C @ 4130'. RD o 4100 psi, O td w/200 sx C	W/L. K. Perf 2 lass "H" w/
	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP t er sqz holes @ 3913'. Cm dloride, 0.3% Halad-344,	C @ 4130'. RD o 4100 psi, O td w/200 sx C	W/L. K. Perf 2 lass "H" w/
10-7-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm dloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase	W/L. K. Perf 2 lass "H" w/ t. WOC. RD.
10-7-00 11-14-00 11-15-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm dloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt a holes & csq to 1000 ps	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD.
10-7-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm cloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt choles & csg to 1000 ps CBL/GR/CCL @ 4550-3450	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD.
10-7-00 11-14-00 11-15-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm dloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt a holes & csq to 1000 ps	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD.
10-7-00 11-14-00 11-15-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm cloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt choles & csg to 1000 ps CBL/GR/CCL @ 4550-3450	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD. Tag CIBP @ 3913-3758'.
10-7-00 11-14-00 11-15-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm cloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt choles & csg to 1000 ps CBL/GR/CCL @ 4550-3450	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD. Tag CIBP @ 3913-3758'.
10-7-00 11-14-00 11-15-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm cloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt choles & csg to 1000 ps CBL/GR/CCL @ 4550-3450	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD. Tag CIBP @ 3913-3758'.
10-7-00 11-14-00 11-15-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm cloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt choles & csg to 1000 ps CBL/GR/CCL @ 4550-3450	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD. Tag CIBP @ 3913-3758'.
10-7-00 11-14-00 11-15-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm cloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt choles & csg to 1000 ps CBL/GR/CCL @ 4550-3450	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD. Tag CIBP @ 3913-3758'.
10-7-00 11-14-00 11-15-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm cloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt choles & csg to 1000 ps CBL/GR/CCL @ 4550-3450	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD. Tag CIBP @ 3913-3758'.
10-7-00 11-14-00 11-15-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm cloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt choles & csg to 1000 ps CBL/GR/CCL @ 4550-3450	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD. Tag CIBP @ 3913-3758'.
10-7-00 11-14-00 11-15-00 11-16-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran TOC @ 3758'.	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm cloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt holes & csg to 1000 ps CBL/GR/CCL @ 4550-3450 Flow well & CO.	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'. i, OK. SDON.', good cmt @	W/L. K. Perf 2 lass "H" w/ t. WOC. RD. Tag CIBP @ 3913-3758'.
10-7-00 11-14-00 11-15-00 11-16-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran TOC @ 3758'.	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm cloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt choles & csg to 1000 ps CBL/GR/CCL @ 4550-3450	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'. i, OK. SDON.', good cmt @	W/L. K. Perf 2 lass "H" w/ t. WOC. RD. Tag CIBP @ 3913-3758'.
10-7-00 11-14-00 11-15-00 11-16-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran TOC @ 3758'.	et @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP ter sqz holes @ 3913'. Cm cloride, 0.3% Halad-344, rig. cmt @ 3600'. Drill cmt holes & csg to 1000 ps CBL/GR/CCL @ 4550-3450 Flow well & CO.	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'. i, OK. SDON.', good cmt @ correct.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD. Tag CIBP @ 3913-3758'.
10-7-00 11-14-00 11-15-00 11-16-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran TOC @ 3758'.	set @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP to set graph stage and set graph stage are set graph stage and set graph stage and set graph stage and set graph stage are set graph stage and set graph stage and set graph stage are set graph stage are set graph stage and set graph stage are set graph sta	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'. i, OK. SDON.', good cmt @ correct.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD. Tag CIBP @ 3913-3758'.
10-7-00 11-14-00 11-15-00 11-16-00 11-16-00	Stage tool se RU. TIH w/CIBP, 0.32" diamete 1% calcium ch WO completion MIRU. SDON. TIH w/bit, tag 4620'. PT sqz TOOH w/bit. Ran TOC @ 3758'.	set @ 4891'. 2 nd stage TOO set @ 4620'. PT CIBP to set graph stage and set graph stage are set graph stage and set graph stage and set graph stage and set graph stage are set graph stage and set graph stage and set graph stage are set graph stage are set graph stage and set graph stage are set graph sta	C @ 4130'. RD o 4100 psi, O td w/200 sx C 0.4% versase @ 3600-3918'. i, OK. SDON.', good cmt @ correct.	W/L. K. Perf 2 lass "H" w/ t. WOC. RD. Tag CIBP @ 3913-3758'.