UNITED STATES

DEPARTMENT OF THE INTERIOR

Sundry No	otices and Reports on Wells		
	()	5.	Lease Number SF-078387
Type of Well GAS	(1898)	6.	If Indian, All. or Tribe Name
	JUN 2000	7.	Unit Agreement Name
Name of Operator BURLINGTON	or or or	51877	
RESOURCES 01	L & GAS COMPANY	8.	
Address & Phone No. of Open			Howell D #1B
PO Box 4289, Farmington, 1	NM 87499 (505) 326-9 766	9.	
		_	30-045-30064
Location of Well, Footage,		10.	Field and Pool
910'FNL, 1820'FWL, Sec.28,	T-31-N, R-8-W, NMPM	11.	Blanco MV/Basin DK County and State San Juan Co, NM
x Siinsemieni kebort	Plugging Back	Non-Routine	Fracturing
X Subsequent Report Final Abandonment		Non-Routine Water Shut of Conversion t	off
Final Abandonment	Casing Repair Altering Casing X Other -	Water Shut o	off
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/	Casing Repair Altering Casing X Other - mpleted Operations gauge ring to 8116'. Ran CB	Water Shut of Conversion t	off to Injection
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/ @ 2300'-surf 5-1-00 MIRU. ND WH. N csg @ 2450'.	Casing Repair Altering Casing X Other - mpleted Operations Gauge ring to 8116'. Ran CBI ace. TOC @ 2670'. RD W/L. TU BOP. TIH w/CIBP, set @ 43: TOOH w/5 ½" csg. Ran GR-CBI	Water Shut of Conversion to Co	Chemical cut 5 %"
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/ @ 2300'-surf 5-1-00 MIRU. ND WH. N csg @ 2450'. 410'. Perf 2	Casing Repair Altering Casing X Other - mpleted Operations Gauge ring to 8116'. Ran CB: ace. TOC @ 2670'. RD W/L. TOOH w/5 ½" csg. Ran GR-CB: sgz holes @ 350'. RD W/L.	Water Shut of Conversion to Co	Chemical cut 5 %" '-surface. TOC @ et @ 264'.
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/ @ 2300'-surf 5-1-00 MIRU. ND WH. N csg @ 2450'. 410'. Perf 2	Casing Repair Altering Casing X Other - mpleted Operations gauge ring to 8116'. Ran CB ace. TOC @ 2670'. RD W/L. U BOP. TIH w/CIBP, set @ 43 TOOH w/5 ½" csg. Ran GR-CB sqz holes @ 350'. RD W/L. from Jim Lovato, BLM, no se	Water Shut of Conversion to Co	off to Injection 110-2300' & GR-CCL Chemical cut 5 %" '-surface. TOC @ et @ 264'. ch 5 %" csg to surfa
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/ @ 2300'-surf 5-1-00 MIRU. ND WH. N csg @ 2450'. 410'. Perf 2 5-2-00 (Verbal approval PT lines to 30 pump into. R	Casing Repair Altering Casing X Other - Mmpleted Operations Gauge ring to 8116'. Ran CB ace. TOC @ 2670'. RD W/L. TOOH w/5 ½" csg. Ran GR-CB sqz holes @ 350'. RD W/L. from Jim Lovato, BLM, no so 000 psi, OK. Attempt to brk Rls pkr & TOOH. TIH w/mill to	Water Shut of Conversion to Co	off to Injection 110-2300' & GR-CCL Chemical cut 5 %" '-surface. TOC @ et @ 264'. ch 5 %" csg to surfaces w/1000 psi. Cannot ses csg stub. Circ ho
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/ @ 2300'-surf 5-1-00 MIRU. ND WH. N csg @ 2450'. 410'. Perf 2 5-2-00 (Verbal approval PT lines to 30 pump into. R clean. TOOH	Casing Repair Altering Casing X Other - mpleted Operations Gauge ring to 8116'. Ran CBS ace. TOC @ 2670'. RD W/L. TOOH w/5 ½" csg. Ran GR-CBS sqz holes @ 350'. RD W/L. from Jim Lovato, BLM, no sc 000 psi, OK. Attempt to brk Rls pkr & TOOH. TIH w/mill to w/mill. TIH w/5 ½" csg pate	Water Shut of Conversion to Co	Chemical cut 5 ½" '-surface. TOC @ et @ 264'. ch 5 ½" csg to surfaces w/1000 psi. Cannot ss csg stub. Circ how csg stub w/csg page
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/ @ 2300'-surf 5-1-00 MIRU. ND WH. N csg @ 2450'. 410'. Perf 2 5-2-00 (Verbal approval PT lines to 30 pump into. R clean. TOOH PT csg patch	Casing Repair Altering Casing X Other - mpleted Operations Gauge ring to 8116'. Ran CBS ace. TOC @ 2670'. RD W/L. TOOH w/5 ½" csg. Ran GR-CBS sqz holes @ 350'. RD W/L. from Jim Lovato, BLM, no sc 000 psi, OK. Attempt to brk als pkr & TOOH. TIH w/mill to w/mill. TIH w/5 ½" csg patc n to 400 psi, OK. PT to 1500	L-GR-CCL @ 83 50'. RU W/L. L-CCL @ 2450' TIH w/pkr, se queeze & pate dwn sqz holes o 2450'. Dres h. Engage 5 : psi, OK. TIH	Chemical cut 5 %" '-surface. TOC @ et @ 264'. ch 5 %" csg to surface w/1000 psi. Cannot ss csg stub. Circ how csg stub w/csg pa
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/ @ 2300'-surf 5-1-00 MIRU. ND WH. N csg @ 2450'. 410'. Perf 2 5-2-00 (Verbal approval PT lines to 30 pump into. R clean. TOOH PT csg patch	Casing Repair Altering Casing X Other - mpleted Operations Gauge ring to 8116'. Ran CBS ace. TOC @ 2670'. RD W/L. TOOH w/5 ½" csg. Ran GR-CBS sqz holes @ 350'. RD W/L. from Jim Lovato, BLM, no sc 000 psi, OK. Attempt to brk Rls pkr & TOOH. TIH w/mill to w/mill. TIH w/5 ½" csg pate	L-GR-CCL @ 83 50'. RU W/L. L-CCL @ 2450' TIH w/pkr, se queeze & pate dwn sqz holes o 2450'. Dres h. Engage 5 : psi, OK. TIH	Chemical cut 5 ½" '-surface. TOC @ et @ 264'. ch 5 ½" csg to surfaces w/1000 psi. Cannot ss csg stub. Circ how csg stub w/csg page
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/ @ 2300'-surf 5-1-00 MIRU. ND WH. N csg @ 2450'. 410'. Perf 2 5-2-00 (Verbal approval PT lines to 30 pump into. R clean. TOOH PT csg patch	Casing Repair Altering Casing X Other - mpleted Operations Gauge ring to 8116'. Ran CBS ace. TOC @ 2670'. RD W/L. TOOH w/5 ½" csg. Ran GR-CBS sqz holes @ 350'. RD W/L. from Jim Lovato, BLM, no sc 000 psi, OK. Attempt to brk als pkr & TOOH. TIH w/mill to w/mill. TIH w/5 ½" csg patc n to 400 psi, OK. PT to 1500	L-GR-CCL @ 83 50'. RU W/L. L-CCL @ 2450' TIH w/pkr, se queeze & pate dwn sqz holes o 2450'. Dres h. Engage 5 : psi, OK. TIH	Chemical cut 5 ½" '-surface. TOC @ et @ 264'. ch 5 ½" csg to surface w/1000 psi. Cannot ss csg stub. Circ how csg stub w/csg pa
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/ @ 2300'-surf 5-1-00 MIRU. ND WH. N csg @ 2450'. 410'. Perf 2 5-2-00 (Verbal approval PT lines to 30 pump into. R clean. TOOH PT csg patch 5-3-00 M/O CIBP @ 435	Casing Repair Altering Casing X Other - mpleted Operations Gauge ring to 8116'. Ran CBS ace. TOC @ 2670'. RD W/L. TOOH w/5 ½" csg. Ran GR-CBS sqz holes @ 350'. RD W/L. from Jim Lovato, BLM, no sc 000 psi, OK. Attempt to brk als pkr & TOOH. TIH w/mill to w/mill. TIH w/5 ½" csg patc 1 to 400 psi,OK. PT to 1500 50'. Continue to clean out w	Water Shut of Conversion to Conversion to Conversion to Conversion to Conversion to Conversion to Conversion (Conversion Conversion to Conversion Conversi	Chemical cut 5 %" '-surface. TOC @ et @ 264'. ch 5 %" csg to surface w/1000 psi. Cannot ss csg stub. Circ how csg stub w/csg pa
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/ @ 2300'-surf 5-1-00 MIRU. ND WH. N csg @ 2450'. 410'. Perf 2 5-2-00 (Verbal approval PT lines to 30 pump into. R clean. TOOH PT csg patch 5-3-00 M/O CIBP @ 435	Casing Repair Altering Casing X Other - mpleted Operations Gauge ring to 8116'. Ran CBS ace. TOC @ 2670'. RD W/L. TOOH w/5 ½" csg. Ran GR-CBS sqz holes @ 350'. RD W/L. from Jim Lovato, BLM, no sc 000 psi, OK. Attempt to brk als pkr & TOOH. TIH w/mill to w/mill. TIH w/5 ½" csg patc n to 400 psi, OK. PT to 1500	L-GR-CCL @ 83 50'. RU W/L. L-CCL @ 2450' TIH w/pkr, se queeze & pate dwn sqz holes o 2450'. Dres h. Engage 5 psi, OK. TIH ellbore.	COEDIED FOR RECO
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/ @ 2300'-surf 5-1-00 MIRU. ND WH. N csg @ 2450'. 410'. Perf 2 5-2-00 (Verbal approval PT lines to 30 pump into. R clean. TOOH PT csg patch 5-3-00 M/O CIBP @ 435	Casing Repair Altering Casing X Other - mpleted Operations Gauge ring to 8116'. Ran CB: ace. TOC @ 2670'. RD W/L. TO BOP. TIH w/CIBP, set @ 43: TOOH w/5 %" csg. Ran GR-CB: sqz holes @ 350'. RD W/L. from Jim Lovato, BLM, no sc 000 psi, OK. Attempt to brk Rls pkr & TOOH. TIH w/mill to w/mill. TIH w/5 %" csg patc 1 to 400 psi,OK. PT to 1500 50'. Continue to clean out w	L-GR-CCL @ 83 50'. RU W/L. L-CCL @ 2450' TIH w/pkr, se queeze & pate dwn sqz holes o 2450'. Dres h. Engage 5 psi, OK. TIH ellbore.	off to Injection 110-2300' & GR-CCL Chemical cut 5 %" '-surface. TOC @ et @ 264'. ch 5 %" csg to surfaces w/1000 psi. Cannot compared to
Final Abandonment Describe Proposed or Co 3-15-00 RU W/L. TIH w/ @ 2300'-surf 5-1-00 MIRU. ND WH. N csg @ 2450'. 410'. Perf 2 5-2-00 (Verbal approval PT lines to 30 pump into. R clean. TOOH PT csg patch 5-3-00 M/O CIBP @ 435	Casing Repair Altering Casing X Other - mpleted Operations Gauge ring to 8116'. Ran CB: ace. TOC @ 2670'. RD W/L. TO BOP. TIH w/CIBP, set @ 43: TOOH w/5 %" csg. Ran GR-CB: sqz holes @ 350'. RD W/L. from Jim Lovato, BLM, no sc 000 psi, OK. Attempt to brk Rls pkr & TOOH. TIH w/mill to w/mill. TIH w/5 %" csg patc 1 to 400 psi,OK. PT to 1500 50'. Continue to clean out w	L-GR-CCL @ 83 50'. RU W/L. L-CCL @ 2450' TIH w/pkr, se queeze & pate dwn sqz holes o 2450'. Dres h. Engage 5 psi, OK. TIH ellbore.	CCEPTED FOR RECO