Form 3160-5 (August 1999)

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB NO. 1004-0135
Expires: November 30, 200

SUNDRY 1	OTICES AND REPORTS ON WELLS
Do not use this	form for proposals to drill or to re-enter an
shandoned well	Use form 3160-3 (APD) for such proposals

5. Lease Serial No. NMNM-101552

Do not uso this	OTICES AND KEPO		<b>.</b>	
apallubileu wen	s form for proposais to I. Use form 3160-3 (APE	drill or to re <del>-ente</del> r <del>an</del>	6. If Indian	, Allottee or Tribe Name
SUBMIT IN TRIPLICATE - Other instructions on reverse side.				or CA/Agreement, Name and/or No.
Type of Well			8. Well Na	me and No. DERAL 12-2
Oil Well Gas Well Other: COAL BED METHANE				II No.
2. Name of Operator RICHARDSON OPERATING COMPANY  Contact: JOHN WHISLER E-Mail: jwhisler@richardsonx			om 30-045	5-30712
Address	3b. Phone No. (include area code Ph: 303.830.8000	) 10. Field a	nd Pool, or Exploratory	
1700 LINCOLN, SUITE 1700 DENVER, CO 80203	Fx: 303.830.8009			
Location of Well (Footage, Sec., T.	)	1	11. County or Parish, and State	
Sec 12 T30N R14W NWSW 1	815FSL 828FWL		SAN	IUAN COUNTY, NM
12. CHECK APPI	ROPRIATE BOX(ES) TO	O INDICATE NATURE OF	NOTICE, REPORT, C	OR OTHER DATA
TYPE OF SUBMISSION			F ACTION	
	Acidize	☐ Deepen	☐ Production (Start/I	Resume) Water Shut-Off
☐ Notice of Intent	Actorize  Alter Casing	☐ Fracture Treat	☐ Reclamation	☐ Well Integrity
Subsequent Report	Casing Repair	☐ New Construction	☐ Recomplete	Other
<del>-</del>	Change Plans	☐ Plug and Abandon	☐ Temporarily Aban	don Well Spud
☐ Final Abandonment Notice	Convert to Injection		■ Water Disposal	
determined that the site is ready for	final inspection.)	act all y lists to require the many	·	completed, and the operator has
sesting has been completed. Final Adetermined that the site is ready for SPUD SUNDRY 9/17/01 MIRU AND SPUD WK-55 surface casing. Circulat Circulate cement to surface. 9/18/01 Install BOP and test 9/19/01 Drill 6 1/4" hole to 13/19/01 Drill 6 1/4" hole to 13/19/01 Drill 6 1/4" hole to 13/19/19/19/19/19/19/19/19/19/19/19/19/19/	VELL. Drill 8 3/4" hole to the Mix and pump 30 sx consing. Drill 6 1/4" hole to casing. Spendate. Spendate.	135'. Circulate hole. POOH. class H cement. Displace w/ to 660'. Circulate. SDFN.	RIH w/ 3 jt 7* 20# 3 bbls wa <del>te</del> r.	)
sesting has been completed. I that A determined that the site is ready for SPUD SUNDRY 9/17/01 MIRU AND SPUD WK-55 surface casing. Circulat Circulate cement to surface. 9/18/01 Install BOP and test 9/19/01 Drill 6 1/4" hole to 1/9/20/01 Drill 6 1/4" hole to 1/9/21/01 Circulate. LDDP. R	VELL. Drill 8 3/4" hole to the. Mix and pump 30 sx concessing. Drill 6 1/4" hole to day. Circulate. SDFN. 850' TD. Circulate. SDFRIH w/ 4 1/2" guide shoe,	135'. Circulate hole. POOH. class H cement. Displace w/ to 660'. Circulate. SDFN.  N. 1 jt 4 1/2" casing. Float chec.	RIH w/ 3 jt 7" 20# 3 bbls water. k, 26 jt 4 C-lite, cello	
sesting has been completed. I that A determined that the site is ready for SPUD SUNDRY 9/17/01 MIRU AND SPUD W K-55 surface casing. Circulate cement to surface. 9/18/01 Install BOP and test 9/19/01 Drill 6 1/4" hole to 13/9/20/01 Drill 6 1/4" hole to 13/9/21/01 Circulate. LDDP. R 1/2" 10.5# J-55 casing. Circulate.	VELL. Drill 8 3/4" hole to the. Mix and pump 30 sx of casing. Drill 6 1/4" hole to 340'. Circulate. SDFN. 850' TD. Circulate. SDFRIH w/ 4 1/2" guide shoe, ulate hole. Mix and pump 4 toil coment w/ 1/4# cello	135'. Circulate hole. POOH. class H cement. Displace w/ to 660'. Circulate. SDFN.  N. 1 jt 4 1/2" casing. Float chec. 95 sx class B cement w/2% flake. Displaced with 28 bbl	RIH w/ 3 jt 7" 20# 3 bbls water. k, 26 jt 4 C-lite, cello	
testing has been completed. I that A determined that the site is ready for SPUD SUNDRY 9/17/01 MIRU AND SPUD W K-55 surface casing. Circulate cement to surface. 9/18/01 Install BOP and test 9/19/01 Drill 6 1/4" hole to 13 9/20/01 Drill 6 1/4" hole to 13 9/20/01 Drill 6 1/4" hole to 15 9/21/01 Circulate. LDDP. R 1/2" 10.5# J-55 casing. Circulates. Pump 205 sx class B plug and test. Circulated 10	VELL. Drill 8 3/4" hole to the Mix and pump 30 sx of casing. Drill 6 1/4" hole to 340'. Circulate. SDFN. 850' TD. Circulate. SDFRIH w/ 4 1/2" guide shoe, ulate hole. Mix and pump 3 tail cement w/ 1/4# cello bbls cement to surface.	135'. Circulate hole. POOH. class H cement. Displace w/to 660'. Circulate. SDFN.  N. 1 jt 4 1/2" casing. Float chectory of the country of the	RIH w/ 3 jt 7" 20# 3 bbls water. k, 26 jt 4 C-lite, cello water and bump	30 30 30 30 30 30 30 30 30 30 30 30 30 3
sesting has been completed. I that A determined that the site is ready for SPUD SUNDRY 9/17/01 MIRU AND SPUD W K-55 surface casing. Circulate cement to surface. 9/18/01 Install BOP and test 9/19/01 Drill 6 1/4" hole to 13/2/20/01 Drill 6 1/4" hole to 13/2/21/01 Circulate. LDDP. R 1/2" 10.5# J-55 casing. Circulate.	VELL. Drill 8 3/4" hole to the. Mix and pump 30 sx of casing. Drill 6 1/4" hole to 340'. Circulate. SDFN. 850' TD. Circulate. SDFRIH w/ 4 1/2" guide shoe, ulate hole. Mix and pump 3 tail cement w/ 1/4# cello bbls cement to surface.	135'. Circulate hole. POOH. class H cement. Displace w/ to 660'. Circulate. SDFN.  N. 1 jt 4 1/2" casing. Float chect of 95 sx class B cement w/2% flake. Displaced with 28 bbl Casing set @ 1816'.	RIH w/ 3 jt 7" 20# 3 bbls water.  k, 26 jt 4 C-lite, cello water and bump	
sesting has been completed. I that Adetermined that the site is ready for SPUD SUNDRY 9/17/01 MIRU AND SPUD WK-55 surface casing. Circulate cement to surface. 9/18/01 Install BOP and test 9/19/01 Drill 6 1/4" hole to 13 9/20/01 Drill 6 1/4" hole to 13 9/20/01 Drill 6 1/4" hole to 15 9/21/01 Circulate. LDDP. R 1/2" 10.5# J-55 casing. Circulates. Pump 205 sx class B plug and test. Circulated 10	VELL. Drill 8 3/4" hole to the Mix and pump 30 sx of casing. Drill 6 1/4" hole to 340'. Circulate. SDFN. 850' TD. Circulate. SDFN. 81H w/ 4 1/2" guide shoe, ulate hole. Mix and pump 3 tail cement w/ 1/4# cello bbls cement to surface. (is true and correct.  Electronic Submission.	135'. Circulate hole. POOH. class H cement. Displace w/ to 660'. Circulate. SDFN.  N. 1 jt 4 1/2" casing. Float chect of 95 sx class B cement w/2% flake. Displaced with 28 bbl Casing set @ 1816'.	RIH w/ 3 jt 7" 20# 3 bbls water.  k, 26 jt 4 C-lite, cello water and bump	
testing has been completed. I that A determined that the site is ready for SPUD SUNDRY 9/17/01 MIRU AND SPUD W K-55 surface casing. Circulate Circulate cement to surface. 9/18/01 Install BOP and test 9/19/01 Drill 6 1/4" hole to 13 9/20/01 Drill 6 1/4" hole to 13 9/20/01 Drill 6 1/4" hole to 13 9/21/01 Circulate. LDDP. R 1/2" 10.5# J-55 casing. Circulates. Pump 205 sx class B plug and test. Circulated 10 Name (Printed/Typed) JOHN W	VELL. Drill 8 3/4" hole to the Mix and pump 30 sx of casing. Drill 6 1/4" hole to 340'. Circulate. SDFN. 850' TD. Circulate. SDFN. 81H w/ 4 1/2" guide shoe, ulate hole. Mix and pump 3 tail cement w/ 1/4# cello bbls cement to surface. (is true and correct.  Electronic Submission.	135'. Circulate hole. POOH. class H cement. Displace w/ to 660'. Circulate. SDFN.  N. 1 it 4 1/2" casing. Float chect of 95 sx class B cement w/2% flake. Displaced with 28 bbl Casing set @ 1816'.  1 #9749 verified by the BLM W. OPERATING COMPANY, service.	RIH w/ 3 jt 7" 20# 3 bbls water.  k, 26 jt 4 C-lite, cello water and bump	
testing has been completed. I that A determined that the site is ready for SPUD SUNDRY 9/17/01 MIRU AND SPUD W K-55 surface casing. Circulate cement to surface. 9/18/01 Install BOP and test 9/19/01 Drill 6 1/4" hole to 13/2/20/01 Drill 6 1/4" hole to 13/2/20/01 Drill 6 1/4" hole to 18/2/1/01 Circulate. LDDP. R 1/2" 10.5# J-55 casing. Circulates. Pump 205 sx class B plug and test. Circulated 10	VELL. Drill 8 3/4" hole to the Mix and pump 30 sx of casing. Drill 6 1/4" hole to 340'. Circulate. SDFN. 850' TD. Circulate. SDFN wildle hole. Mix and pump 30 stores and the stores of	135'. Circulate hole. POOH. class H cement. Displace w/ to 660'. Circulate. SDFN.  N. 1 it 4 1/2" casing. Float chect of 95 sx class B cement w/2% flake. Displaced with 28 bbl Casing set @ 1816'.  1 #9749 verified by the BLM W. OPERATING COMPANY, service.	RIH w/ 3 jt 7" 20# 3 bbls water.  k, 26 jt 4 C-lite, cello water and bump  ett Information System to the Farmington  RATIONS	
sesting has been completed. I that A determined that the site is ready for SPUD SUNDRY 9/17/01 MIRU AND SPUD WK-55 surface casing. Circulat Circulate cement to surface. 9/18/01 Install BOP and test 9/19/01 Drill 6 1/4" hole to 1/9/20/01 Drill 6 1/4" hole to 1/9/20/01 Drill 6 1/4" hole to 1/9/21/01 Circulate. LDDP. R 1/2" 10.5# J-55 casing. Circulates. Pump 205 sx class B plug and test. Circulated 10	VELL. Drill 8 3/4" hole to the Mix and pump 30 sx of casing. Drill 6 1/4" hole to 340'. Circulate. SDFN. 850' TD. Circulate. SDFN wildle hole. Mix and pump 30 stores and the stores of	135'. Circulate hole. POOH. class H cement. Displace w/ to 660'. Circulate. SDFN.  N. 1 jt 4 1/2" casing. Float chectory of the company of th	RIH w/ 3 jt 7" 20# 3 bbls water.  k, 26 jt 4 C-lite, cello water and bump  ett Information System to the Farmington  RATIONS	
sesting has been completed. I that A determined that the site is ready for SPUD SUNDRY 9/17/01 MIRU AND SPUD WK-55 surface casing. Circulat Circulate cement to surface. 9/18/01 Install BOP and test 9/19/01 Drill 6 1/4" hole to 13/2/01/01 Drill 6 1/4" hole to 13/2/20/01 Drill 6 1/4" hole to 13/2/20/01 Drill 6 1/4" hole to 13/2/20/01 Circulate. LDDP. R 1/2" 10.5# J-55 casing. Circulates. Pump 205 sx class B plug and test. Circulated 10/20/20/20/20/20/20/20/20/20/20/20/20/20	VELL. Drill 8 3/4" hole to the Mix and pump 30 sx of casing. Drill 6 1/4" hole to 340'. Circulate. SDFN. 850' TD. Circulate. SDFN wildle hole. Mix and pump 30 stores and the stores of	135'. Circulate hole. POOH. class H cement. Displace w/ to 660'. Circulate. SDFN.  N. 1 jt 4 1/2" casing. Float chectory of the company of th	RIH w/ 3 jt 7" 20# 3 bbls water.  k, 26 jt 4 C-lite, cello water and bump  ett Information System to the Farmington  RATIONS	