

1-28-96 WOC. Release pkr, TOOH. TIH to TOC @ 796'. Drill cmt @ 796-920'. Circ hole clean.
PT sqz holes @ 900' to 750 psi/15 min, OK. TIH to TOC @ 1455'. Drill cmt @
1455-1548'. Circ hole clean. PT sqz holes @ 1528' to 750 psi/15 min, OK. TIH, tag up
@ 1629'. Circ hole clean to RBP @ 1680'. TOOH. TIH w/retrieving tool, latch RBP, TOO
TIH to 1884'. Blow well & CO.

1-29-96 Blow well & CO. TOOH.

1-30-96 TIH w/retrieving tool, CO to RBP @ 4120'. Latch RBP, TOOH. TIH, blow well & CO.

1-31-96 Blow well & CO. Drill out CIBP @ 4540'. Blow well & CO. TOOH.

2-1-96 RU, ran after frac log @ 3550-4770'. RD. TIH, blow well clean. TIH w/151 jts 2 3/8"
4.7# J-55 tbg, landed @ 4731'. ND BOP. NU WH. RD. Rig released.

1-28-96 WOC. Release pkr, TOOH. TIH to TOC @ 796'. Drill cmt @ 796-920'. Circ hole clean. PT sqz holes @ 900' to 750 psi/15 min, OK. TIH to TOC @ 1455'. Drill cmt @ 1455-1548'. Circ hole clean. PT sqz holes @ 1528' to 750 psi/15 min, OK. TIH, tag up @ 1629'. Circ hole clean to RBP @ 1680'. TOOH. TIH w/retrieving tool, latch RBP, TOO TIH to 1884'. Blow well & CO.

1-29-96 Blow well & CO. TOOH.

1-30-96 TIH w/retrieving tool, CO to RBP @ 4120'. Latch RBP, TOOH. TIH, blow well & CO.

1-31-96 Blow well & CO. Drill out CIBP @ 4540'. Blow well & CO. TOOH.

2-1-96 RU, ran after frac log @ 3550-4770'. RD. TIH, blow well clean. TIH w/151 jts 2 3/8" 4.7# J-55 tbg, landed @ 4731'. ND BOP. NU WH. RD. Rig released.