

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

5. LEASE DESIGNATION AND SERIAL NO.
NM-58887

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Newco

9. WELL NO.
100

10. FIELD AND POOL, OR WILDCAT
Basin Fruitland Coal

11. SEC., T., R., M., OR S.E. AND
SURVEY OR AREA
SEC. 20, T32N, R09W
NMPM

12. COUNTY OR PARISH
San Juan

13. STATE
NM

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR
Meridian Oil Inc.

3. ADDRESS OF OPERATOR
P.O. Box 4289 Farmington, New Mexico 87499

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface 1630'S, 1640'W

14. PERMIT NO.
15. ELEVATIONS (Show whether DF, RT, GR, etc.)
6778' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

5-16-89 MOL RU. Nd tree. Nu bop. Pull donut. Tbg Free. Tooh w/2 3/8" tbg, F-nip & exp chk. Tih w/bit to 3296'. Unload hole. Clean out to 3419'. Pull 10 stds inside csg to 2700'. Tih w/bit. Tag fill @ 3481'. Tooh w/bit. Tih w/ 2 3/8" exp chk, F-nip, & tbg. Landed tbg @ 3577', F-nip @ 3545'. Nd bops, Nu tree. Pump off chk. Circ. Nd tree. Nu bop. Pull donut, work tbg. Unload hole. Pull 10 stds of tbg into csg @ 2970'. Tih to 3573'. Unload hole. Clean out to btm @ 3598'. Land tbg @ 3577', F-nip @ 3545'. Nd bops. Nu wh.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Regulatory Affairs

ACCEPTED FOR RECORD
DATE

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

FARMINGTON RESOURCE AREA

BY

SMN

*See Instructions on Reverse Side