In Lieu of Form 3160-5 (June 1990)


# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

 
FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993

Do not use this form for proposals to drill or to deepen o PERMIT—" for such proposals	AND REPORTS ON WELLS r reentry to a different reservoir. Use "APPLICATION FOR	Lease Designation and Serial No.     14-20-603-585      If Indian, Allottee or Tribe Name     Navajo	
SUBMIT IN TRIPLICATE		7. If Unit or CA, Agreement Designation	
1. Type of Well ☑ Gas Well ☑ Other		8. Well Name and No. Navajo AA No. 8	
Name of Operator     21st Century Investment Corp.		9. API Well No. 30-045-114.30	
<ol> <li>Address and Telephone No. C/O Walsh Engineering &amp; Production Corp.</li> <li>7415 East Main Farmington, NM 87402 505-327-4892</li> </ol>		10. Field and Pool, or Exploratory Area North Many Rocks Gallup	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)  943' FSL & 840' FWL, Sec. 17, T32N, R17W		11. County or Parish, State San Juan, NM.	
	IATE BOX(s) TO INDICATE NATURE OF NOTICE, REPO	ORT, OR OTHER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION		
<ul><li>☒ Notice of Intent</li><li>☐ Subsequent Report</li></ul>	☒ Abandonment       ☐ Change of Plans         ☐ Recompletion       ☐ New Construction         ☐ Plugging Back       ☐ Non-Routine Fracturing         ☐ Casing Repair       ☐ Water Shut-Off		
☐ Final Abandonment	☐ Altering Casing ☐ Other	☐ Conversion to Injection ☐ Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	
is directionally drilled, give subsurface locat	(Clearly state all pertinent details, and give pertinent dates, incions and measured and true vertical depths for all markers and is to plug and abandon the above mentioned well	zones pertinent to this work.)*	
	DEC 1 S TELS		
	<b>©</b> [	OIL GOD. DIV. Div. 3	
14. I hereby certify that the foregoing is true and Signed	Correct  (John C. Thompson) Title Agent	Date <u>12/05/96</u>	
(This space for Federal or State office use)		APPROVED	
Approved by	Title	Date	

Navajo AA No. 8 943' FSL & 840' FWL Sec 17 T32N R17W


#### P&A Status

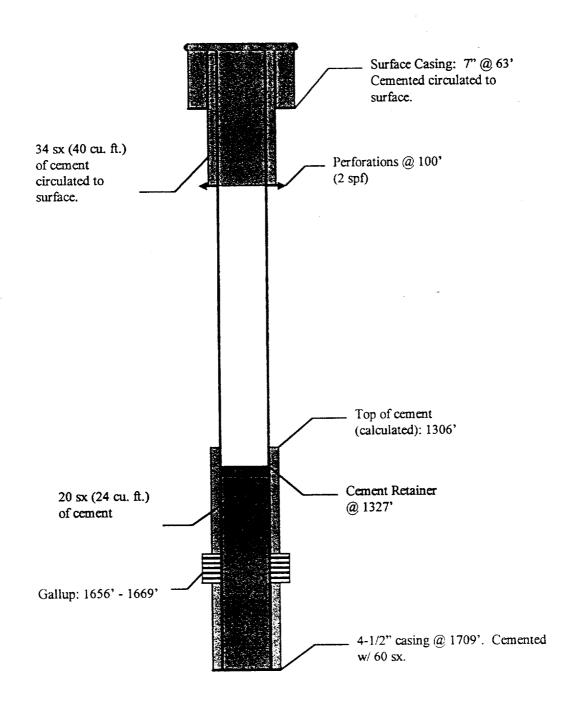



### Navajo AA No. 8 943' FSL & 840' FWL Sec 17 T32N R17W

Current Status

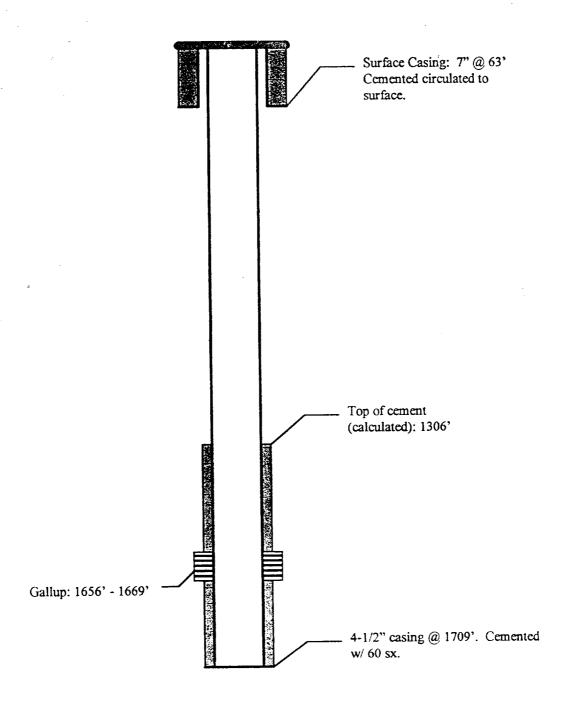

REÇEN!

95020-5 11. 1.02

## Plug & Abandon Procedure for 21st Century Investment Corp. Navajo AA #8

Location: Section 17 T32N R17W

San Juan County, New Mexico

Date: December 5, 1996

#### Procedure:

- 1. MOL & RU pulling unit. Haul in 2-3/8" work string. Hold safety meeting.
- 2. Blow well down and ND tubing head and NU BOP. Lay 2-3/8" flow line to pit. Pressure test BOP.
- 3. Lay down rods and/or tubing. Note: Records do not indicate what type of production strings are currently in the hole, ie. tubing, rods, pumps, etc.
- 4. PU cement retainer & TIH on 2-3/8" tubing. Set cement retainer at 1327' (100' above Gallup perforations).
- 5. Mix and pump 20 sx (24 cu.ft.) of cement. Sting out of cement retainer & TOH.
- 6. Perforate 2 holes in 4-1/2" casing at 100'.
- 7. Circulate 34 sx (40 cu. ft.) of cement down 4-1/2" and up 7" x 4-1/2" annulus through perfs at 100'.
- 8. ND BOP and cut off well head below surface casing. Install P&A marker. Rig down & release rig.
- 9. Clean location and restore as per BLM requirements.

Note: All cement volumes are calculated w/ 100% excess.

John C. Thompson

Engineer