UNITED STATES

DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

	ces and Reports on Well	2 1 25 F	
. Type of Well	07	() [] [] [] [] [] [] [] [] [] [Lease Number NM-24667 If Indian, All. o
GAS			Tribe Name
	(5)	678 9 7.	Unit Agreement Na
Name of Operator			
RESOURCES OIL S		IG 2000 CEIVIED CON. DIV DIST. S	
TESOS OTTO	د د د د د د د د د د د د د د د د د د	CEIVED E	Well Name & Numbe
. Address & Phone No. of Operat	or 🔀	DIET. S	State Line #1
PO Box 4289, Farmington, NM	87499 (505) 32 700	9.	API Well No.
		2527712 10	30-045-23884
. Location of Well, Footage, Se 1100'FNL, 940'FWL, Sec.13, T-	2., T, R, M	200000000000000000000000000000000000000	. Field and Pool Basin Dakota
1100°FNL, 940°FWL, Sec.13, 1	52 H, K 15 H, Half	11	
2. CHECK APPROPRIATE BOX TO IND	ICATE NATURE OF NOTICE	, REPORT, OTHE	R DATA
Type of Submission	Type of Ac		
Notice of Intent	_X_ Abandonment _	Change of P	
Gular ment Bonort		New Constru- Non-Routine	
Subsequent Report		Water Shut	
X Final Abandonment	Altering Casing		
	Other -		
3. Describe Proposed or Compl	oted Operations		
3. Describe Proposed or Compl	eted operations		
7-13-00 MIRU. ND WH. NU BO		TIH w/gauge ri	ng to 4600'. Set
4 ½" CIBP @ 4567		OV Dl. #1	
7-14-00 Tag CIBP @ 4567'.	PT csg to 500 psi/5 mi ide csg @ 4567-4409'.		
	3801-3630'. Plug #3:		
amt incide cea a	. Plug #4: pump 29 sx	Class "B" neat	cmt inside csg @
cmt inside csg @ 3158-2835'	1 1 6 5454 71 111	5: pump 190 sx	Class "B" neat cmt
csq @ 3158-2835'	noies @ 547'. Plug #5		•
csg @ 3158-2835' to 1444'. Perf 3 7" csg @ 547'-su	rface. Circ 1 bbl cmt	to surface. ND	BOP. Dig out & cu
csg @ 3158-2835' to 1444'. Perf 3 7" csg @ 547'-su WH. Install dry	rface. Circ 1 bbl cmt hole marker w/15 sx C	to surface. ND lass "B" cmt. R	BOP. Dig out & cu D. Rig released. (
csg @ 3158-2835' to 1444'. Perf 3 7" csg @ 547'-su WH. Install dry	rface. Circ 1 bbl cmt	to surface. ND lass "B" cmt. R	BOP. Dig out & cu D. Rig released. (
csg @ 3158-2835' to 1444'. Perf 3 7" csg @ 547'-su WH. Install dry	rface. Circ 1 bbl cmt hole marker w/15 sx C	to surface. ND lass "B" cmt. R	BOP. Dig out & cu D. Rig released. (
csg @ 3158-2835' to 1444'. Perf 3 7" csg @ 547'-su WH. Install dry	rface. Circ 1 bbl cmt hole marker w/15 sx C	to surface. ND lass "B" cmt. R	BOP. Dig out & cu D. Rig released. (
csg @ 3158-2835' to 1444'. Perf 3 7" csg @ 547'-su WH. Install dry	rface. Circ 1 bbl cmt hole marker w/15 sx C	to surface. ND lass "B" cmt. R	BOP. Dig out & cu D. Rig released. (
csg @ 3158-2835' to 1444'. Perf 3 7" csg @ 547'-su WH. Install dry	rface. Circ 1 bbl cmt hole marker w/15 sx C	to surface. ND lass "B" cmt. R	BOP. Dig out & cu D. Rig released. (
csg @ 3158-2835' to 1444'. Perf 3 7" csg @ 547'-su WH. Install dry	rface. Circ 1 bbl cmt hole marker w/15 sx Ci vas on location.) Well	to surface. ND lass "B" cmt. R plugged and ab	BOP. Dig out & cu D. Rig released. (
csg @ 3158-2835' to 1444'. Perf 3 7" csg @ 547'-su WH. Install dry Ruybalid, BLM, v	foregoing is true and	to surface. ND lass "B" cmt. R plugged and ab correct.	BOP. Dig out & cu D. Rig released. (condoned on 7-14-00
csg @ 3158-2835' to 1444'. Perf 3 7" csg @ 547'-su WH. Install dry Ruybalid, BLM, v	rface. Circ 1 bbl cmt hole marker w/15 sx Ci vas on location.) Well	to surface. ND lass "B" cmt. R plugged and ab correct.	BOP. Dig out & cu D. Rig released. (condoned on 7-14-00
csg @ 3158-2835' to 1444'. Perf 3 7" csg @ 547'-su WH. Install dry Ruybalid, BLM, v	frace. Circ 1 bbl cmt hole marker w/15 sx Ci as on location.) Well foregoing is true and Title Regulator	to surface. ND lass "B" cmt. R plugged and ab correct.	BOP. Dig out & cu.D. Rig released. (bondoned on 7-14-00) Date 8/1/00