

U. S. A. #2 - FRTC RECOMPLETION PROCEDURE
Page 2

9. TIH w/notched collar on 2-3/8" tbg & C.O. to 1850' w/air/mist. Take pitot gauges when possible.
10. When wellbore is sufficiently clean, TOH and run after frac gamma-ray log from 1850'-1000'.
11. TIH with 2-3/8" tbg with standard seating nipple one joint off bottom. Land tbg @ 1800'. Take final pitot gauges, water samples, and gas samples.
12. Replace bad valves on wellhead w/rebuilt valves. ND BOP and NU wellhead. Rig down & release rig.

Approved: _____
J. A. Howieson

VENDORS:

Wireline:	Blue Jet	325-5584
Frac & Cmt:	Smith	327-8172
RA Tagging:	Pro-Technics	326-7133

PMP