



STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT  
OIL CONSERVATION DIVISION  
AZTEC DISTRICT OFFICE

BRUCE KING  
GOVERNOR  
LARRY KEHOE  
SECRETARY

JUNE 2, 1981

1000 RIO BRAZOS ROAD  
AZTEC, NEW MEXICO 87410  
(505) 334-6178

Mr. Ernest Padilla  
Oil Conservation Division  
P.O. Box 2088  
Santa Fe, New Mexico

Re: Elvis L. Roberts    Bergin #1    F-21-29N-11W

Dear Ernie:

Order R-6153 directed that the referenced well be plugged and abandoned. The operator has not plugged the well during the allotted time and we have allowed more than ample time past the required date of plugging.

I recommend that this well be included in our next plugging contract.

A plugging procedure is attached.

Yours truly

Frank T. Chavez  
District Supervisor

XC: Travelers Ins. Co. , Two North Park Place, Dallas Texas 75231  
Attention: Kathy Franklin  
Brock, Waters, and Pigg, P.O. Box 10305, Lubbock, Texas 79408

Plugging procedure for Elvis Roberts Bergin #1

1. Clean out to 750'.
2. Perforate 750' and circ. cement to 600' inside and outside of pipe.
3. Set cement plug from 350' to 450' inside outside of pipe.
4. Set cement plug 50'-150' inside and outside pipe.
5. Set 10 sack surface plug and marker.
6. Level pits and clean location.

Presumed downhole equipment

8 5/8" casing @ 100' w/75 sx  
5 1/2" casing @ 1621' w/200 sx TOC @ 1264'  
PBTD 1251' CIBP w/5 sx  
2 7/8" tubing @ 500' W/Lane Wells pkr  
1" tubing @ 500'

There is no cement behind pipe above 1264'. Well is producing through a casing failure @ 740".

