

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

5a. Indicate Type of Lease  
State ☐ Fee ☒  
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Hare & McCoy Bloomfield Oilfield Service	8. Farm or Lease Name Hare & McCoy
3. Address of Operator P. O. Box 1641 Bloomfield, N.M. 87413	9. Well No. H. L. Hare # 2
4. Location of Well UNIT LETTER B, FEET FROM THE LINE AND FEET FROM THE LINE, SECTION 23 TOWNSHIP 29 N RANGE 11 W NMPM.	10. Field and Pool, or Wildcat Bloomfield-Farmington
15. Elevation (Show whether DF, RT, GR, etc.)	12. County 59

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

8-4-80 Move P & A, rig on location and rig up, trip in hole to 87', drill out junk, boards and cans with 3 7/8 bit to 802' mix and spot 30 sks Class "A" cement @ 802' to 640', w.o.c. 4 hrs tag cement @ 623', shot csg @ 150' mix and spot 30 sks Class "A" cement @ 180' w.o.c. 4 hrs trip in hole with bit to tag cement, no bridge, mix and spot 30 sks Class "A" cement + 2% cal. clo. @ 180' w.o.c. overnight, tag cement @ 90', mix 10 sks Class "A" cement and pump in surface, cut 7" and 10" csg off 3' below ground level, weld on cap, level and clean up location, ready for inspection 8-8-80.



18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED D. E. Bayler TITLE partner DATE 8-12-80

Original Signed by CHARLES GHOLSON

DEPUTY OIL & GAS INSPECTOR, DIST. #3

DATE AUG 1 1980

APPROVED BY  
CONDITIONS OF APPROVAL, IF ANY: