

Submit 3 Copies To Appropriate District Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised March 25, 1999

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. <b>30-025-22935</b>
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: <b>Keohane</b>
8. Well No. <b>3</b>
9. Pool name or Wildcat <b>Weir; Blincoy, East</b>

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator

**Penroc Oil Corporation**

3. Address of Operator

**P.O. Box 2769 Hobbs, NM 88241**

4. Well Location

Unit Letter **K** : **1650** feet from the **South** line and **1800** feet from the **West** line

Section **6**

Township **20S** Range **38E** NMPM

County **Lea**

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETIONS ☐

OTHER: PLUGGING OPERATIONS FOR THE C-103 ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐ MUST BE NOTICED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 ☐

OTHER: ☐

2. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

**9 5/8" 36" @ 852' - 13 3/4" hole w/ 300 SXS. 7" 23 & 26" @ 7500' - 8 3/4" hole w/ 650 SXS.**

**Blincoy Puffs: 5922-64'**

**① Set CIBP @ 5875' w/ 35' cement on top - w/ bailer**

**② Spot 25 SX cement plug @ 5483'**

**③ Determine free point - cut & pull 7" CSG @ est. 4000'**


**④ Spot 35 SX cement plug 50' in & 50' out of CSG stub. WOC & tag.**

**⑤ Spot 35 SX cement plug @ 1530'**

**⑥ Spot 35 SX cement plug @ 902' - WOC & tag**

**⑦ Spot 35 SX cement plug @ 350' WOC & tag**

**⑧ Spot 20 SX cement plug @ 60' to surface. Install DH Marker. Clean up.**

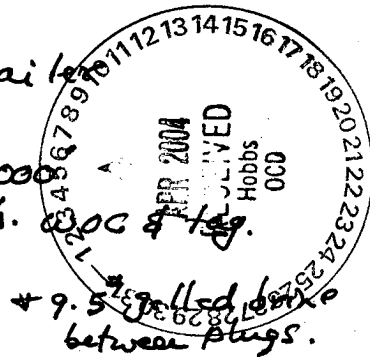

whereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE **M. Y. (Merck) Merchant** TITLE **President** DATE **4/6/04**

or print name **M. Y. (Merck) Merchant**

is space for State use)

Telephone No. **505 492-1236**

APPROVED BY **Mary W. Wink** TITLE **OC FIELD REPRESENTATIVE II/STAFF MANAGER**

conditions of approval, if any:

DATE **APR 05 2004**