

Submit 1 Copy To Appropriate District

Office

District I - (575) 393-6161  
1625 N. French Dr., Hobbs, NM 88240

District II - (575) 748-1283

811 S. First St., Artesia, NM 88203  
District III - (505) 334-6178

1000 Rio Brazos Rd., Aztec, NM 87410

District IV - (505) 476-3460

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico

Energy, Minerals and Natural Resources

Form C-103

Revised July 18, 2013

FEB 16 2015

RECEIVED

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe, NM 87505

WELL API NO. 30-025-28551
5. Indicate Type of Lease <b>FEDERAL</b> STATE <input type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name <b>Harris Federal</b>
8. Well Number <b>#1</b>
9. OGRID Number <b>3474</b>
10. Pool name or Wildcat <b>SWD: Delaware</b>

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☐ Other **SWD**

2. Name of Operator  
**State of New Mexico formerly CW Trainer**

3. Address of Operator  
**1625 N. French Drive Hobbs, NM 88240**

4. Well Location  
Unit Letter **O** : **660** feet from the **South** line and **1980** feet from the **East** line  
Section **5** Township **22S** Range **34E** NMPM County **Lea**

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check ☒ E-PERMITTING  
☒ P&A NR  
☒ DHC COMP  
☒ CSNG  
☒ TA

☒ INT to PA  
☒ P&A R  
☒ CHG Loc

☒ RBDMS

Describe Nature of Notice, Report or Other Data

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☒  
CASING/CEMENT JOB ☐

OTHER: ☐

Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

**3-13-13 MIRU Basic Plugging Services**

Bleed pressure off tubing. Injection packer found at 5654'. Squeeze 100 sx cement down tubing. Cut tubing off at 5440'. Spot 25 sx cmt at 5440'. WOC. Tag at 5300'. POOH to 4864'. Spot 50 sx cmt. Tag at 4560'. POOH to 3559'. Spot 50 sx cmt. WOC. Tag at 3339'. POOH to 1669'. Spot 50 sx cmt. WOC. Tag at 1512'. Perf at 1171'. Unable to pump in. GIH to 1226'. Spot 40 sx. WOC. Tag at 1035'. POOH to 974'. Spot 30 sx cmt. WOC. Tag at 777'. Perf at 300'. Squeeze with 100 sx cmt. Circulate cmt to surface.

**3-22-13 Fill casing to surface with cmt. Cut off wellhead and install P&A marker.**

Spud Date:

**MIRU 03-13-2013**

Rig Release Date:

**RDMO 03-22-2013**

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

Type or print name \_\_\_\_\_ E-mail address: \_\_\_\_\_ PHONE: \_\_\_\_\_

**For State Use Only**

APPROVED BY: *Michael P. [Signature]* TITLE **Compliance Officer** DATE **02-16-2015**

Conditions of Approval (if any):

**FEB 17 2015**