Submit 1 Copy To Appropriate District	State of New M		Form C-	
District I - (575) 393-6161	Energy, Minerals and Natural Resources OIL CONSERVATION DIVISION 1220 South St. Francis Dr.		Revised July 18, 2013 WELL API NO. 30-025-20577	
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283				
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178			5. Indicate Type of Lease	
1000 Rio Brazos Rd., Aztec, NM 87410			STATE FEE	
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Santa I C, IVIVI C	STOOS OCD	6. State Oil & Gas Lease No.	
87505	H	OBBS OCD		
SUNDRY NOTIC (DO NOT USE THIS FORM FOR PROPOSA DIFFERENT RESERVOIR. USE "APPLICA	ALS TO DRILL OR TO DEEPEN OR P	LUGBACK TO A	7. Lease Name or Unit Agreement Nan Cotton Tree State SWD	ne
PROPOSALS.) 1. Type of Well: Oil Well G	Gas Well 🔲 Other: Salt Water		8. Well Number 1	
2. Name of Operator	las well Other. Sait water	Disposal	9. OGRID Number	
Judah Oil, LLC			245872	
3. Address of Operator		Contraction of the second	10. Pool name or Wildcat	
P. O. Box 568, Artesia, NM 88211-0	568		SWD; Bell Canyon- Cherry Canyon	1
4. Well Location	and the second se			1
Unit LetterF:_	feet from the	Northline and		V
Section 32	Township 25S	Range 32E	NMPM Lea County	
	11. Elevation (Show whether D	<i>R</i> , <i>RKB</i> , <i>RT</i> , <i>GR</i> , <i>etc.</i>)		
12. Check Ap	ppropriate Box to Indicate 1	Nature of Notice, 1	Report or Other Data	
NOTICE OF INT	ENTION TO:	SUBS	SEQUENT REPORT OF:	
ERFORM REMEDIAL WORK D PLUG AND ABANDON REMEDIAL WOR			ALTERING CASING	
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRI	LING OPNS. PAND A	
	MULTIPLE COMPL	CASING/CEMENT	JOB 🗌	
OTHER:	tad anomations (Clearly state al	OTHER: Re-Entry	& Deepen 🛛 I give pertinent dates, including estimated	data
			appletions: Attach wellbore diagram of	adate
proposed completion or recor		C. For Multiple Con	ipietions. Attach wendore diagram of	
proposed completion of record				
Please See Attached				
pud Date:	Rig Release I	Date:		
Jud Date.		Juic.		
		a Martin Contra		
hereby certify that the information ab	have is true and complete to the	hest of my knowledge	and balief	
hereby certify that the information at	Sove is true and complete to the	best of my knowledge	e and bener.	
$() \mathcal{D} /$				
IGNATURE CALL	TITLE n	nember/manager	DATE 1/19/2016	
				1
ype or print name James B. Cam	panella E-mail address:	jbc@judahoil.com	PHONE: <u>575-748-4730</u>	
or State Use Only				
	Pr Pr	etroleum Engineer	DATE OUZA	11
APPROVED BY:	TITLE	Survey	DATE Offen	10
Conditions of Approval (if any):				V
			JAN 2 2 2016	0
			IAN 2 2 LUIU	V

.

JUDAH OIL, LLC Oil and Gas Operating

Dailey report on the Cotton Tree State #1 SWD API #30-025-20577 1980' FNL, 1980' FSL, Section 32, Township 25 South, Range 32 E, Lea County, New Mexico NM Permit # SWD 1583

<u>11-24-2015</u> Moved in RDL and started location prep.

12-1-2015

Welded on 7-5/8 wellhead. End of report

<u>12-2-2015</u>

Moved in reentry equipment and rigged up well service rig. Set 2 frac tanks and filled with 10# Brine water, filled up Re-circulating pit with Brine water, set up light towers and drill pipe. End of report

12-3-2015

NU BOP and tested. PU bit, drill collar and swivel. Started reenter @ 10:00 am MDT Drilled surface plug to 54'. PU drill collars and tagged #2 plug @ 318' drilled plug, washing down tubing to #3 plug @1000'. Did not tag. Washed down to 4210', loosing 15 bwpd, mixed mud w/ paper, vis-55, mud wt-10.1. Continued washing down to 4210', did not tag #4 plug. Continued washing down. End of report

12-4-2015

4457' Washing down. Continued washing down hole. Loosing 30 bwph mixed mud w/paper to slow down water loss. Did not tag plug #5 at 4524'. Washed down to 4624' (original TD). Ran Dev survey Dev 2.2°. POH and laid down 6 3/4 mill bit. Cleaned out circulating pit and changed to brine water. TIH w/ 6 3/4 Button Cone Bit, 4.5" x 18" x/o sub, 20-4.5" drill collars, 4.5" x 3 1/2" coller to DP x/o, 127 jnts 3 1/2" DP. PU swivel. 10:00 pm started drilling new formation. Bit weight- 18K, PP-800#, drilling with Brine water. Drilling @ 14' ph. End of report.

12-5-2015

4755' Drilling. Loosing 20 bwph. Mixed mud Vis-55. Drilling @ 17 fph. End of report.

<u>12-6-2016</u>

5065' Drilling. 16 fph. BW- 18 points, PP-820#. Loosing 5 bwph. Ran Dev survey @ 5134' Dev 1°. End of report.

<u>12-7-2015</u>

5337' Drilling. Loosing 5 bwph. Vis-36, MW-10.1#, ph-7.5, WL-33.2 cc, PP-850#, 78 rpm. 15 fph. End of report.

12-8-2015

5561' Drilling. Drilling 6 fph. TOH w/ pipe. Laid down 6 Collars. Bit and bit sub left in hole. Called WRH for fishing tools. 3:00 pm PU RIH w/ 5 1/8 overshot, bumper sub, 14 collars, x/o and DP. Tagged @ 5547', PU swivel and washed over 14' fill. Worked over fish, TOH. No fish, TIH with 5 1/8 overshot, bumper sub, 14 collars, x/o, DP.

Pg-1

Cotton Tree State SWD #1 re-entry Cont

<u>12-9-2015</u>

Tagged @ 5513'. PU Swivel and washed to fish. Heavy returns, circ for 30 min and worked over fish. TOH with pipe, no fish. SION End of Report.

<u>12-10-2015</u>

5561' Fishing Bit. Schlumberger fisherman on location. Looked at overshot used and ordered fishing tools. 10:30 am PU RIH w/ cut lip, Grapple, Knuckle Joint, x/o, 168 joints DP. Tagged @ 5504' (57' fill). PU swivel and washed down to fish. Could not get over fish, TOH w/pipe and overshot. Cleaning pits and replacing w/ 10# Brine. 7:00 pm SION. End of report.

<u>12-11-2015</u>

5561' Setting plug. Par 5 Cementing on location. TIH with 180 jnts DP to 5510'. RU Cement truck, established circ and pumped 10 bbls fw pad. 60 sx class "C" cement plug, 10 bbl fw flush, 40 bbls brine for balance. Pulled 10 stands and flushed with brine, TOH w/ tbg SIOW. End of report.

12-13-2015

5561' Side Tracking. TIH w/ 14 stands and laid down. PU 6 3/4 Varel button bit, down hole motor, 2-Leam Direction Tools collars, calibrated directional tool, 14 WRH collars, x/o DP. Hit several tight spots, worked tight areas, tagged @ 5177', drilled 8' cement, started SIDETRACK @ 8:30 pm.

12-14-2015

5212' Side Tracking. Tried to put weight on bit, PU RIH with 5 jnts and tagged @ 5386'. Restarted sidetrack. Drilled 10' cement and kicked off, 4:30 am finished sidetrack @ 5407' Dev 2.9°. Drilling 15 fph. End of report.

12-15-2015

5452' Drilling. Drilling ahead. Loosing 10 bwph, drilled 5452' to 5795'. Last hour drilling 6 fph. Circ 5 gal MS-55 prepare to TOH. End of Report.

12-16-2015

5795' Tripping for bit change. Pulled up 22' and tubing stuck. Ordered pipe release chemical and 50 bbls oil. RU JSI wireline to run stretch test. DP stuck @ 502'. Circ pipe release chem. w/ 50 bbls oil. Would not work loose. Pulled 20 points over and left SION. End of report.

12-17-2015

5773' Pipe stuck. Pipe came free at 500' but was stuck lower. Ordered Vibration truck, did not show up. SION End of report.

12-18-2015

5773' Pipe stuck. Tried to circulate, pump pressured to 1500#s. RU Layne Vibration Tech. Started vibration tool @ 10:00 am. 5:30 pm no movement. RD vibration tools. SION End of report.

12-19-2015

5773' Fishing. WRH delivered fishing equipment. RU Rotary Wireline (RWL) and ran free-point. Top of BHA @ 5260'. Free-point @ 4638. Backed off @ 4606'. PU swivel and circulated. Laid down swivel tried to pull, tubing stuck. RIH w/ free-point, tubing stuck @ 485'. Backed off tubing @ 331' and POH. RIH w/ 200'-7 5/16 washover pipe with flat cut-rite shoe, jars, 4- 4 1/2" collars, 1 jnt DP. PU swivel and tagged up @ 496', washed over to 558', circ for 20 minutes and TOH. PU RIH with overshot, jars, 4 collars, and DP. On fish @ 11:30 pm. Pipe stuck, jarred on pipe for 7 hrs, no movement. Called RWL for free-point. End of report.

12-20-2016

331' Fishing. 9:00 am RU RWL and ran free-point. Pipe free @ 642', backed off @ 611'. Pumped 50 bbl oil pill w/ 55 gal pipe release, TOH w/pipe and fish, TIH w/ BHA and DP. Washed over fish, pipe stuck, called RWL to ran free-point, pipe stuck @ 1273', backed off @ 1205', TOH with Fish. Waited on overshot swedge. PU and RIH w/ 200' washpipe, x/o swedge, Overshot, jars, 4-collars and DP. End of report.

Cotton Tree State SWD #1 re-entry cont.

12-21-2015

1205" Fishing. Washing over fish, latched onto fish w/overshot, tbg stuck, called RWL. RIH w/ free-point, Pipe free @3964', backed off @ 3964'. TOH with fish, TIH with BHA and DP. Washed over and latched onto fish, tbg stuck. Jarred for 1 hours, no movement, called RWL. End of report.

12-22-2015

3964' Fishing. RU RWL, ran free-point, pipe free @ 4244', backed off @ 4244' and TOH with fish. TIH with 6 3/4 bit, jars, 4 collars and DP. Worked tight spots. TOH w/ bit and picked up and TIH w/ 300' washover pipe, BHA and DP. Tagged up at 4270', washed over 18' in 6 hrs. TOH. Cut shoe looks good. SION End of report.

12-23-2015

4270' Fishing. TIH w/ cut shoe with 4" cut, 60' washover pipe, jars, 4 collars and drill-pipe. Tagged @ 4270', PU swivel and washed down 6'. Very slow washing over, TOH with washover equipment. Cut-rite on cut shoe was very badly worn. 2:00 pm. SI for Christmas holiday and weekend. End of report.

1-4-2016


4270' Fishing. PU 60' washover pipe, overshot, jars, and DP. Tagged tight spot @ 580', PU swivel and worked tight spot, laid down swivel and TIH to 4270. Tried to get over fish but was unable too. Pipe is laying over in salt and overshot won't go over fish. Ordered a sidewall hook from WRH. End of report.

1-5-2016

4270' Fishing. 9:00 am. PU RIH w/ 6 1/2" sidewall hook, overshot, bumper sub, bent joint, GP. RIH to 3781 Hit tight spot, rotated tubing and worked through tight spot, tried to catch fish at 4244. Didn't feel any tag, tagged at 4270, rotated pipe but couldn't catch pipe. Worked tool up and down pipe area but was unable to catch. TOH with Fish tools and laid down DP pipe. Released all equipment, cleaned circ pit and 1/2 round solids pit. ND 5000# Hydraulic BOP and NU 3000 # BOP. Released Pulling Unit. Will submit plugging procedure to OCD. End of report.

pg-3

Judah Oil, LLC 1805 W Jacobs Ave P.O. Box 568 Artesia, New Mexico 88211-0568 Office; (575)748-4730 Fax; (575)748-4731 Cell; (575)748-5488

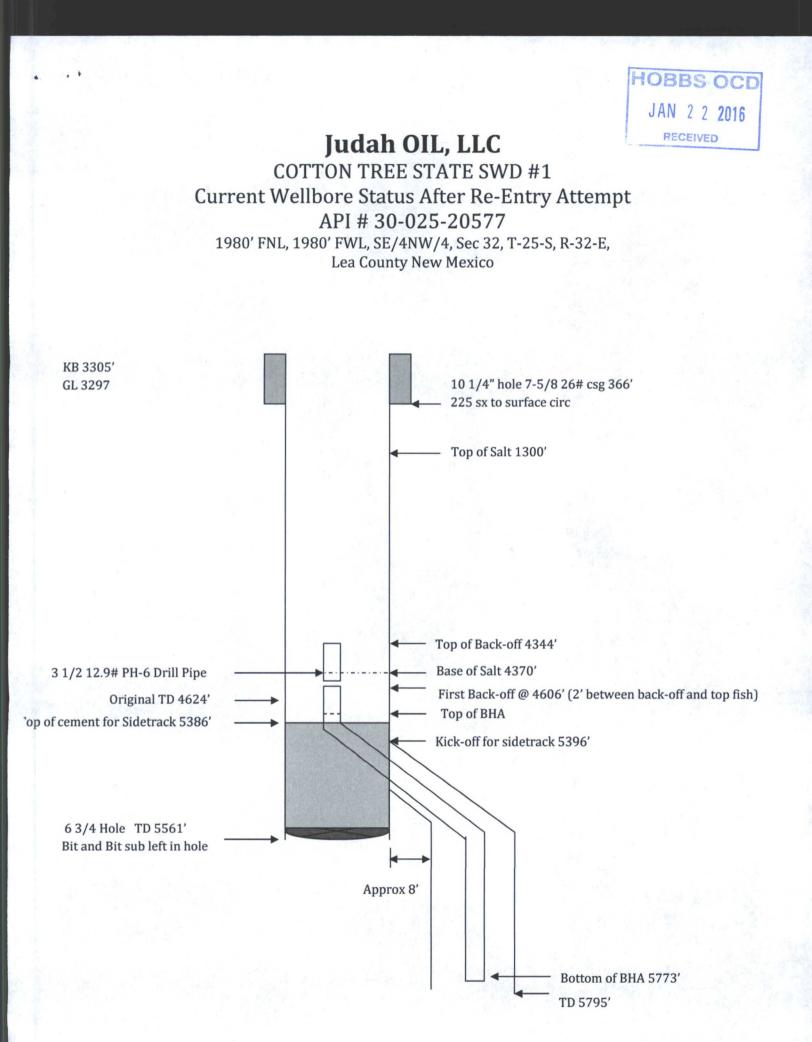

1-12-2016