

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease  
State  Fee   
5. State Oil & Gas Lease No.

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Great Western Drilling Company	8. Farm or Lease Name
3. Address of Operator	9. Well No.
4. Location of Well UNIT LETTER _____ FEET FROM THE _____ LINE AND _____ FEET FROM THE _____ LINE, SECTION _____ TOWNSHIP _____ RANGE _____ NMPM.	10. Field and Pool, or Wildcat
15. Elevation (Show whether DF, RT, GR, etc.)	12. County

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3. Pull tbq, rig up elevators, spider, slips and tongs for 5½" casing. Find freepoint and shoot casing in collar - pull & lay down casing. Rerun tbq to 50' into the 5½" csg stub cut off - spot 25 Sx plug (108' plug), 50' in 5½" csg stub and 58' in the 7 7/8" hole - pull tbq above plug - WOC - tag top of plug - if plug is satisfactory - pull & lay down tbq to 50' below the 8 5/8" OD, csg shoe.

4. With tbq opened ended 50' below the 8 5/8" csg shoe, spot 35 Sx plug (106' plug), 50' in 7 7/8" hole & 56' in the 8 5/8" csg (355' - 249'). Pull tbq above plug - WOC - tag plug - if satisfactory, set 20 sx. plug @ surface.

5. Install steel marker 4" diameter pipe set in concrete, extending 4' above GL. Stamp on marker or weld - well name and number, location, (Unit letter, Section, Township and Range) as listed below:  
 COMPANY: Great Western Drilling Company  
 LEASE: Rock Queen Unit Tr. 13  
 WELL NO: 36-10  
 LOC: 1,980' FSL, 1,980' FEL, Sec. 36, T-13-S, R-31-E, Unit Letter J, Chaves County, New Mexico

6. Clean up location for inspection.  
 Estimated Tops: T-Anhydrite 1,430', T-Salt 1,520', B-Salt 2,190', T-Yates 2,280'  
 T-7 Rivers 2,420' & T-Queen 3,066'.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

NOV 19 1982

RECEIVED  
NOV 18 1982  
FLOOR OFFICE