

Hobbs  
Copy

STATE G # 10

Copy Date 7-21-86

10/21/85  
Pulled rods and pump. Pulled 24 7/8" 255 3/4" and 100 7/8". The pump had a bad scratch on the lower extension and a groove in the no go. Removed the flange unable to unset anchor. Work at tubing for about 1 1/2 hours, called pusher. Finally got tubing to move in upward direction. Every 30± feet tubing would go in to tight spot. With 60± points could pull collar on 3 joints. Once collar was through it would take weight going the other direction. Shut down.

10/22/85  
Hot oil truck ran 60 barrels. Produced water down anulus at slow rate with 10 barrels. Cool down attempted to pull 1 more joint. Pulled 63 points. Shut down. Contact Midland. Ran 3 joints back in the hole. Flanged well. Ran rods with out pump. Ran 24 7/8", 255 3/4", 47 7/8". Hit tight spot at 8150'. Layed down 53 rods on ground. Rigged down.

11/7/85  
Rigged up. Start pulling rods and laying down in singles. Shut down.

T/Cement  
6482'

11/8/85  
Finish pulling sucker rods. Rigged up Bell run chemical cutter to 8437'. Hooked up water truck. Pumped fluid in tubing. Cut tubing. Rigged down Bell and Fannie Lee. Picked up rods in triples. Layed down in singles. Rigged to pull tubing. Layed down 271 1/2" joints on ground. Could not rig down due to wind. Shut down.

11/11/85  
Rigged down.

COPY DATE

5-28-87 T/FISH 8437', FISH CONSISTS OF 1400' 2 1/2" TUBING, TUBING ANCHOR.

Rigged up. Picked up fishing tools:

Overshot	3.30
Bumper Sub	4.35
Jars	7.38
Drill collars (4 each)	117.17
Accelerator	10.25
Changeover	01.25
265 joints tubing: 15 new on bottom, 241 used, 9 new on top	8295.10

Caught fish, jarred on fish, work up and down. Felt 4 collars come through or past tight spot. Tried to turn and would unseat overshot, finally pulled out +5 joints and pulled off fish. Could not reset overshot. Pulled out of the hole.

**RECEIVED**

MAY 24 1993

**OCD HOBBS OFFICE**

## STATE G-10

COPY DATE \_\_\_\_\_

5-28-87

Picked up extension and added to tool string. Tools as follows:

Overshot	3.30
Extension	2.80
Bumper Sub	4.35
Jars	7.38
4 Drill Collars	29.70
	29.48
	29.31
	28.68
Accelerator	10.25
Changeover	1.24
Total	146.94

Ran tools and tubing. Caught fish. Jar unable to move string. Pump produced water down hole, eventually was able to come up + 20'. Tried going down. Went down 60' Pulled back up. Unable to turn string. Continued to jar. String parted. Pulled tubing and tools. Collars flat and tubing egged. Pulled out 109.64' of fish. From markings on tubing, the top of collapsed casing at 8454.74. Top of fish will be at 8365' with a flattened collar looking up. Shut unit down.

6-1-87

Laid down tools and tubing. Rigged down.

-----