

MEXICO OIL CONSERVATION COMMISSIC

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

50. Indicate Type of Lease
 State Fee
 5. State Oil & Gas Lease No.
 B-2516

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR UNCONFINED TO BULK OR TO OPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT BY REPORT CONTROL FOR SUCH PURPOSES.)

1. OIL WELL GAS WELL OTHER - Water Injection Well
 2. Name of Operator
 Southland Royalty Company
 3. Address of Operator
 21 Desta Drive, Midland, Texas 79701
 4. Location of Well
 UNIT LETTER C 660 FEET FROM THE North LINE AND 1980 FEET FROM
 THE West LINE, SECTION 7 TOWNSHIP 17S RANGE 33E RANGE.
 15. Elevation (Show whether DF, RT, GR, etc.)
 4231' GR

7. Unit Agreement Name
 8. Form of Lease Name
 State "A"
 9. Well No.
 2
 10. Field and Pool, or Wildcat
 Malmajar (GB SA)
 12. County
 Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOG <input type="checkbox"/>	
		OTHER _____	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- MIRU PU. Ran tbg to 3980'.
- Spot 100' cmt plug from 4000-3900'. Spot cmt plug from 3500-3050'. POH w/csg.
- Shot csg @ 2000'. Work pipe free. POH w/5 1/2" csg. GIH w/tbg to 2150'. Spot 50 sx. cmt. Tag plug @ 1800'. Pull tbg to 1331'. Spot 50 sx cmt. Pull tbg to 800'.
- Tag plug @ 1180'. POH. Perf 2 sqz holes @ 350'. Pump 120 sx cmt thru perfs. Circ OK.
- Spot 10 sx cmt plug from 40' to surface. RD plugging unit. Remove wellhead. Weld plate on csg. Install dry hole marker. Clean location. Plugged & abandoned 1-8-83.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED F. W. Rad TITLE District Operations Engineer DATE 1-11-83
 APPROVED BY David Catant TITLE OIL & GAS INSPECTOR **MAY 19 1983**

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
JAN 12 1983
R.C.D.
MOBBS OFFICE