

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 87240
 District II
 811 South First, Artesia, NM 87210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV
 2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised March 25, 1999

OIL CONSERVATION DIVISION
 2040 South Pacheco
 Santa Fe, NM 87505

WELL API NO. 30-025-03048
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B-1231
7. Lease Name or Unit Agreement Name: Vacuum ABO Unit Tract 13
8. Well No. 08
9. Pool name or Wildcat Vacuum ABO Reef
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3947' GR / 3961' RKB

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
 Oil Well Gas Well Other

2. Name of Operator
Phillips Petroleum Company

3. Address of Operator
4001 Penbrook Street Odessa, TX 79762

4. Well Location
 Unit Letter **D** : **330** feet from the **North** line and **990** feet from the **West** line
 Section **4** Township **18-S** Range **35-E** NMPM County **Lea**

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

02/26/02 MIRU BASIC ENERGY SERVICES P&A PACKAGE #2282. OBJECTIVE: PLUG AND ABANDON VACUUM ABO UNIT #13-08. 330'FNL & 990'FWL, SEC 4, T-18-S, R-35-E, LEA COUNTY, NEW MEXICO. NOTIFIED NMOCD: SYLVIA DICKIE (02/25/02 15:45 P.M.) INTENT TO COMMENCE P&A OPERATIONS. DIG TESS CONFIRMATION #2002072002. ND WH, NU CLASS 1 BOPE. RIG UP AND GIH W/5-1/2" GAUGE RING TO 8540'. POOH W/WL. GIH W/5-1/2" CIBP AND SET @ 8550'. POOH W/WL. RIG UP FLOOR AND TOOLS. P/U WS AND GIH TO 5000'. SECURE WELL. SDON.

02/27/02 PU WS TO 8550'. TAG CIBP @ 8550'. MIX 50 SX SALT GEL W/200 BBL BRINE WTR. CIRC 9.5# MLF FLUID AROUND. **NOTE: ALL PLUGS CLASS "C" CEMENT, 14.8#, 1.32YD.** PUMP PLUG #1 = (40 SX, INTERVAL 8550-8145', DISPLACE W/31.5 BBL MLF). LD WS TO 6250'. PUMP PLUG #2 = (25 SX, INTERVAL 6250-5997', DISPLACE W/23 BBL MLF). LD WS TO 4500'. PUMP PLUG #3 = (80 SX, INTERVAL 4500-3691', DISPLACE W/14 BBL MLF). POOH W/WS. ND BOPE, NU TUBING HEAD. DIG OUT CELLAR. SECURE WELL & SDON.

*** CONTINUED ON BACK ***

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Stacey Kinder 915/368-1344 TITLE Supervisor, Reg./Pro. DATE 03/13/02

Type or print name for L. M. Sanders Telephone No. 915/368-1488

(This space for State use)

APPROVED BY Johnny Robinson TITLE Supervisor DATE 3/13/02

Conditions of approval, if any:

GWW

Continued:

VACUUM ABO UNIT #13-08

02/28/02 ND WH. REMOVE "B" SECTION. CUT 5-1/2" PACKOFF, WELD ON 5-1/2" PULL NIPPLE. CUT SLIPS OFF OF PIPE. NU BOPE. FREEPOINT 5-1/2" CASING – 3000'. GIH W/5-1/2" JET CUTTER. CUT CASING @3000'. POOH W/WL. RIG UP FLOOR AND TOOLS TO LAY DOWN 5-1/2" CASING. LAY DOWN 5-1/2" CASING.

03/03/02 LAYING DOWN CASING. FINISH LAYING DOWN 5-1/2 " CASING. 83 JTS AND 2 PIECES. TOTAL PIPE APPROX 3000'. CHANGE RAMS IN BOP, RIG UP FLOOR TO GIH W/TBG. GIH TO 3307'. CIRC AND PUMP PLUG #4 = (75 SX, INTERVAL 3307-2839', DISPLACE W/10.5 BBL MLF). POOH W/WS. WOC. GIH –TAG PLUG @ 2851'. LD WS TO 2000'. PUMP PLUG #5 = (30 SX, INTERVAL 2000-1889', DISPLACE W/7BBL MLF). LD WS. SECURE WELL. SDON.

03/04/02 ND BOPE, REMOVE "B" SECTION. WELD ON 8-5/8" PULL NIPPLE. FREEPOINT 8-5/8 CASING @315'. GIH W/JET CUTTER. TOOL FAILED. POOH. WORK ON WIRELINE. RIG UP TO GO BACK IN HOLE. GIH AND CUT CASING @315'. POOH W/WL. RIG UP FLOOR AND TOOLS. LAY DOWN 9 FULL JOINTS AND 1 PIECE OF 8-5/8" CASING (APPROX 315'). RIG UP TBG TOOLS AND GIH TO 370'. PUMP PLUG #6 = (55 SX, INTERVAL 370-258', DISPLACE W/4BBL MLF). POOH W/TBG. SECURE WELL. SDON.

03/05/02 GIH TO 470', NO PLUG. POOH. PUMP PLUG #7 = (55 SX, INTERVAL 375-258', DISPLACE W/3BBL MLF). POOH. WOC. GIH. TAG PLUG @ 252'. POOH. LD WS. PUMP PLUG #8 = (45 SX, INTERVAL 75'-SURFACE). RDMO. PERFORM RECLAMATION WORK. INSTALL DRY HOLE MARKER. P&A OPERATIONS COMPLETE, DROP FROM REPORT.

MATERIAL TRANSFERS:

5-1/2" CASING =	#799484
8-5/8" CASING =	#799485
WELLHEAD =	#799486