

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-30754

5. Indicate Type of Lease STATE FEE

6. State Oil / Gas Lease No. 857948

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well: OIL WELL GAS WELL OTHER

2. Name of Operator TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator 205 E. Bender, HOBBS, NM 88240

4. Well Location
Unit Letter F : 1980 Feet From The NORTH Line and 2583 Feet From The WEST Line
Section 2 Township 18S Range 34E NMPM LEA COUNTY
10. Elevation (Show whether DF, RKB, RT,GR, etc.) 4015' GR

7. Lease Name or Unit Agreement Name VACUUM GRAYBURG SAN ANDRES UT

8. Well No. 138

9. Pool Name or Wildcat VACUUM GRAYBURG SAN ANDRES

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPERATION <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: CLEAN OUT & ACIDIZE <input checked="" type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12-12-00: MIRU. BACK OFF RDS. NDWH. NUBOP.
 12-14-00: SWAB DN TBG. TIH W/TBG.
 12-15-00: TIH W/BIT, BIT SUB. TAG @ 4725'. C/O 5' FILL.
 12-18-00: TIH W/PKR TO 4206'. SET PKR @ 4206' / LOAD/PSI CSG & PKR TO 500-OK. RU SWAB LINE.
 12-19-00: ACIDIZE PERFS IN 7" CSG FR 4289-4730' W/5000 GALS 15% NEFE HCL. RU SWAB. FL @ 4100'. REL PKR.
 12-20-00: TIH W/BIT & TBG. TAG @ 4730'. PUMP SCALE SQZ 165 GALS TH756 IN 30 BBLs FW, FLSH W/350 BBLs FW W/30 GALS ALPHA-160. PUMP @ 3.5 BPM. WELL ON VAC. TOH W/TBG. STOP @ 1865'.
 12-21-00: TIH W/MUD JT, SN, TBG, TAC. MA @ 4712'. TIH W/GAS ANCHOR, K-BARS, RDS.
 12-22-00: RUN RDS & PMP. LOAD/TEST-OK. RIG DOWN.
 12-23-00: ON 24 HR OPT. PUMPED 52 BO, 103 BW, & 20 MCF.
 FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *J. Denise Leake* TITLE Engineering Assistant DATE 1/4/01

TYPE OR PRINT NAME J. Denise Leake Telephone No 397-0405

(This space for State Use)

APPROVED _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL IF ANY: _____

5
C