

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State Fee

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-	7. Unit Agreement Name
2. Name of Operator SHELL WESTERN E&P INC.	8. Farm or Lease Name TURNER
3. Address of Operator P. O. BOX 576, HOUSTON, TX 77001 (WCK 4435)	9. Well No. 4
4. Location of Well UNIT LETTER M 660 FEET FROM THE SOUTH LINE AND 330 FEET FROM THE WEST LINE, SECTION 22 TOWNSHIP 21-S RANGE 37-E NMPM.	10. Field and Pool, or Whidact DRINKARD HARE SIMPSON
15. Elevation (Show whether DF, RT, GR, etc.) 3436' DF	12. County LEA

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data.

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER SQZ DRINKARD; ACDZ HARE SIMPSON <input checked="" type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. POH w/prod equip.
2. Set RBP @ 6750'. Dmp 2 sx sd on RBP.
3. Set cmt ret @ 6380'. Sqz Drinkard perfs 6420' - 6642' w/100 sx Cls "C" cmt + .3% Halad-9 followed by 100 sx Cls "C" cmt + 2% CaCl₂. WOC 24 hrs.
4. DO cmt ret @ 6380' & cmt to sand cap on RBP.
5. Pres tst sqz to 500#.
6. Circ sand off RBP. POH w/RBP.
7. Acdz Hare Simpson perfs 7383' - 7543' w/5000 gals 15% HCl-NEA.
8. Install prod equip & return well to prod.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] A. J. FORE TITLE SUPERVISOR REG. & PERMITTING DATE 11-18-87

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE NOV 23 1987

CONDITIONS OF APPROVAL, IF ANY: