

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-79

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease -
State Fee

5. State Oil & Gas Lease No.
NM - 285

7. Unit Agreement Name

8. Farm or Lease Name
State "Y"

9. Well No.
8

10. Field and Pool, or Wildcat
Justis Fusselman

12. County
Lea

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - P" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL GAS WELL OTHER-

2. Name of Operator
ARCO Oil & Gas Company
Division of Atlantic Richfield Company

1. Address of Operator
P. O. Box 1710, Hobbs, New Mexico 88240

4. Location of Well
UNIT LETTER H 1980 FEET FROM THE North LINE AND 990 FEET FROM
THE East LINE, SECTION 25 TOWNSHIP 25S RANGE 37E NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)
3064' GR

19. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	Blinebry Zone
		OTHER <u>Co Justis Fuss zone</u>	<input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Rigged up on 6/1/80. Installed BOP. POH w/ dual comp assy.
- RIH w/ RBP, set BP @ 5600'. Spotted 3 sx sd on top.
- RIH w/ cmt retr. Set retr @ 5100'. Squeezed Bly perms 5174-5447' w/ 150 sx Halad-4 followed by 100 sx C1 "C" neat. WOC. Drld retr & cmt. Press test squeeze job to 1500# for 30 mins, OK
- Washed sd off BP, rec BP @ 5600'. CO hole to 6879' PBD.
- RIH w/ prk, set @ 6600'. Swbd Fuss zone 6720-6830' 6 hrs, rec 6 BO, 62 BLW. POH w/ prk.
- RIH w/ comp assy.
- On 24 hr test 7/30/80 pmpd Fuss perms 6720-6830' 59 BO, 32 BW & 35 MCFG. FINAL REPORT.

1b. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED W. D. McDaniel TITLE Dist. Drlg. Supt DATE 8/1/80

APPROVED BY [Signature] TITLE _____ DATE AUG 11 1980

CONDITIONS OF APPROVAL, IF ANY: