Form 3160-5


UNITED STATES

FORM APPROVED
OMB No. 1004-013
Eunicon Inl. 21 201


	PARTMENT OF THE EAU OF LAND MAN		5. Lease Serial No.	OMB No. 1004-0137 Expires: July 31, 2010
	OTICES AND REP		NMNM54113	
Do not use this t	form for proposals	to drill or to re-enter an APD) for such proposals	6. If Indian, Allottee	or Tribe Name
	T IN TRIPLICATE - Othe	r instructions on page 2.	7. If Unit of CA/Agr	reement, Name and/or No.
I. Type of Well				
Oil Well Gas W	American Co. Co. Co.		8. Well Name and N OXY SHORTCAK	o. E FEDERAL 1
2. Name of Operator DEVON ENERGY PRODUCTION C	COMPANY, LP		9. API Well No. 30-015-32234	77 (17 C 17 C 17 C 17 C 17 C 17 C 17 C 1
Address Saa Address West Sheridan Avenue, Oklahoma City, Ok	3b. Phone No. (include area cod 405-552-5014		r Exploratory Area RRY, BONE SPRING	
4. Location of Well (Footage, Sec., T., 1980' FSL 1130' FEL Sec 7 T19S R31E 32.6731186,-103.9038315	R.,M., or Survey Description)	11. Country or Paris EDDY COUNTY, N	€ 0 10 200 000 000 000 000 000 000 000 00
12. CHEC	K THE APPROPRIATE BO	DX(ES) TO INDICATE NATURE	OF NOTICE, REPORT OR OT	HER DATA
TYPE OF SUBMISSION			E OF ACTION	
Notice of Intent	Acidize Alter Casing	Deepen Fracture Treat	Production (Start/Resume) Reclamation	Water Shut-Off Well Integrity
Subsequent Report	Casing Repair Change Plans	New Construction ✓ Plug and Abandon	Recomplete Temporarily Abandon TO	Other
Final Abandonment Notice	Convert to Injection	Plug Back GF/F	Water Disposal FMFN	TC AND
1. MIRU P&A unit. POOH rods and t 2. Set CIBP @ 8710'. Tag. Circ 10#: 3. Spot 25 sx CI C from 6500'-6250'. 4. Perf @ 4650'. Sqz 35 sx CI C in/oi 5. Perf @ 3280'. Sqz 35 sx CI C in/oi 6. Perf @ 1875'. Sqz 38 sx CI C in/oi 7. Perf @ 800'. Sqz 275 sx CI C in/oi 8. Cut wellhead off 3' BGL, set dry ho	salt gel. Spot 25 sx Cl H f (T. Bone Spring @ 6392' ut from 4650'-4540'. (T. D ut from 3280'-3180'. WOO ut from 1875'-1775'. WOO ut from 800' to surface. (T bie marker.) elaware @ 4592') \$\$ \$\frac{1}{2}\$ \$\frac{1}{2}\$ & tag. (Shoe @ 3230') \$\frac{1}{2}\$ & tag. (B. Salt @ 1825') \\ \text{Per} \$\text{. Salt @ 700'; Shoe @ 668')} \text{Verify @ }	4650'-4496' w f@ 2205' spe : surface	0 c ft f 140 SX
 I hereby certify that the foregoing is tru Name (Printed/Typed) 	ue and correct.			
Armon Radfar	Title Production	Engineer		
Signature	Pefer	Date 6-	-1-21	
cepted for record – NMOCD gc 7/29/202	THIS SPACE	FOR FEDERAL OR STA	TE OFFICE USE	
Approved by Conditions of approval, if any, are attached, hat the applicant holds legal or equitable it in title the applicant to conduct openings to	Approval of this notice does le to those rights in the subjec	not warrant or certify	roleum Engineer	Date 6/26/2021

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

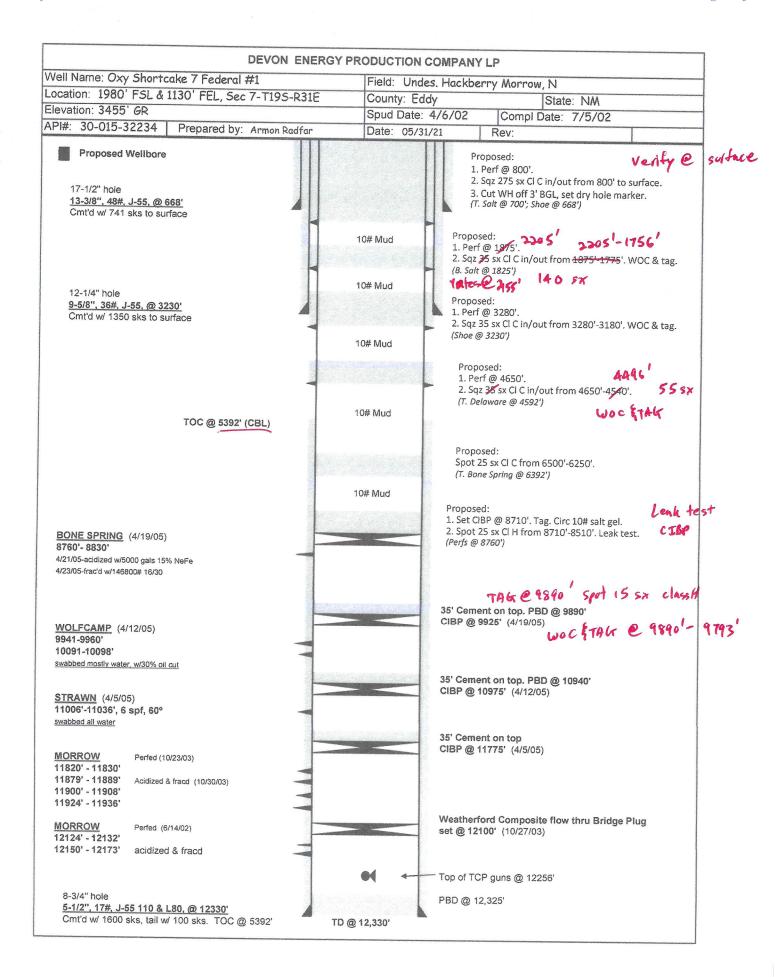

Secretary, Medium

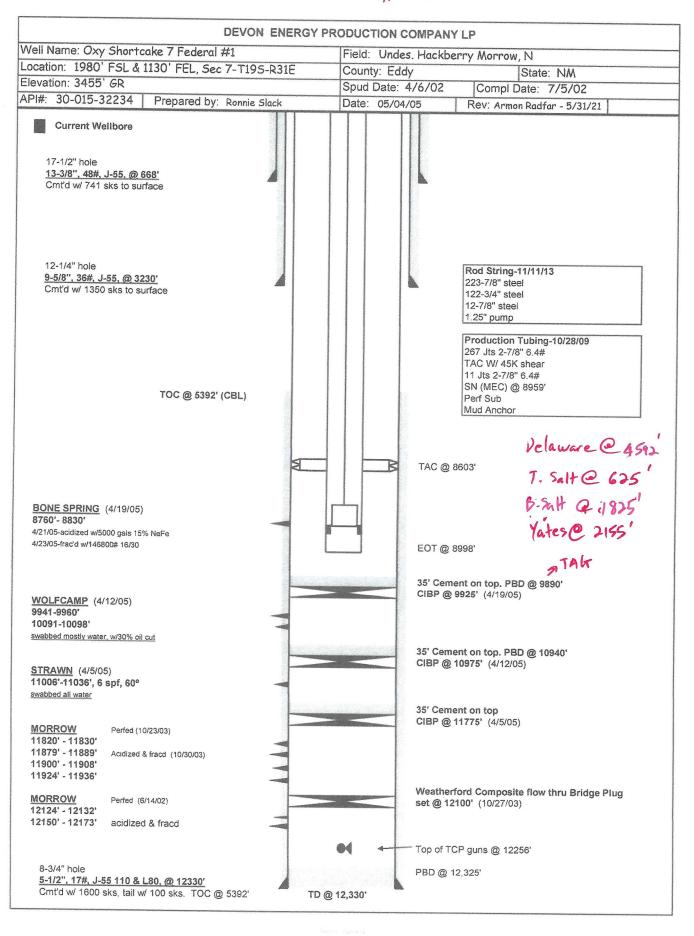

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninetv (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90^{th} day provide this office, prior to the 90^{th} day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all plugged. If the cut off shall commence within ten (10) calendar days of the well being justification to receive an extension for completing the cut off.

 The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and following information shall be permanently inscribed on the dry hole marker: well name and section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of casing left in the well. <u>Show date well was plugged</u>.
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Received by OCD: 7/27/2021 3:11:14 PM



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3). Surface Use Plan of
 Operations must include adequate measures for stabilization and reclamation of disturbed lands.
 Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
 process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well completion, and final reclamation
- The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation. equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Melissa Horn Environmental Protection Specialist 575-234-5951

Kelsey Wade Environmental Protection Specialist 575-234-2220

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 38435

CONDITIONS

Operator:	OGRID:
DEVON ENERGY PRODUCTION COMPANY, LP	6137
333 West Sheridan Ave.	Action Number:
Oklahoma City, OK 73102	38435
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	7/29/2021