

Submit a Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised August 1, 2011

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-07610
5. Indicate Type of Lease STATE [X] FEE [ ]
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name South Hobbs (G/SA) Unit
8. Well Number: 32
9. OGRID Number: 157984
10. Pool name or Wildcat Hobbs (G/SA)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)
1. Type of Well: Oil Well [ ] Gas Well [ ] Other: Injector
2. Name of Operator Occidental Permian Ltd.
3. Address of Operator HCR 1 Box 90 Denver City, TX 79323
4. Well Location
Unit Letter F 1980 feet from the North line and 1980 feet from the West line
Section 4 Township 19S Range 38E NMPM Lea County
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3614' (KB)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK [ ] PLUG AND ABANDON [X]
TEMPORARILY ABANDON [ ] CHANGE PLANS [ ]
PULL OR ALTER CASING [ ] MULTIPLE COMPL [ ]
DOWNHOLE COMMINGLE [ ]

SUBSEQUENT REPORT OF:

- REMEDIAL WORK [ ] ALTERING CASING [ ]
COMMENCE DRILLING OPNS. [ ] P AND A [ ]
CASING/CEMENT JOB [ ]

OTHER: [ ]

OTHER: [ ]

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 1. MIRU PU,
2. RIH with open ended tbg, Tag capped CIBP @ 3938'.
3. Circulate 12# Plugged mud,
4. Pressure test casing to 500 psi
5. Perf and sqz 100 sx of cmt at 2820'. SPOT 100' CMT AND TAG @2720'
WOC and Tag (Yates / Intermediate Csg Shoe plug)
6. Spot 50 sx of cmt from 1600' (Rustler plug)
7. Perf and sqz 200 sx of cmt at 300' (50' below Surface csg shoe) and circulate to surface. Top-off as necessary (Csg Shoe plug / Surface plug)
8. Cut off wellhead and install dry hole marker (verify cement to surface all string) with labeling
9. Clean up location, remove anchors

During this procedure we plan to use the closed-loop system with a steel tank and haul contents to the required disposal per ODC Rule 19.15.17

4" diameter 4' tall Above Ground Marker

SEE ATTACHED CONDITIONS OF APPROVAL

Spud Date: [ ]

Rig Release Date: [ ]

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Faris

TITLE Production Engineer DATE 8/11/2021

Type or print name Faris Al Ismaili E-mail address faris\_al\_ismaili@oxy.com PHONE: 832-973-0186

For State Use Only

APPROVED BY: [Signature] Compliance Officer A 9/17/21




# SHOU-32F04

API# 30-025-07610

TWN 19-S; RNG 38-E

Water Injection Well

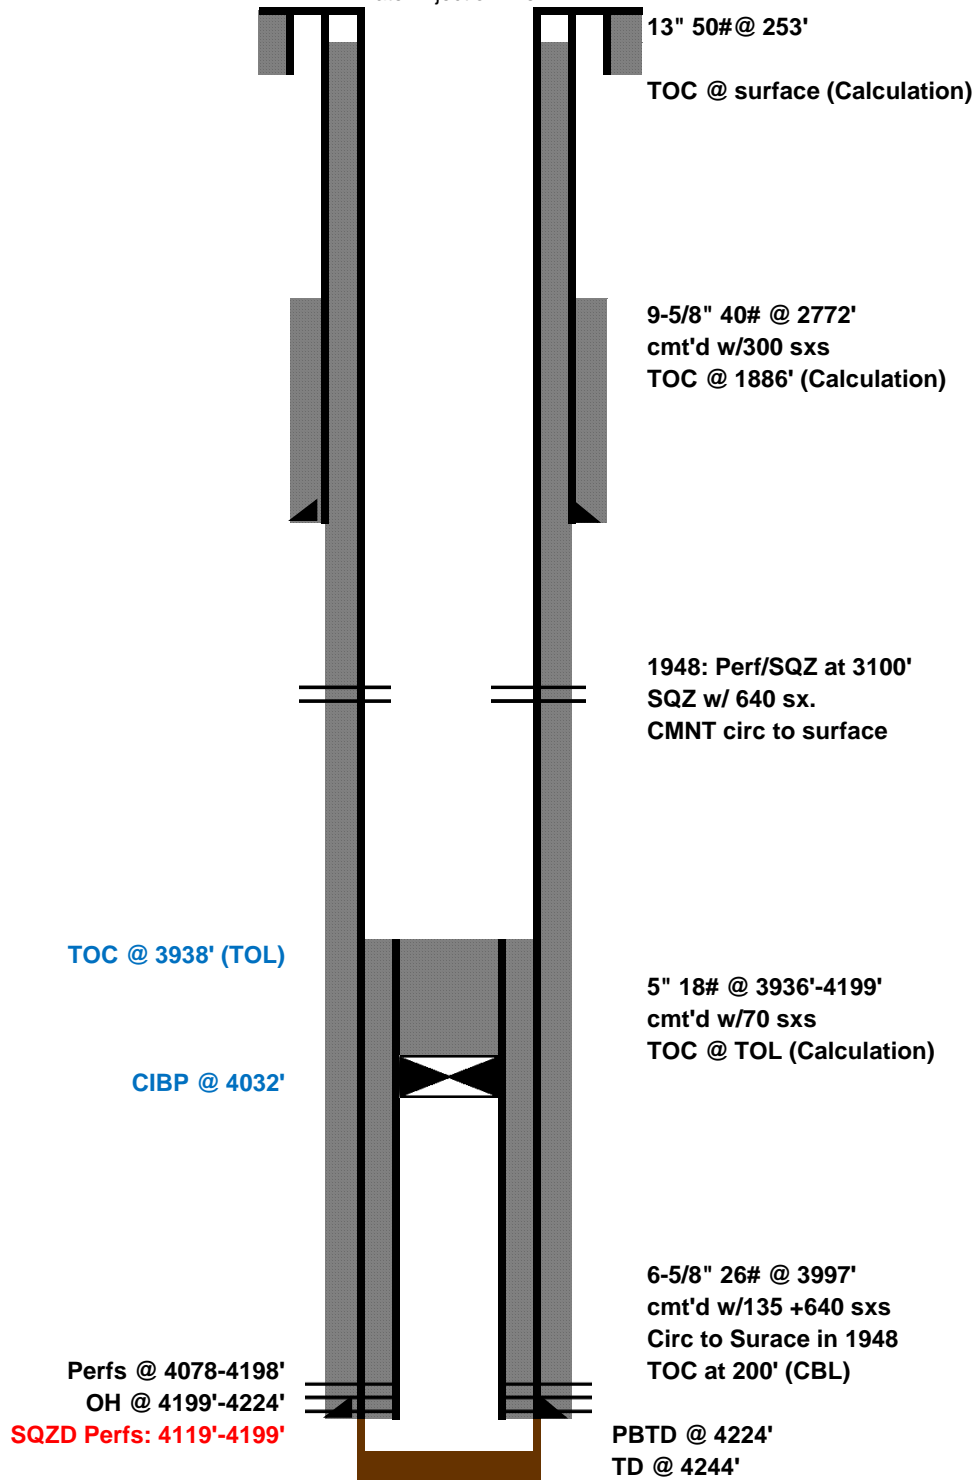




# SHOU-32F04

API# 30-025-07610

TWN 19-S; RNG 38-E

Water Injection Well

 
Surface/Csg Shoe Plug @ 300'  
Perf and Sqz ~ 200 sx



13" 50# @ 253'

TOC @ surface (Calculation)

Rustle Plug @ 1600'  
Spot 100' cmt, tag @ 1500' or higher

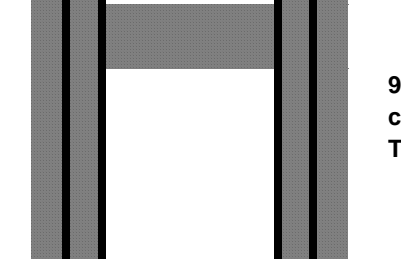

9-5/8" 40# @ 2772'

cmt'd w/300 sxs

TOC @ 1886' (Calculation)

Yates Plug @ 2820'  
Spot 100' cmt, Tag @ 2720' or higher  
Perf and Sqz @2820




1948: Perf/SQZ at 3100'

SQZ w/ 640 sx.

CMNT circ to surface

TOC @ 3938' (TOL)

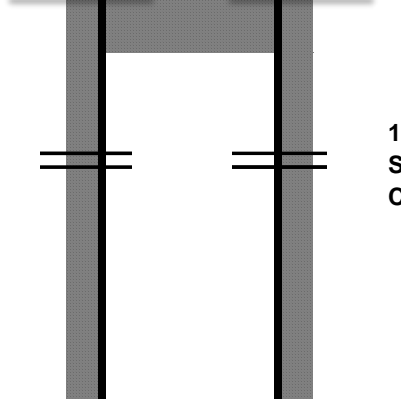

5" 18# @ 3936'-4199'

cmt'd w/70 sxs

TOC @ TOL (Calculation)

CIBP @ 4032'

6-5/8" 26# @ 3997'

cmt'd w/135 +640 sxs


Circ to Surace in 1948

TOC at 200' (CBL)

Perfs @ 4078-4198'

OH @ 4199'-4224'

SQZD Perfs: 4119'-4199'

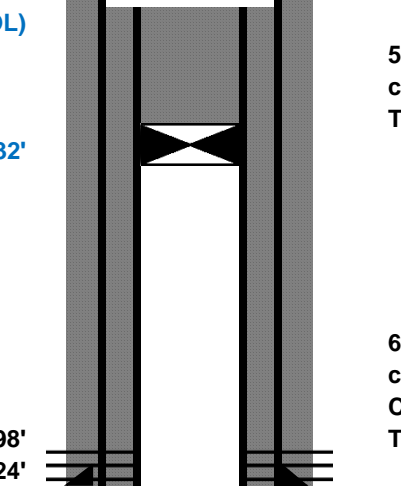

PBTD @ 4224'

TD @ 4244'

**CONDITIONS OF APPROVAL  
FOR PLUGGING AND ABANDONMENT  
OCD - Southern District**

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at **(575)-263-6633** at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

**Company representative will be on location during plugging procedures.**

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
3. Trucking companies being used to haul oilfield waste fluids to a disposal - commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
8. Produced water will not be used during any part of the plugging operation.
9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
11. Class 'C' cement will be used above 7500 feet.
12. Class 'H' cement will be used below 7500 feet.
13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
  - A) Fusselman
  - B) Devonian
  - C) Morrow
  - D) Wolfcamp
  - E) Bone Springs
  - F) Delaware
  - G) Any salt sections
  - H) Abo
  - I) Glorieta
  - J) Yates.

**K) Potash---(In the R-111-P Area (Potash Mine Area),**  
 A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

**DRY HOLE MARKER REQ.UIRMENTS**

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

**SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS**

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

**SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION**




# SHOU-32F04

API# 30-025-07610

TWN 19-S; RNG 38-E

Water Injection Well

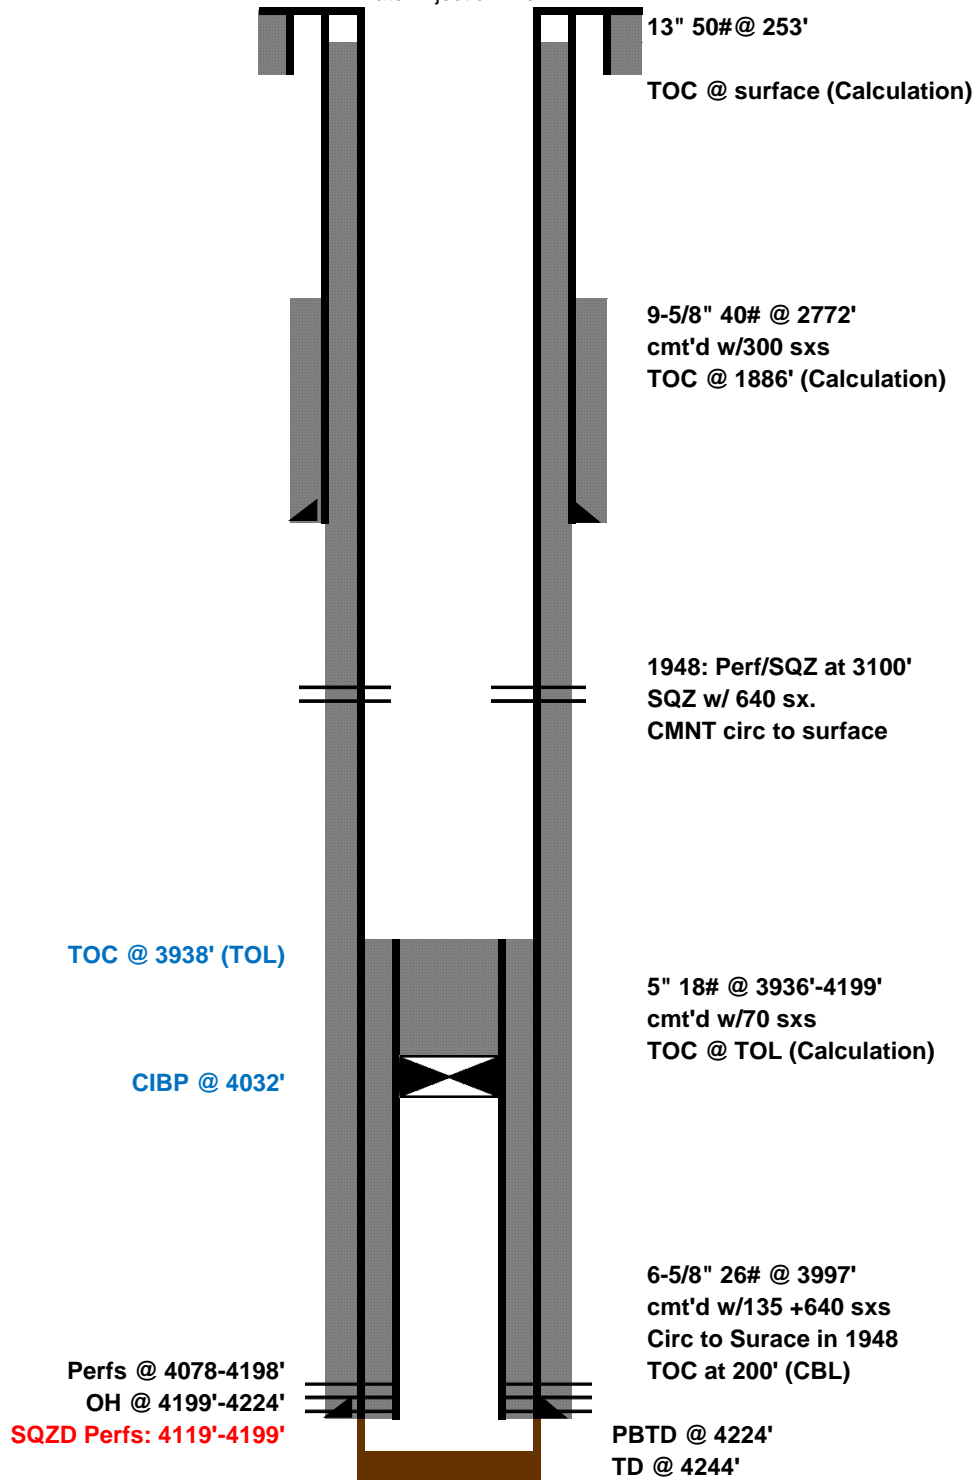











# SHOU-32F04

API# 30-025-07610

TWN 19-S; RNG 38-E  
Water Injection Well

Surface/Csg Shoe Plug @ 300'  
Perf and Sqz ~ 200 sx


Rustle Plug @ 1600'  
Spot 100' cmt, tag @ 1500' or higher

Yates Plug @ 2820'  
Spot 100' cmt, Tag @ 2720' or higher  
Perf and Sqz @2820

TOC @ 3938' (TOL)

CIBP @ 4032'

Perfs @ 4078-4198'  
OH @ 4199'-4224'  
SQZD Perfs: 4119'-4199'

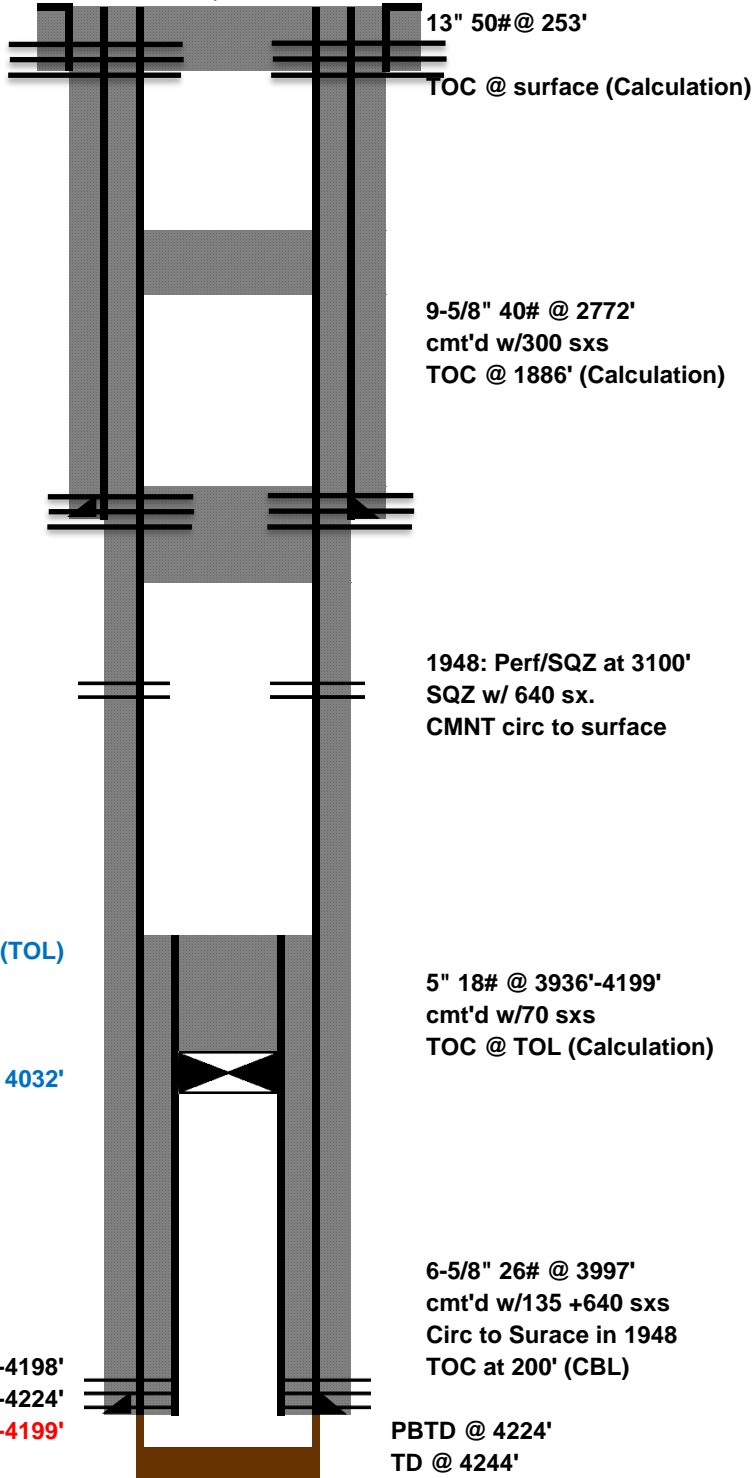

13" 50# @ 253'

TOC @ surface (Calculation)

9-5/8" 40# @ 2772'  
cmt'd w/300 sxs  
TOC @ 1886' (Calculation)

1948: Perf/SQZ at 3100'  
SQZ w/ 640 sx.  
CMNT circ to surface

5" 18# @ 3936'-4199'  
cmt'd w/70 sxs  
TOC @ TOL (Calculation)

6-5/8" 26# @ 3997'  
cmt'd w/135 +640 sxs  
Circ to Surace in 1948  
TOC at 200' (CBL)

PBTD @ 4224'  
TD @ 4244'







**District I**  
 1625 N. French Dr., Hobbs, NM 88240  
 Phone:(575) 393-6161 Fax:(575) 393-0720

**District II**  
 811 S. First St., Artesia, NM 88210  
 Phone:(575) 748-1283 Fax:(575) 748-9720

**District III**  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 Phone:(505) 334-6178 Fax:(505) 334-6170

**District IV**  
 1220 S. St Francis Dr., Santa Fe, NM 87505  
 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

CONDITIONS

Action 41773

**CONDITIONS**

Operator: OCCIDENTAL PERMIAN LTD P.O. Box 4294 Houston, TX 772104294	OGRID: 157984
	Action Number: 41773
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

**CONDITIONS**

Created By	Condition	Condition Date
kfortner	See attached conditions of approval	9/17/2021