Ceined by Copy Po Roportine Disting	Stat		Form C-103 of			
<u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Natural Resources OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505			Revised July 18, 2013 WELL API NO.		
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210				30-025-26192		
<u>District III</u> - (505) 334-6178				5. Indicate Type of Lo STATE X	FEE	
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460				6. State Oil & Gas Le		
1220 S. St. Francis Dr., Santa Fe, NM				L-2949	450 110.	
87505 SUNDRY NO	7. Lease Name or Un	it Agreement Name				
(DO NOT USE THIS FORM FOR PROP DIFFERENT RESERVOIR. USE "APPL	PIPELINE 16 ST	e				
PROPOSALS.) 1. Type of Well: Oil Well X	8. Well Number 00	1				
2. Name of Operator MATADC	9. OGRID Number 228937					
3. Address of Operator 5400 LBJ F	REEWAY, STE 1500	DALLAS, TX	75240	10. Pool name or Wil QUAIL RIDGE	dcat ; BONE SPRING	
4. Well Location			1.0			
Unit Letter <u>G</u>		n the <u>NORTH</u>				
Section 16	Townshi	1	nge 34E		ounty LEA	
	11. Elevation (She	ow whether DR, 3791' GI	<i>RKB, RT, GR, etc.</i> R	)		
	] ] npleted operations. (C work). SEE RULE 19	Clearly state all p .15.7.14 NMAC ine 16 State #1, per the re nencing operations. U BOPs & TOOH w/ rod //bg. Cl H cmt. WOC and tag. 25 sx cmt. WOC and tag. 50 sx	2. For Multiple Co quired COA, following the proc s. 25 sx	d give pertinent dates, in mpletions: Attach wellb	ore diagram of arker send pics before	
• • *Current and p	Spot 250° of Cl C cmt (2017, 1747° (TO) Perf (2017, 1747°) (TO) Perf (2017, 1747°) (TO) Cut off wellhead and ensure cmt to su install above ground marker per NMG oposed wellbore diagrams attached uid (MLF) mixed at 25sx/100 bbls w	C). WOC and tag. face. urface on all csg strings. OCD specifications.	en each plug.	Note changes to proce	dure	
Spud Date: 01/27/1979		Rig Release Da	te:			
-		-		]		
I hereby certify that the information	n above is true and co	mplete to the be	est of my knowledg	e and belief.		
signature	4-5	TITLE Regulate	ory Analyst	DATE_	9/24/21	
Type or print name <u>Brett Jennings</u>	$\mathcal{O}$	E-mail address	Brett.Jennings@matadorr	PHON	E:	
•	Fortner	TITLE Compli	ance Officer A	DATE_	10/7/21	

•

# Released to Imaging: 10/7/2021 2:57:22 PM


Matador is requesting to plug and abandon the Pipeline 16 State #1, per the required COA, following the procedure below:


- Notify NMOCD 24 hrs prior to commencing operations.
- Safety mtg, MIRU, check pressure, NU BOPs & TOOH w/ rods.
- ND wellhead, NU BOPs & TOOH w/ tbg.
- Set CIBP @ 9,450' and spot 100' of CI H cmt. WOC and tag. 25 sx
- Circ and displace hole w/ MLF.
- Spot 100 of CI H cmt @ 9,200' (TOC). WOC and tag. 25 sx
- Perf @ 8,063' and Sqz 108' of Cl H cmt. WOC and tag. 50 sx
- Perf @ 5,237' and Sqz 100' of CI C cmt. WOC and tag. 50 sx
- Spot 100 of CI C cmt @ 3,413' (TOC). WOC and tag. 25 sx
- Spot 1% of CI C cmt @ 3,130' (TOC). WOC and tag. 25 sx
- Spot 250' of Cl C cmt @ 1,747' (TOC). WOC and tag.
- Perf @ 550' and Sqz Cl C cmt to surface.
- Cut off wellhead and ensure cmt to surface on all csg strings.
- Install above ground marker per NMOCD specifications.
- \*Current and proposed wellbore diagrams attached

\*\*Mud laden fluid (MLF) mixed at 25sx/100 bbls water will be spotted between each plug.

## MATADOR PRODUCTION COMPANY Pipeline 16 State #1 1980' FNL & 1980' FEL Sec 16 - 19S - 34E Lea County, NM API: 30-025-26192



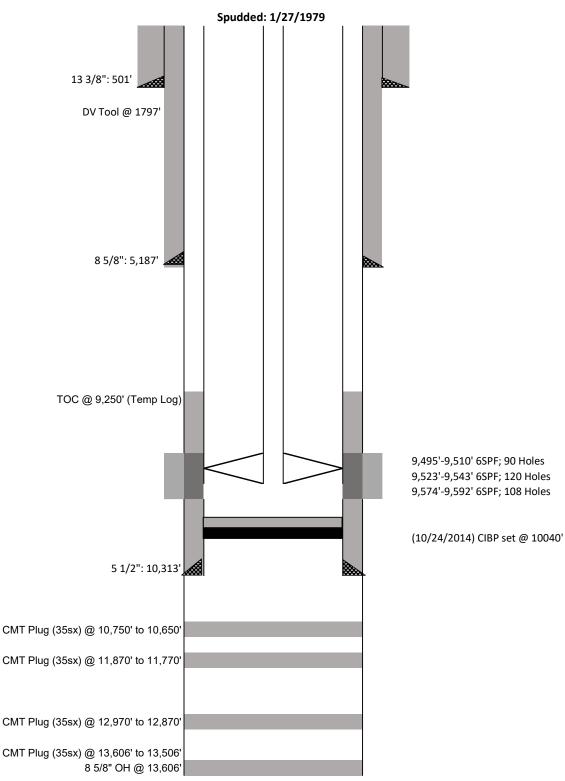

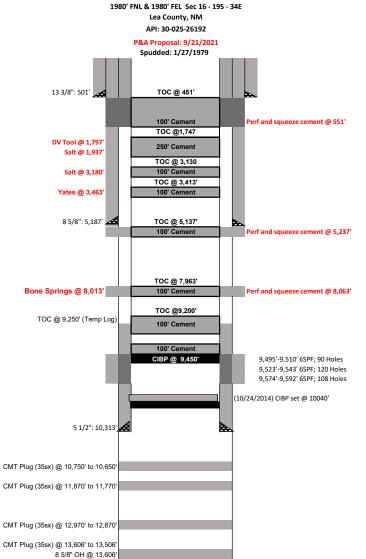

MATADOR PRODUCTION COMPANY Pipeline 16 State #1

		Casing Information						
		Casing Size	Weight lb/ft	Depth Set	Hole Size	Cementing Record	Type	Joints
	Surface	13 3/8	48	501	17 1/2	500 sxs of CI C (Circulated)	H-40	11
Intermediate					First Stage: 600sx of Lite Wate Cmt + 200sx			
	8 5/8	32	5,187	12 1/4	Neat Cmt; Second Stage: 950 sx Lite Wate Cmt	S-80	117	
				-		+ 50 sx Class "C" neat Cmt (Circulated)		
	Production	`5 1/2	17	10,313	7 7/8	500 sx Class H 50/50 Pozmix	N-80 + S-95	249

# CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

# Company representative will be on location during plugging procedures.

**1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.

**2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.

**3.** Trucking companies being used to haul oilfield waste fluids to a disposal - commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.

4. Filing a subsequent C-103 will serve as notification that the well has been plugged.

**5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.

**6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.

7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.

8. Produced water will not be used during any part of the plugging operation.

9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.

**10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.

11. Class 'C' cement will be used above 7500 feet.

12. Class 'H' cement will be used below 7500 feet.

**13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged

**14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

**16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set

17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.

**18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.

20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops

- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.

#### K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

**21.** If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

# DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

## SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

# SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION


Matador is requesting to plug and abandon the Pipeline 16 State #1, per the required COA, following the procedure below:

- Notify NMOCD 24 hrs prior to commencing operations.
- Safety mtg, MIRU, check pressure, NU BOPs & TOOH w/ rods.
- ND wellhead, NU BOPs & TOOH w/ tbg.
- Set CIBP @ 9,450' and spot 100' of CI H cmt. WOC and tag.
- Circ and displace hole w/ MLF.
- Spot 100' of Cl H cmt @ 9,200' (TOC). WOC and tag.
- Perf @ 8,063' and Sqz 100' of Cl H cmt. WOC and tag.
- Perf @ 5,237' and Sqz 100' of Cl C cmt. WOC and tag.
- Spot 100' of Cl C cmt @ 3,413' (TOC). WOC and tag.
- Spot 100' of Cl C cmt @ 3,130' (TOC). WOC and tag.
- Spot 250' of Cl C cmt @ 1,747' (TOC). WOC and tag.
- Perf @ 550' and Sqz Cl C cmt to surface.
- Cut off wellhead and ensure cmt to surface on all csg strings.
- Install above ground marker per NMOCD specifications.
- \*Current and proposed wellbore diagrams attached


\*\*Mud laden fluid (MLF) mixed at 25sx/100 bbls water will be spotted between each plug.

## MATADOR PRODUCTION COMPANY Pipeline 16 State #1 1980' FNL & 1980' FEL Sec 16 - 19S - 34E Lea County, NM API: 30-025-26192



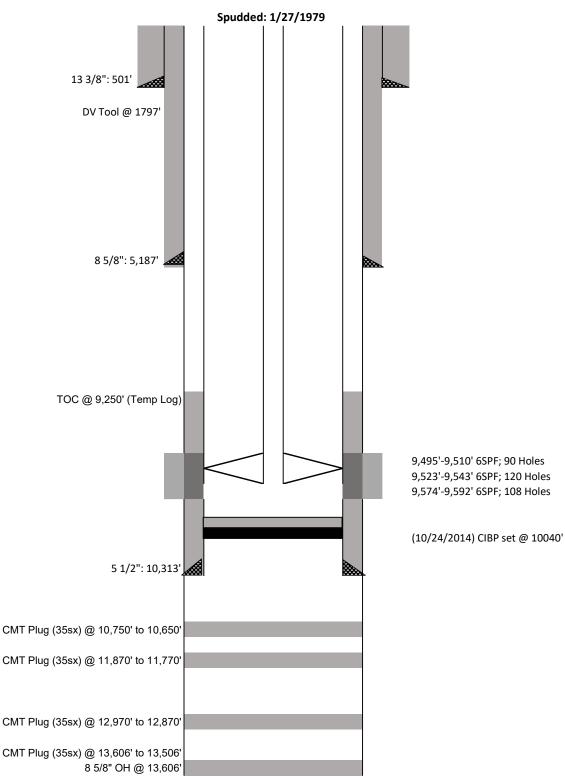

MATADOR PRODUCTION COMPANY Pipeline 16 State #1

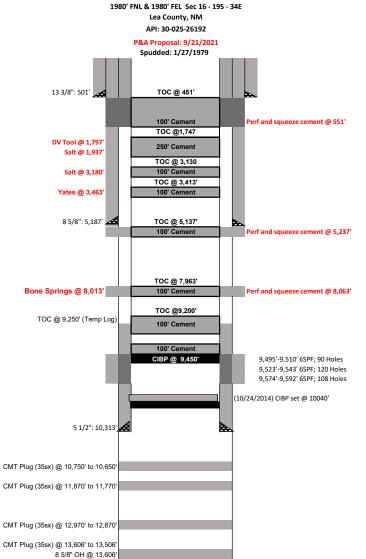

	Casing Information						
	Casing Size	Weight lb/ft	Depth Set	Hole Size	Cementing Record	Type	Joints
Surface	13 3/8	48	501	17 1/2	500 sxs of CI C (Circulated)	H-40	11
					First Stage: 600sx of Lite Wate Cmt + 200sx		
Intermediate	8 5/8	32	5,187	12 1/4	Neat Cmt; Second Stage: 950 sx Lite Wate Cmt	S-80	117
					+ 50 sx Class "C" neat Cmt (Circulated)		
Production	`5 1/2	17	10,313	7 7/8	500 sx Class H 50/50 Pozmix	N-80 + S-95	249

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. Santa Fe, NM 87505

Page 10 of 10

CONDITIONS

Action 51783

CONDITIONS

Operator:	OGRID:
MATADOR PRODUCTION COMPANY	228937
One Lincoln Centre	Action Number:
Dallas, TX 75240	51783
	Action Type:
1	[C-103] NOLPlug & Abandon (C-103E)

CONDITIONS			
Created By	Condition	Condition Date	
kfortner	See attached conditions of approval Note changes to procedure	10/7/2021	