

Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.
30-039-07517
5. Indicate Type of Lease
STATE [ ] FEE [X]
6. State Oil & Gas Lease No.
FEE
7. Lease Name or Unit Agreement Name
San Juan 29-6 Unit
8. Well Number
70
9. OGRID Number
372171
10. Pool name or Wildcat
Blanco Mesaverde
11. Elevation (Show whether DR, RKB, RT, GR, etc.)
6336' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)
1. Type of Well: Oil Well [ ] Gas Well [X] Other
2. Name of Operator
HILCORP ENERGY COMPANY
3. Address of Operator
382 Road 3100, Aztec, NM 87410
4. Well Location
Unit Letter N : 1150' feet from the South line and 1500' feet from the West line
Section 29 Township 29N Range 6W NMPM County Rio Arriba

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:
PERFORM REMEDIAL WORK [ ] PLUG AND ABANDON [ ]
TEMPORARILY ABANDON [X] CHANGE PLANS [ ]
PULL OR ALTER CASING [ ] MULTIPLE COMPL [ ]
DOWNHOLE COMMINGLE [ ]
CLOSED-LOOP SYSTEM [ ]
OTHER: [ ]
SUBSEQUENT REPORT OF:
REMEDIAL WORK [ ] ALTERING CASING [ ]
COMMENCE DRILLING OPNS. [ ] P AND A [ ]
CASING/CEMENT JOB [ ]
OTHER: [ ]

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Hilcorp Energy Company requests permission to Temporary Abandon the subject well for future uphole potential per the attached procedure and current/proposed wellbore schematic. A closed-loop system will be used.

Spud Date: [ ]

Rig Release Date: [ ]

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Operations/Regulatory Technician - Sr. DATE 2/7/2022

Type or print name Amanda Walker E-mail address: mwalker@hilcorp.com PHONE: (346) 237-2177
For State Use Only

APPROVED BY: [Signature] TITLE Deputy Oil and Gas Inspector DATE 3/14/2022
Conditions of Approval (if any):



## TA Procedure

General Information			
<b>Well Name</b>	San Juan 29-6 #70	<b>Date:</b>	3/7/2022
<b>API:</b>	30-039-07517	<b>AFE #</b>	
<b>Field:</b>	San Juan	<b>County</b>	San Juan
<b>Status:</b>	Well is ACOI		
<b>Subject:</b>	Temporarily Abandon Wellbore		
<b>By:</b>	M. Wissing		

### Well Data

Surface Casing: 9-5/8" 32.3# H-40 at 294'  
 Intermediate Casing: 7" 20# J-55 at 3,420'  
 Production Casing: 4-1/2" J-55 10.5# at 5,560'  
 Production Tubing: 2-3/8" J-55 4.6# at 5,486'  
 Current Perforations: 3,905'-5,508'  
 Current PBTD: 5,540' (Cement plug)  
 SICP = 0 psig; SIBH: 0 psi

**Notes:** Latest remedial rig work in 3/2015. Each remedial rig job fished tubing due to corrosion & scale issues.


Hold PJSM prior to begin all operations. Properly document all operations via the JSA process. Ensure that all personnel onsite abide by HEC safety protocol, including PPE, housekeeping, and standard guidelines. Verify cathodic protection is off and wellhead instrumentation is properly disconnected from the wellhead. Comply with all NMOCD and HEC safety and environmental regulations. Verify there is no H2S present prior to beginning operations. If any H2S is present, take the necessary actions to ensure that the location is safe prior to beginning operations. Observe and record pressures across all strings daily, prior to beginning operations.

Remember to notify NMOCD 24 hours prior to starting operations on location. This procedure is contingent upon P&A sundry approval by NMOCD.


## TA Procedure

1. MIRU workover rig and related equipment. Record pressures on all strings of the wellbore.
2. ND whd and NU BOP. Test BOP. Release tbg hgr and tag for fill. TOOH with the production tubing.
3. MU 4.5" casing scraper and RIH. Reach +/- 3,870' and POOH.
4. MU 4.5." CIBP and RIH. Set CIBP at 3,855'.
  - a. **Top Lewis perf at 3,905'**
5. Load wellbore with inhibited packer fluid and circulate wellbore clean. TOOH with tbg.
6. **Contact NMOCD 24 hrs prior to pressure test.** Test casing to 560 psi for 30 min on a chart recorder (2 hr chart). Contact engineer if pressure test fails.
7. ND BOP and NU whd. RDMO workover rig & equipment.

# CURRENT WELLBORE SCHEMATIC

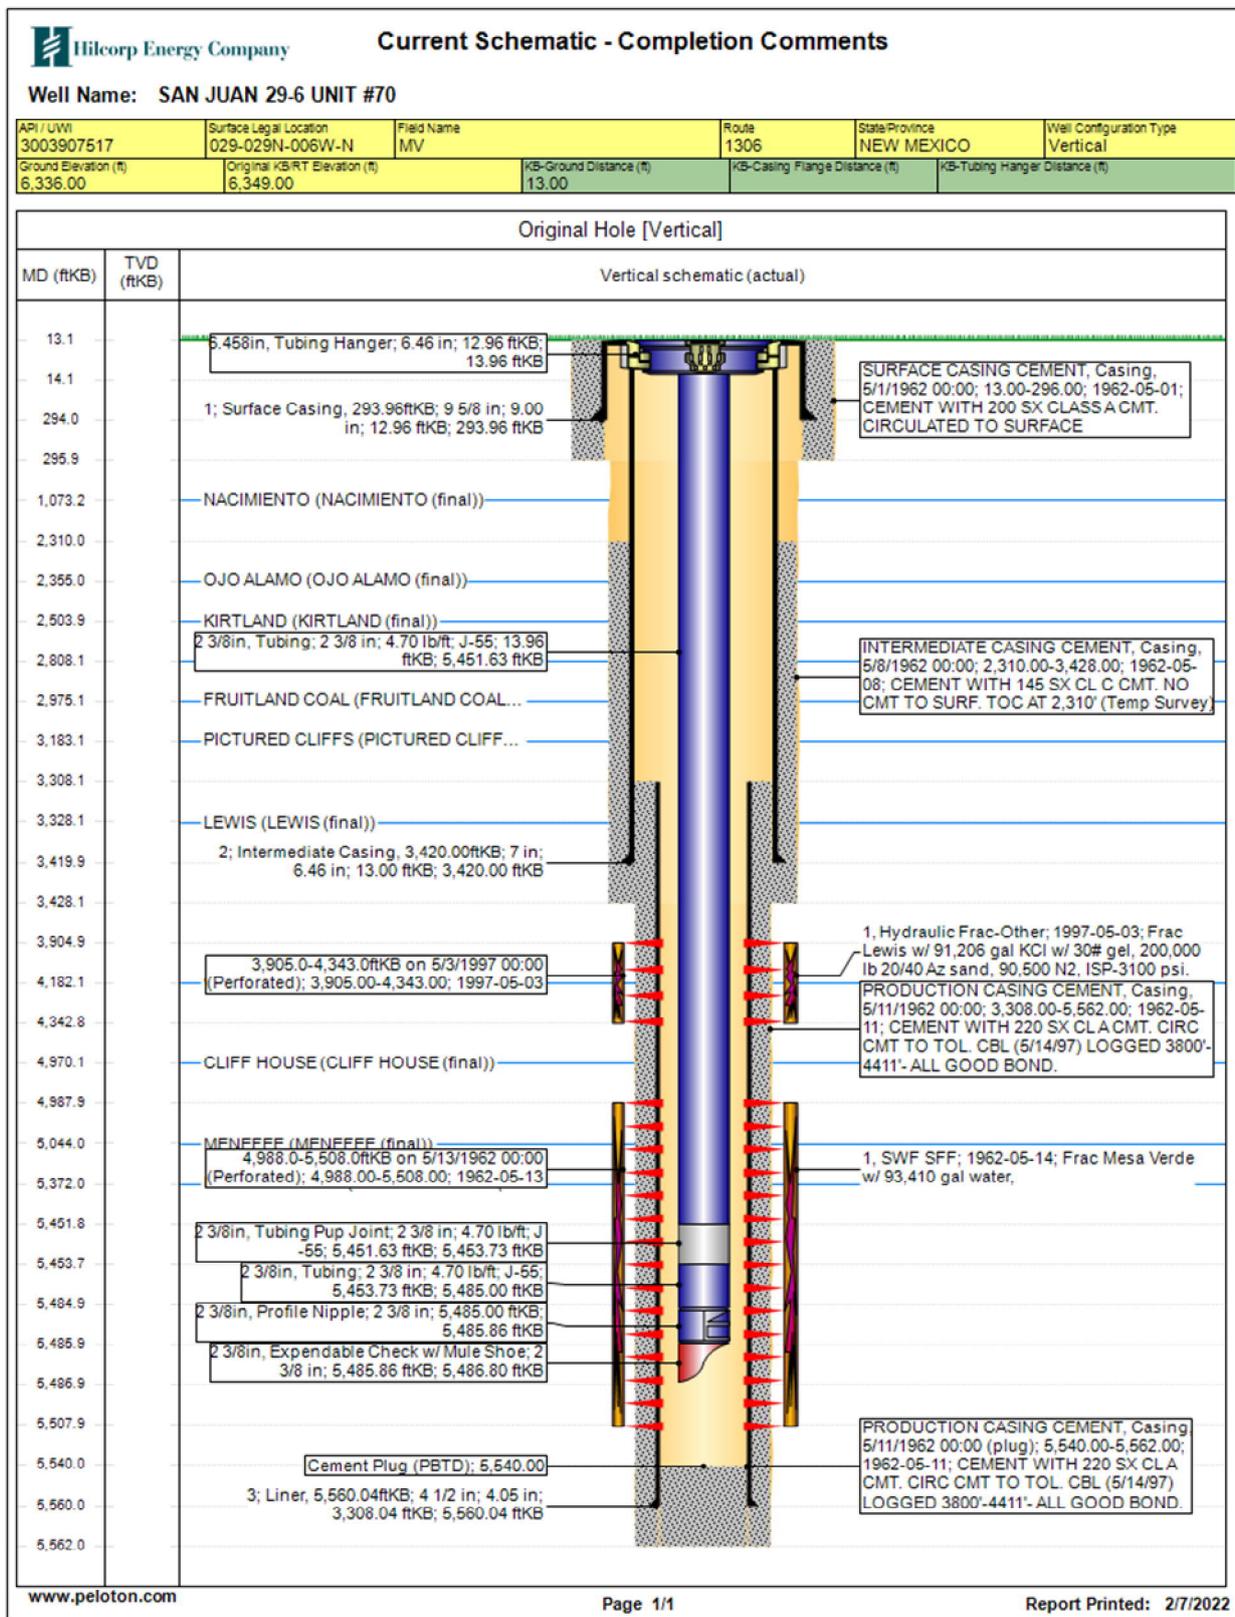

## PROPOSED WELLBORE SCHEMATIC

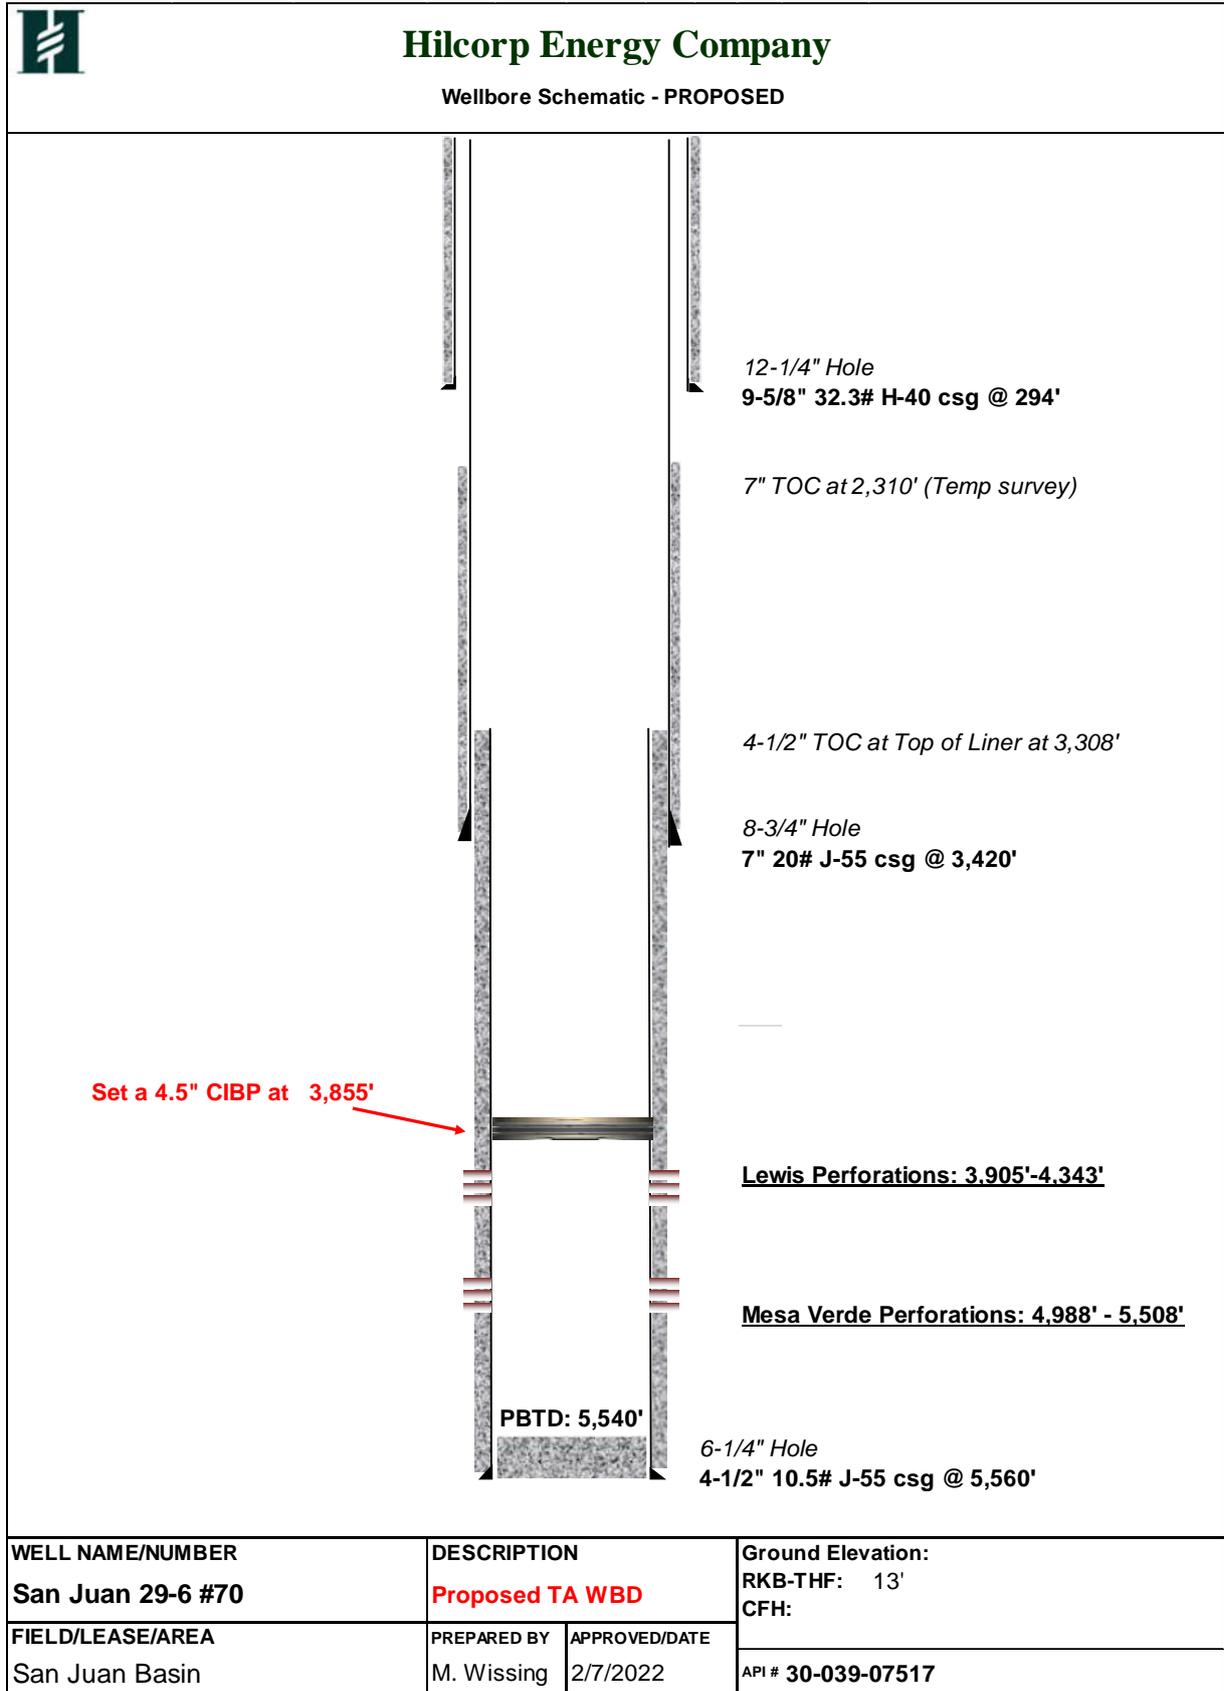

**District I**  
 1625 N. French Dr., Hobbs, NM 88240  
 Phone:(575) 393-6161 Fax:(575) 393-0720

**District II**  
 811 S. First St., Artesia, NM 88210  
 Phone:(575) 748-1283 Fax:(575) 748-9720

**District III**  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 Phone:(505) 334-6178 Fax:(505) 334-6170

**District IV**  
 1220 S. St Francis Dr., Santa Fe, NM 87505  
 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

CONDITIONS  
 Action 79114

**CONDITIONS**

Operator: HILCORP ENERGY COMPANY 1111 Travis Street Houston, TX 77002	OGRID: 372171
	Action Number: 79114
	Action Type: [C-103] NOI Temporary Abandonment (C-103I)

**CONDITIONS**

Created By	Condition	Condition Date
mkuehling	Notify NMOCD 24 hours prior to moving on - Notify NMOCD 24 hours prior to MIT - Bradenhead test required prior to MIT - all testing required to be witnessed by NMOCD inspector - due to shortage of personnel tests may need to be witnessed through facetime	3/14/2022