Received by OCP: Appropriate 23:10:11	1:24 AM State of New N	Mexico	Form C-1831			
Office <u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Natural Resources		Revised July 18, 2013 WELL API NO.			
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION		30-025-08601			
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.		5. Indicate Type of Lease STATE ✓ FEE			
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Santa Fe, NM 87505		6. State Oil & Gas Lease No.			
87505	ΓICES AND REPORTS ON WELL	1.5	7. Lease Name or Unit Agreement Name			
(DO NOT USE THIS FORM FOR PROP	JSE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A IT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		JALMAT FIELD YATES SAND UNIT			
PROPOSALS.)	_		8. Well Number 116			
2. Name of Operator	Gas Well Other		9. OGRID Number 370080			
Breitburn Operating LP 3. Address of Operator			10. Pool name or Wildcat			
1111 Bagby Street Ste 1600	Houston, TX 77002		[33820] JALMAT; TAN-YATES-7 RVRS			
4. Well Location	: 1650feet from the _south	line and 330) cos a west			
Unit Letter L Section 12	icct from the	Range	feet from the west line NMPM County Lea			
12	11. Elevation (Show whether L		,			
12. Check	Appropriate Box to Indicate	Nature of Notice,	Report or Other Data			
NOTICE OF I	NTENTION TO:	SUB	SEQUENT REPORT OF:			
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WOR	K ☐ ALTERING CASING ☐			
TEMPORARILY ABANDON PULL OR ALTER CASING] CHANGE PLANS □] MULTIPLE COMPL □	COMMENCE DRI				
DOWNHOLE COMMINGLE	-	CASING/CEMENT	100			
CLOSED-LOOP SYSTEM	j					
OTHER: 13 Describe proposed or com	unleted operations (Clearly state a	OTHER:	d give pertinent dates, including estimated date.			
of starting any proposed v	13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of					
proposed completion or re	-					
Surface - Surface Casing	Shoe Plug: Mix, Spot & SQZ	Z cmt plug f/ 330'- S	Surface in 5-1/2" csg & 5-1/2" x			
Surface - Surface Casing Shoe Plug: Mix, Spot & SQZ cmt plug f/ 330'- Surface in 5-1/2" csg & 5-1/2" x 8-5/8" annulus w/ (19.5 bbls / 109 cuft / 82.5 sx) 1.32 yield Class "C" Cmt. WOC 4 hrs. Tag & Record 330'- Perf 5-1/2" Csg 50' below 8-5/8" Csg Shoe @ 330'. Attempt SQZ plug. Do not exceed 500 psi on SQZ						
2600'-Zone Isoloation Plug: Mix, Spot & Sqz Cmt plug in 5-1/2" csg f/ 2,080'-1,980' + 50' excess cmt w/ (3.7 bbls / 20.5 cuft / 15.6 sx) 1.32 yield Class "C" cmt. WOC 4 hrs. Tag & Record						
2700'- Perf 5-1/2" Csg @	2,700'. TOC on 5-1/2" unkno	ow at this time. Atte	empt to SQZ plug.			
Do not exceed 500 psi of 25 sx3425' -Mix & Spot 100'	n SQZ. Cmt plug f/ 3 525' - 3 425' or	ton CIRP w/ (2.44	hble / 13 7 cuft / 10 5 ev)			
1.32 vield Class "C" cmt.	WOC 4hrs. Tag & Record.					
	ve 2-7/8" Junk Tbg Fish Spo					
LPC Area Below ground mark	ter send pics before backfilling	nole	SEE ATTACHED CONDITIONS OF APPROVAL			
g 15		ъ.				
Spud Date: 07/16/1958	Rig Release	Date:				
I hereby certify that the information	n above is true and complete to the	best of my knowledge	e and belief.			
SIGNATURE Nicole L	ee _{TITLE} Reç	julatory Analyst	DATE_10/21/2022			
			PHONE: 713-437-8050			
For State Use Only	E-maii addr	CSS:	PHONE: 1.10 101 0000			
APPROVED BY:	touther TITLE CO	mpliance Officer A	DATE 10/31/22			
Conditions of Approval (if any):		575-263-6633				

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS


The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:


- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

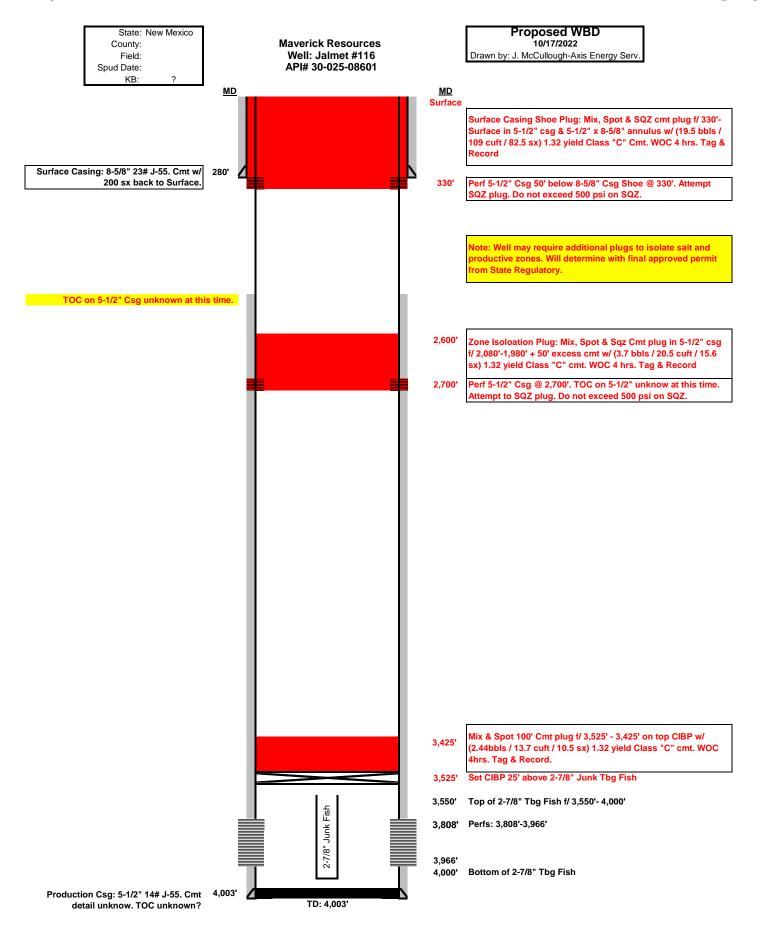

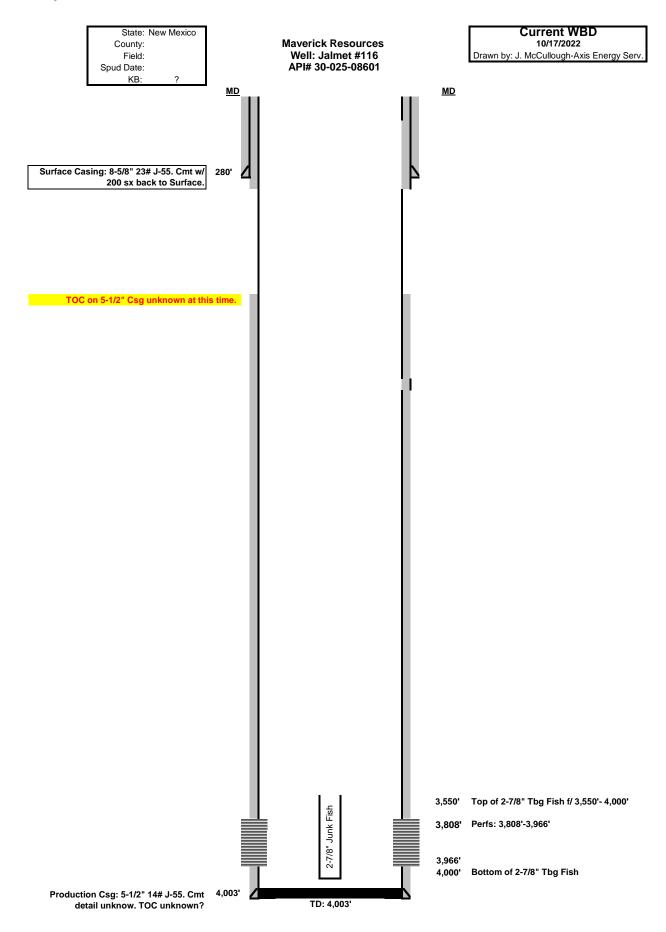

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 152598

COMMENTS

Operator:	OGRID:
BREITBURN OPERATING LP	370080
1111 Bagby St. Suite 1600	Action Number:
Houston, TX 77002	152598
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM	11/1/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 152598

CONDITIONS

Operator:	OGRID:
BREITBURN OPERATING LP	370080
1111 Bagby St. Suite 1600	Action Number:
Houston, TX 77002	152598
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Create By	d Condition	Condition Date
kfort	ser See attached COA	10/31/2022