

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT Sundry Print Report 04/01/2024

Well Name: FEDERAL V COM

Well Location: T20S / R28E / SEC 8 / SWNW / 32.5909292 / -104.2053256

County or Parish/State: EDDY /

Well Number: 4

Type of Well: CONVENTIONAL GAS

Allottee or Tribe Name:

Lease Number: NMNM83584

Unit or CA Name: FEDERAL V #1

Unit or CA Number: NMNM84643

US Well Number: 3001535127

Well Status: Producing Gas Well

Operator: MEWBOURNE OIL

COMPANY

Notice of Intent

Sundry ID: 2777194

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 02/28/2024

Time Sundry Submitted: 01:19

Date proposed operation will begin: 04/15/2024

Procedure Description: Please see attached P&A procedure and wellbore schematics.

Surface Disturbance

is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Current_WBS_20240228131835.pdf

Proposed_WBS_20240228131835.pdf

Federal_V__4_PA_20240228131816.pdf

APPROVAL SUBJECT TO GENERAL REQUIREMENTS AND SPECIAL STIPULATIONS ATTACHED

Well Name: FEDERAL V COM Well Location: T20S / R28E / SEC 8 /

SWNW / 32.5909292 / -104.2053256

County or Parish/State: EDDY /

Allottee or Tribe Name:

NM

Well Number: 4

Type of Well: CONVENTIONAL GAS

WELL

Lease Number: NMNM83584

Unit or CA Name: FEDERAL V #1

Unit or CA Number: NMNM84643

US Well Number: 3001535127

Well Status: Producing Gas Well

Operator: MEWBOURNE OIL

COMPANY

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: JACKIE LATHAN

Signed on: FEB 28, 2024 01:17 PM

Name: MEWBOURNE OIL COMPANY

Title: Regulatory

Street Address: PO Box 5270

City: Hobbs

State: NM

Phone: (575) 393-5905

Email address: Jlathan@mewbourne.com

Field

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified *BY PHONE* (numbers listed in 2. Notifications) minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Doris Lauger Martinez Environmental Protection Specialist 575-234-5926

Jaden Johnston Environmental Protection Asst. (Intern) 575-234-6252 Form 3160-5 (June 2019)

UNITED STATES

FORM APPROVED OMB No. 1004-0137

	Expires:			
ease Serial No)	**********	 	

	PARTMENT OF THE INTE				Expires: October 31, 202	.1
	EAU OF LAND MANAGE			5. Lease Serial 1	No. NMNM83584	Notice that was a process of the following the second state of the process of the following the second state of the second sta
SUNDRY N	NOTICES AND REPORTS	S ON WEL	LS	6. If Indian, Allo	ottee or Tribe Name	
abandoned well.	form for proposals to dr Use Form 3160-3 (APD)	rill or to re for such p	enter an Proposals.			
	TRIPLICATE - Other instruction	ns on page 2			/Agreement, Name and/or l	No.
1. Type of Well					1/NMNM84643	
Oil Well Gas V 2. Name of Operator AFTA/POLIDALE	Inches I			8. Well Name an	nd No. FEDERAL V COM	4
MEWBOURNE				9. API Well No.		
3a. Address P O BOX 5270, HOBBS	(575)	hone No. (incli) 393-5905	ide area code)	1	ol or Exploratory Area AT,/BURTON FLAT	
4. Location of Well (Footage, Sec., T., K SEC 8/T20S/R28E/NMP	₹.,M., or Survey Description)	2		11. Country or P EDDY/NM	arish, State	
12. CHE	CK THE APPROPRIATE BOX(ES	S) TO INDICA	TE NATURE OF	NOTICE, REPORT OF	R OTHER DATA	
TYPE OF SUBMISSION			-	F ACTION		
✓ Notice of Intent	Acidize	Deepen		Production (Start/Resu	ime) Water Shut-O	ff
	Alter Casing	Hydraulic	Fracturing	Reclamation	Well Integrity	
Subsequent Report	Casing Repair	New Cons	truction	Recomplete	Other	
Final Abandonment Notice	Change Plans	✓ Plug and A	bandon	Temporarily Abandon		
Describe Proposed or Completed Of the proposal is to deepen directions.	Convert to Injection	Plug Back		Water Disposal		
	cedure and wellbore schematics	s.	uding reclamation	n, have been completed	and the operator has detenr	uned that the site
14. I hereby certify that the foregoing is to JACKIE LATHAN / Ph: (575) 393-59		yped)	Regulatory			
2.1.2.2.2.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1	700	Title	. Togalatoly			
Signature (Electronic Submission	٦)	Date		02/2	28/2024	
	THE SPACE FOR	R FEDERA	L OR STATE	OFICE USE		
Approved by						
Conditions of approval, if any, are attached certify that the applicant holds legal or exwhich would entitle the applicant to conditions.	quitable title to those rights in the co	ot warrant or subject lease	Title letale	m Engineer	Date 4/1/2014	
Title 18 U.S.C Section 1001 and Title 43 any false, fictitious or fraudulent statemen	U.S.C Section 1212, make it a crir nts or representations as to any man	me for any pers tter within its ju	on knowingly and prisdiction.	l willfully to make to ar	ny department or agency of	the United States
(Instructions on page 2)				37,755,555,55		

Released to Imaging: 4/17/2024 10:49:04 AM

GENERAL INSTRUCTIONS

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

NOTICES

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240


Additional Information

Location of Well

0. SHL: SWNW / 1590 FNL / 910 FWL / TWSP: 20S / RANGE: 28E / SECTION: 8 / LAT: 0.0 / LONG: 0.0 (TVD: 0 feet, MD: 0 feet) BHL: SWNW / 1590 FNL / 910 FWL / TWSP: 20S / SECTION: / LAT: 0.0 / LONG: 0.0 (TVD: 0 feet, MD: 0 feet)


Federal V #4

1590' FNL & 910' FWL, Sec. 8 –T20S - R28E - Eddy Co, NM API 30-015-35127

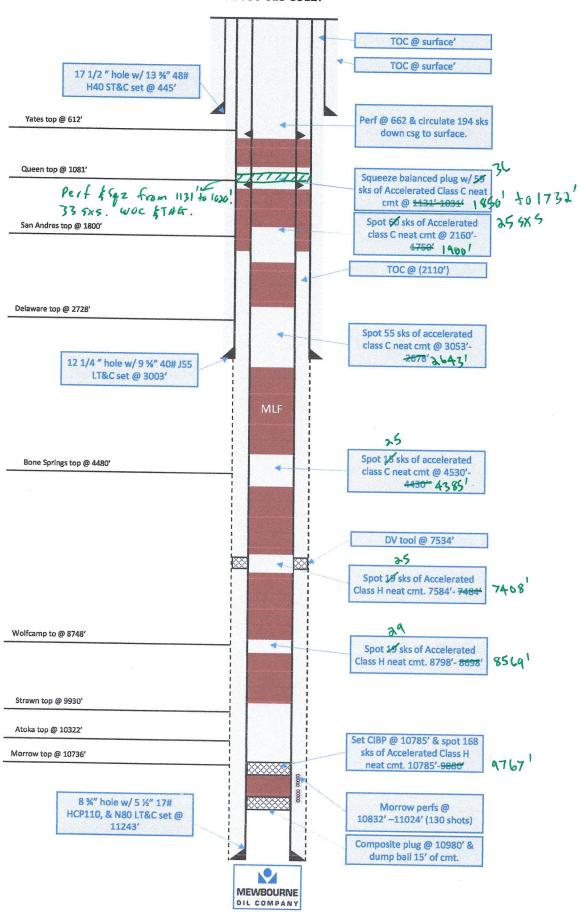

Federal V #4

1590' FNL & 910' FWL, Sec. 8 –T20S - R28E - Eddy Co, NM API 30-015-35127

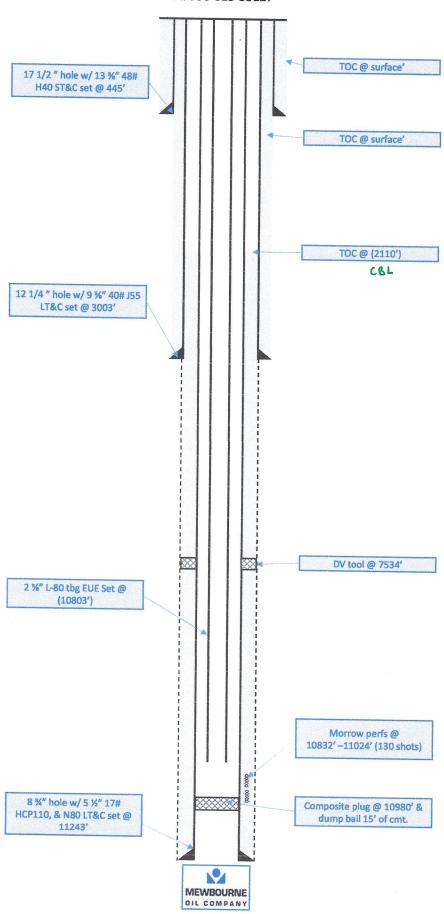

Merchanna Off Company

Plug and Abandon Submitted By: Z. Short 2. ND WH & NU BOP. 3. TOOH w/ tbg. Run Gause Ring to 10945' and tag Existing CIBP. 4. RIH w/ 5 ½" CIBP & 2 %" tbg. 5. Set 5 ½" CIBP @ 10785' (Top perf @ 10832'). Circulate 9.0# MLF to surface. Test csg to 500# for 30 mins.

Wellname: Federal V #4

Location:

1590' FNL & 910' FWL; Sec 8, T20S, R28E; Eddy

Co., NM

Date: February 22, 2024

Csg Set: 5 1/2" Set @ 11243'

Inter Csg Set: 9 5/8" Set @ 3003'

Csg Size: 5 ½" 17# HCP110 & N80 LT&C

Inter Csg Size: 9 %" 40# J55 LT&C

Surf Csg: 13 %" 48# H40 ST&C

Tbg Size @: 2 %" EUE 8RD L-80

Set @: 445'

Perfs: 11024'-10832' (130 shots)

Procedure as follows:

- MIRU turnkey plugging crew. Blow well down.

- 6. Spot 168 sacks of Accelerated Class H neat cmt (1358' ±) (Morrow @ 10736', Atoka @ 10322', & Strawn @
- 7. WOC 4 hrs & tag plug @ 9880' or higher. 97 1,7
 8. LD pipe to 8798' (WFCP @ 8748'). Spot 19 sacks of Accelerated Class H neat cmt. (150' ±) 2 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9. WOC 4 hrs & tag plug @ 8898' or higher. 45 1,9
 9.
- 10. LD pipe to 7584' (DV tool @ 7534'). Spot 19 sacks of Accelerated Class H neat cmt. (150' ±) \$2.5 5% 5 11. WOC 4 hrs & tag plug @ 7484' or higher. 7405'
- 12. LD pipe to 4530' (Bone Spring @ 4480'). Spot 15 sacks of Accelerated Class C neat cmt. (150' ±) 3.5 5x 5
- 13. WOC 4 hrs & tag plug @ 4430' or higher. 4355
- 14. LD pipe to 3053' (9 5/4" csg shoe @ 3003', & Delaware @ 2728'). Spot \$5 sacks of Accelerated Class C neat cmt. (563' ±)
- 15. WOC 4 hrs & tag plug @ 2678' or higher. ১ 43'
- 16. LD pipe to 2160' (TOC @ 2110', & San Andres @ 1800'). Spot 60 sacks of Accelerated Class C neat cmt. 19001
- 17. WOC 4 hrs & tag plug @ 1750' or higher.
- 18. TOOH w/ tbg.
- 19. RIH w/ perforation guns. Perforate 5 1/2" csg @ 11.31' (Queen @ 1081') (San Andres @ 1800')

20. POOH w/ guns.

- Circulate 9# MLF out 5 ½" annulus to surface.
- 22. TIH w/ tbg & pkr to 5/15'. Squeeze halanced plug squeezed through the perfs w/ 50 sacks of Accelerated Class C neat cmt (200' ±). Set Miker @ 1800'
 23. WOC 4 hrs & tag plug @ 1081' or higher. 1732 TAK or higher
- 24. TOOH w/ tbg & pkr.
- 25. RIH w/ perforation guns. Perforate 5 ½" csg @ 662' (Yates @ 612' & 13 ¾" csg shoe @ 445').

26. POOH w/ guns.

27. Circulate Accelerated Class C neat cmt to surface (approximately 194 sacks). (1n 66 915/607 131 519)

28. WOC & confirm that wellbore remains full.

29. Cut off WH & install dry hole marker. Cut off anchors & clean location.

Ly Repeat step 19 - 24. Instead Perfe 1131 and set packer @ 1100. Squeeze 33 sxs. class C. wac &TAKe 1020' or higher.

Page 1 of 1

Sundry ID	2777194						
Plug Type	Тор	Bottom	Length	Tag	Sacks	Cement Class	Notes
riug Type	ТОР	Bottom	Length	ray	Sacks	Ciass	Notes
Surface Plug	0.00	100.00	100.00	Tag/Verify			
Fresh Water @ 158	106.42	208.00	100.00	If solid			
Top of Salt @ 382	328.18	432.00		Tag/Verify			
13.375 inch- Shoe Plug	390.55	495.00	104.45	Tag/Verify			
Yates @ 612	555.88	662.00	106.12	If solid			
Base of Salt @ 612	555.88			Tag/Verify	197.00	С	Perf and squeeze from 662' to surface (In 66 sxs/out 131 sxs) Verify at surface.
Queen @ 1081	1020.19	1131.00	110.81	If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio			Perf and squeeze from 1131' to 1020'. WOC and Tag. (In 1 1 sxs/Out 22 sxs)
Queen @ 1001	1020:19	1131.60	110.01	If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no			Perf and squeeze

1732.00

2643.79

2922.97

1850.00

2771.00

3053.00

Open

118.00 ns

127.21 If solid

130.03 Tag/Verify

Perforatio

36.00 C

41.00 C

from 1850' to 1732'. WOC and Tag. (In 12 sxs/Out 24 sxs)

Spot cement from 3053' to 2643'.

WOC and Tag.

San Andres @ 1800

9.625 inch- Shoe Plug

Delaware @ 2721

	- 1	-		1	1		1
				16 11 -1			
				If solid			
				base no			
				need to			
				Tag			
				(CIBP			
				present			
				and/or			
				Mechanic			
				al Integrity			
				Test), If			
				Perf &			
				Sqz then			
				Tag, Leak			
				Test all			
				CIBP if no			
				Open			
				Perforatio			Spot cement from
Bonesprings @ 4480	4385.20	4530.00	144.80	ns	25.00	С	4530' to 4385'.
. •							Spot cement from
							7584' to 7408'.
DV tool plug	7408.66	7584.00	175.34	Tag/Verify	25.00	Н	WOC and Tag.
, 5				,			J
				If solid			
				base no			
				need to			
				Tag			
				(CIBP			
				present			
				and/or			
				Mechanic			
				al Integrity			
				Test), If			
				Perf &			
				Sqz then			
				Tag, Leak			
				Test all			
				CIBP if no			
				Open			
				Perforatio			Spot cement from
Wolfcamp @ 8707	8569.93	8757.00	187.07		29.00	Н	8798' to 8569'.
Strawn @ 9917	9767.83	9967.00	199.17		20.00		0.00 10 0000.
Atoka @ 10219	10066.81	10269.00	202.19				
Morrow @ 10676	10519.24	10726.00	206.76				
-							
				If solid			
				If solid base no			
				base no			
				base no need to			
				base no need to Tag			
				base no need to Tag (CIBP			
				base no need to Tag (CIBP present			
				base no need to Tag (CIBP present and/or			
				base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If			
				base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf &			Run Gauge Ring to
				base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then			10945' and tag
				base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf &			10945' and tag existing CIBP. Set
				base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then			10945' and tag
				base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak			10945' and tag existing CIBP. Set
				base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all			10945' and tag existing CIBP. Set CIBP at 10785'.
				base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no			10945' and tag existing CIBP. Set CIBP at 10785'. Leak test CIBP. Spot cement from 10785' to 9767'.
CIBP Plug	10750.00	10785.00	35.00	base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio ns	126.00	Н	10945' and tag existing CIBP. Set CIBP at 10785'. Leak test CIBP. Spot cement from
CIBP Plug Perforations Plug (If No CIBP) 5.5 inch- Shoe Plug	10750.00 10782.00		35.00 292.00	base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio	126.00	н	10945' and tag existing CIBP. Set CIBP at 10785'. Leak test CIBP. Spot cement from 10785' to 9767'.

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole. Class H >7500' Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

		Bottom of Kars	st/take deepe	st fresh water/top of salt whichever is greater to
Cave Karst/Potash Cement Requirement:	<u>High</u>	<u>surface</u>		
13.375 inch- Shoe Plug @ 9.625 inch- Shoe Plug @ 5.5 inch- Shoe Plug @	445.00 3003.00 11243.00	0	oc @	2110.00
Perforatons Top @	10832.00) Pe	erforations	11024.00
DV Tool @	7534.00) CI	BP @	10785.00

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 328663

CONDITIONS

Operator:	OGRID:
MEWBOURNE OIL CO	14744
P.O. Box 5270	Action Number:
Hobbs, NM 88241	328663
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

	Created By		Condition Date
Ī	gcordero	CBL is in well file	4/17/2024