

Santa Fe Main Office
Phone: (505) 476-3441
General Information
Phone: (505) 629-6116

Online Phone Directory Visit:
<https://www.emnrd.nm.gov/ocd/contact-us/>

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-22012	
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>	
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name Warren State	
8. Well Number 1	
9. OGRID Number 247692	
10. Pool name or Wildcat Bagley Permo Penn North	
4. Well Location Unit Letter <u>G</u> : 1980 feet from the <u>North</u> line and 1980 feet from the <u>East</u> line Section 28 Township 11 S Range 33 E NMPM County Lea	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 4262 KB	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK PLUG AND ABANDON
TEMPORARILY ABANDON CHANGE PLANS
PULL OR ALTER CASING MULTIPLE COMPL
DOWNHOLE COMMINGLE
CLOSED-LOOP SYSTEM
OTHER:

SUBSEQUENT REPORT OF:

REMEDIAL WORK ALTERING CASING
COMMENCE DRILLING OPNS. P AND A
CASING/CEMENT JOB
OTHER:

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

SEE ATTACHED

Spud Date:

11/20/2024

Rig Release Date:

01/17/2025

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE



TITLE

Agent

DATE 01/09/2026

Type or print name Quang TruongE-mail address: qtram@jaymgt.comPHONE: 713-621-6785For State Use Only

APPROVED BY:

TITLE

DATE

Conditions of Approval (if any):

RIG 110

WARREN STATE #1 – JAY MGMNT – START 11.20.24

FINISH 1.17.25

API# 30-025-22012

11.20.24

MOVE EQUIPMENT RIG DOG HOUSE BOP TRAILER

SPOT BASE BEAM RUSU

CHANGE TBG EQUIPMENT TO ROD EQUIPMENT BLEED OFF WELL RIG DOWN FLOW LINE DIG SELLER
FOR 8 5/8 VALVE SECURE WELL SDFN

TRAVEL TO HOTEL

11.21.24

DROVE TO LOCATION

HOLD TGSM

LATCH ON RODS WORK TO GET PUMP UNSET PUMP 10 BBLS TBG GET PRSSURE UP

PUMP 20 BBLS BROCK CIRCULATION AND CONTINUE PUMP 60 BBLS MORE

CONITNUE TRY TO UNSET PUMP NO LUCK SECURE WELL SDFN

TRAVEL HOME

11.22.24 – 11.30.24 DOWN

12.2.24

DROVE TO LOCATION

HOLD TGSM

CONTINUE WORK TO UNSET PUMP

RIG UP FLOOR TBG TONGS AND BACK OFF TOOL BACK OFF RODS RIG DOWN TBG TONGS FLOOR RIG
ROD TONGS

POOH LAY DOWN 234 RODS

N/D WELL HEAD

N/U BOP RIG UP FLOOR AND TBG EQUIPMENT

POOH W/ 15 STANDS SECURE WELL SDFN

TRAVEL HOME

12.3.24

DROVE TO LOCATION

HOLD TGSM

CONTINUE POOH W/ 155 JTS AT 4886

WAIT ON ORDERS OCD OF NM DECIDE TO TRY FISH ORDER TOOL TO FISH SECURE WELL SDFN

TRAVEL HOME

12.4.24

DROVE TO LOCATION

HOLD TGSM

MIRU 4.5 BIT AND SCRAPER RIH W/ 137 AND PICK UP 18 JTS TO EOT AT 4886

POOH W/ 155 JTS LAY DOWN BIT & SCRAPER

MIRU OVER SHOT AND BUMP SOP RIH W/ 156 JTS LATCH ON FISH WORK TO GET TAC RELEASE

WORK TO GET FISH FREE TBG PARTED

POOH W/ 156 JTS AND 9 MORE JTS

PULL PIECE OF TBG FROM OVER SHOT SECURE WELL SDFN

TRAVEL HOME

12.5.24

DROVE TO LOCATION

HOLD TGSM

MIRU 2 JTS OF WASH OVER PIPE RIH W/ 159 JTS TAG TIGHT SPOT

RIG UP POWER SWIVEL & STRIPPER HEAD

CLEAN UP TIGHT SPOT AND CONTINUE WASH DOWN TO 5220 CIRCULATE WELL CLEAN

RIG DOWN POWER SWIVEL AND STRIPPER HEAD

POOH W/ 163 JTS AND 2 JTS OF WASH OVER

MIRU OVER SHOT W/ GRAPPLE TO CATCH 2 3/8 BODY RIH W/ 45 STANDS SECURE WELL SDFN

TRAVEL HOME

12.6.24

DROVE TO LOCATION

HOLD TGSM

CONTINUE RIH W/ OVER SHOT AND GRAPPLE TO CATCH 2 3/8 BODY

LATCH ON FISH AT 5150 WORK TO GET TBG FREE

POOH W/ 162 JTS BUMPER SUB OVER SHOT AND 3 JTS AND A PIECE TOP OF FISH AT 5250 SECURE WELL

SDFN

TRAVEL HOME

12.9.24

DROVE TO LOCATION

HOLD TGSM

WAIT ON ORDERS

MIRU OVER SHOT W/ GRAPPLE TO CATCH 2 3/8 BODY RIH W 165 JTS TO TOP OF FISH AT 5250

RIG UP POWER SWIVEL AND STRIPPER HEAD DRESS TOP OF FISH

LATCH ON FISH WORK TO GET TBG RELEASE

RELEASE GRAPPLE FROM FISH RIG DOWN POWER SWIVEL AND STRIPPER HEAD

POOH W/ 165 JTS AND OVER SHOT AND GRAPPLE SECURE WELL SDFN

TRAVEL HOME

12.10.24

DROVE TO LOOCATION

HOLD TGSM

MIRU OVER SHOT W/ GRAPPLE TO CATCH 2 3/8 BODY RIH W/ 165 JTS AND LACTCH ON FISH

WAIT ON WIRE LINE

MIRU AAA WIRE LINE RIH W/ WEIGHT BARS AND CCL TO 5859 POOH AND RIH W/ JET CUTTER TO 5859

CUT 2 3/8 TBG POOH RIG DOWN AAA WIRE LINE .

POOH W/165 AND OVER SHOT AND 20 JTS AND A PIECE TOP OF THE FISH 5859 SECURE WELL SDFN

TRAVEL HOME

12.11.24

DROVE TO LOCATION

HOLD TGSM

WORK TO GET RIG RUNNING

MIRU SHOE AND 3 JTS OF WASH OVER PIPE RIH W/ 168 JTS T 5415

RIG UP POWER SWIVEL AND STRIPPER HEAD

BREAK CIRCULATION START WASH DOWN MAKE 5 CONECTION CIRCULATE

RIG DOWN POWER SWIVEL POOH W/ 30 STANDS SECURE WELL SDFN

TRAVEL HOME

12.12.24

DROVE TO LOCATION

HOLD TGSM

RIH W/30 STANDS RIG UP POWER SWIVEL

START WASHING DOWN AT 5526 STOPPED AT 5885

CIRCULATE WELL CLEAN PUMP 80 BBLS 9.5 RIG DOWN POWER SWIVEL POOH W/ 30 STANDS SECURE

WELL SDFN

TRAVEL HOME

12.13.24

DROVE TO LOCATION

HOLD TGSM

CONTINUE POOH W/ 137 JTS AND 3 JTS OF WASH OVER PIPE

MIRU NEW

RIG UP POWER SWIVEL AND STRPPER HEAD

BREAK CIRCULATION START WASH DOWN FROM 5885 TO 5942

CIRCULATE WELL CLEAN RIG DOWN POWER SWIVEL

POOH 20 STANDS SECURE WELL SDFN

TRAVEL HOME

12.16.24

DROVE TO LOCATION

HOLD TGSM

NIPPLE DOWN STRIPPER HEAD CONTINUE POOH W/ 146 JTS TOTAL PULL 186 AT 5946 AND LAY DOWN
3 JTS OF WASH OVER PIPE

MIRU 4.5 TENSION PKR RIH W/ 166 JTS AT 5277 SET PKR

LOAD HOLE PRESSURE TEST 4.5 CSING FROM 5277 TO SURFCE AT 500 PSI AND LOST ALL PRESSURE
AND 2 MINUTES PUMP DOWN TBG PRSSURE UP TO 1000 PSI AND HOLD BLEED OFF PRESSURE
WAIT ON ORDERS SECURE WELL SDFN

TRAVEL HOME

12.18.24

DROVE TO LOCATION

HOLD TGSM

UNSET PKR POOH W/ 166 JTS RIG LD 4.5 PKR

MIRU ONE JTN OF WASH OVER PIPE AND TBG EXTERNAL CUTTER FOR 2 3/8 TBG RHI W/ 184 JTS
RIG UP POWER SWIVEL

START CUT 2 3/8 TBG AT 5976

WORK TO GET TBG RELEASE PULL 5 STANDS AND GET STUCK AGAIN SECURE WELL SDFN

TRAVEL HOME

12.19.24

DROVE TO LOCATION

HOLD TGSM

WORK TO GET TBG RELEASE PULL 60 JTS AND TBG STUCK AGAIN WORK TO GET RELEASE AND
CONTINUE POOH LOOSE FISH

WAIT ON FISHING TOOLS

TRAVEL HOME

12.20.24

DROVE TO LOCATION

HOLD TGSM

MIRU PERFORMANCE OVER SHOT W/ GRAPPLE TO CATCH 2 3/8 TBG AND BUMPER SUB RIH W/ 185 JTS
LATCH ON FISH WORK TO RELEASE FISH

POOH SLOW W/ 185 JTS BUMPER SUB OVER SHOT AND GRAPPLE COULDN'T LATCH

WAIT ON ORDERS

MIRU SMALL GRAPPLE RIH W/ OVER SHOT BUMPER SUB AND 185 JTS LATCH ON FISH WORK TO GET
FISH RELEASE

POOH W/ 185 JTS BUMPER SUB AND OVER SHOT AND TWO MORE JTS SECURE WELL CLEAN GRAPPLE
SDFN

TRAVEL HOME

1.6.25

DROVE TO LOCATION

HOLD TGSM

MIRU 3 7/8 FLAT BOTTOM SHOE TWO JTS OF WASH OVER PIPE AND RIH W/ 184 JTS TAG AT 5897

RIG UP POWER SWIVEL AND STRIPPER HEAD

BREAK CIRCULATION WASH DOWN TO 5960

CIRCULATE WELL CLEAN RIG DOWN POWER SWIVEL AND STRIPPER HEAD

POOH W/ 186 JTS TWO JTS OF WASH OVER PIPE AND SHOE SECURE WELL SDFN

TRAVEL

HOME

1.7.25

DROVE TO LOCATION

HOLD TGSM

MIRU OUT SIDE CUTTER TWO JTS OF WASH OVER PIPE RIH W/ 185 JTS

RIG DOWN TBG EQUIPMENT RIG UP POWER SWIVEL

PICK UP ONE JTN CUT 2 3/8 TBG

RIG DOWN POWER SWIVEL RIG UP TBG EQUIPMENT

POOH W/ 186 JTS TWO JTS OF WASH OVER PIPE CUTTER TWO MORE JTS OF 2 3/8 AND TWO RODS TOP

OF FISH AT 5957

RIG DOWN ALL EQUIPMENT FOR PERFORMANCE OIL TOOLS

MIRU 4.5 PKR RIH W/182 AT 5785 SET PKR

LOAD TBG PRESSURE UP TO 1000 PSI AND HOLD BLEED OFF PRESSURE SECURE WELL SDFN

TRAVEL HOME

1.13.25

DROVE TO LOCATION

HOLD TGSM

POOH W/ 186 JTS AND 4.5 PKR

MIRU AAA WIRE RIH W/ GAUGE RING AT 5900 POOH

MIRU 4.5 CIBP RIH AND SET AT 5907 POOH

MIRU CBL TOOLS AND RUN CBL

WAIT ON OCD TO REVIEW RESULTS OF CBL RIG DOWN AAA WIRE LINE

RIH W/186 TO EOT AT 5907 SECURE WELL SDFN

TRAVEL HOME

1.14.25

Drove to location.

Tag Plug #3 @ 2315' & P.O.O.H. TBG

R.U. AAA WL,

PERF, P.O.O.H.

R.I.H. 58 JTS w/ AD-1 PKR ON BTM, CHECK INJECTIONON PERFS. (No injection.)

TALK TO RRC & REQUEST TO DROP 50' & SPOT 20SX CMT. P.O.O.H. PKR & R.I.H. TBG OPEN ENDED.

SPOT PLUG #4. P.O.O.H.
TBG.
R.U. WL, PERF & P.O.O.H.
TEST INJECTION RATE ON PERFS. (No inj.) CALL NM & REQUEST TO DROP 50' & SPOT 20 SXS CMT. R.I.H.
56 JTS.
SPOT PLUG #5 & P.O.O.H. TBG. R.U.
WL, PERF & P.O.O.H.
R.I.H. 11 JTS w/ AD-1 PKR ON BTM & CHECK INJ RATE ON PERFS. (Good inj. Circulated to surface.)
SQZ PLUG #6.
DROVE TO HOTEL.

1.15.25

DROVE TO LOCATION

HOLD TGSM

RIH W/ 25 STANDS TAG PLUG # 2 AT 4826 POOH W/ 77 JTS TO EOT AT 3480

RIG UP AAA WIRE LINE RIH W/ PERFORATING GUNS SHOT 4.5 CASING AT 3780 POOH RIG DOWN AAA
WIRE LINE

GET INJECTION RATE PUMP 0.5 BBLS AT 1000 Psi UNSET PKR RIH W/ 12 JTS TO EOT AT 3830

PLUG # 3 MIX & PUMP 25 SXS OCD OF NM AUTHORIZE TO DROP 50 FT FROM PERFS AND BALACE 25 SXS
POOH 30 STANDS WOC

RIH W/ 25 STANDS TAG PLUG # 3 AT 3442 POOH LAY DOWN 53 JTS SET PKR

RIG UP AAA WIRE LINE RIH W/ PERFORATING GUNS SHOT 4.5 CASING AT 2490 POOH RIG DOWN AAA
WIRE LINE

GET INJECTION RATE PRESSURE UP TO 1000 PSI AND HOLD UNSET PKR RIH W/ 12 JTS TO EOT AT 2540

PLUG # 4 MIX & PUMP 25 SXS

POOH 30 STANDS SECURE WELL SDFN

TRAVEL HOME

1.16.25

DROVE TO LOCATION

HOLD TGSM

RIH W/ 25 STANDS TAG PLUG # 4 AT 2143 POOH LAY DOWN 20 JTS TO EOT AT 1525 SET PKR

RIG UP AAA WIRE LINE RIH W/ PERFORATING GUNS SHOT 4.5 CASING AT 1818 POOH RIG DOWN WIRE
LINE

GET INJECTION RATE 1BBLS X MINUTE AT 900 PSI

PLUG # 5 MIX&PUMP 65 SXS WOC

WOC

RIH W/6 JTS TAG PLUG # 5 AT 1703 POOH LAY DOWN 36 JTS TO EOT AT 381

RIG UP AAA WIRE LINE RIH W/ PERFORATING GUNS SHOT 4.5 CASING AT 470 POOH RIG DOWN WIRE
LINE

GET INJECTION RATE 1.5 BBLS X MINUTE AT 400 PSI

PLUG # 6 MIX & PUMP 175 SXS WASH PUMP BOP FROM CMT DRIAN HOSES FROM FRESH WATER SDFN
TRAVEL HOME

1.17.25

DROVE TO LOCATION

HOLD TGSM


RIG DOWN TBG EQUIPMENT AND FLOOR N/D BOP

RDSU AND ALL EQUIPMENT

DIG SELLER CUT WELL HEAD INSTALL DRY HOLE MARKER MIX CMT LEVEL LOCATION

Unit Letter G, 1980' North , 1980' East
Sect 28, Township 11S, Range 33E NMPP
Lea Co, NM ()
API No. 30-025-22012

Jay Management Company, LLC
2401 Fountain View, Suite 420
Houston, TX 77057

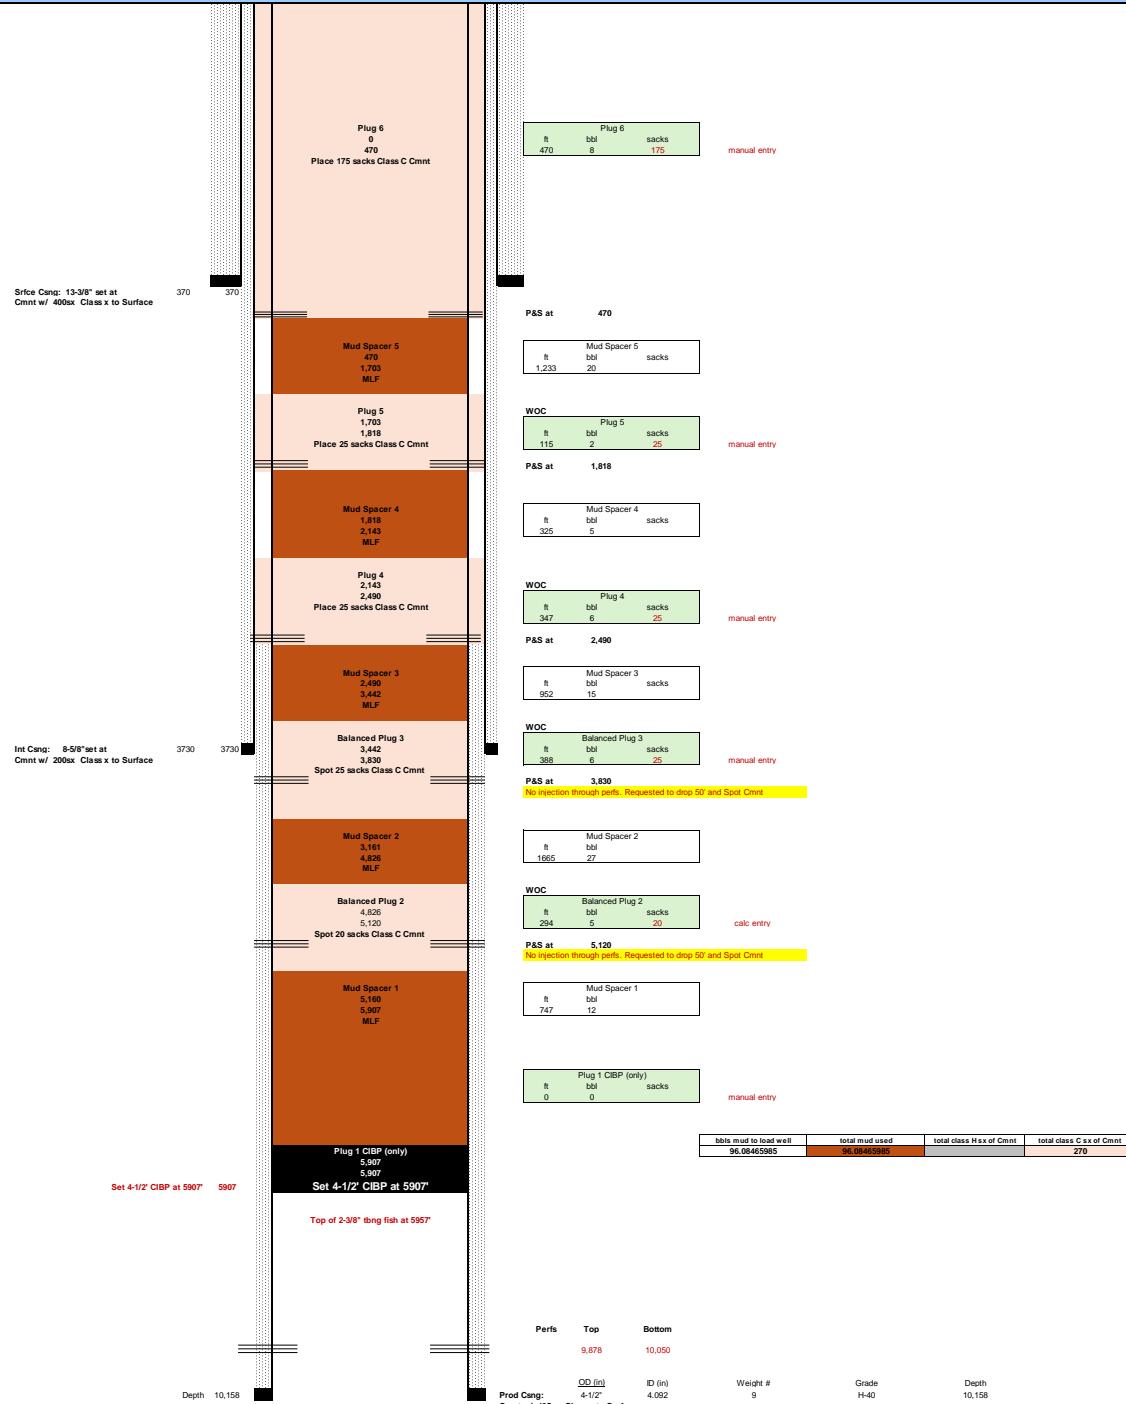

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 541846

CONDITIONS

Operator: JAY MANAGEMENT COMPANY, LLC 2401 Fountain View Drive Houston, TX 77057	OGRID: 247692
	Action Number: 541846
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
gcordero	Clean Location in accordance with 19.15.25.10 NMAC.	1/16/2026
gcordero	Submit C-103Q within one year of plugging.	1/16/2026