Office		of New Mex	_			Form C-103
District I	Energy, Mine	rals and Natur	al Resources	TYPEY A DI	NO.	June 19, 2008
1625 N. French Dr., Hobbs, NM 88240 District II				WELL API	NO. 3-20014	
1301 W. Grand Ave., Artesia, NM 88210 OIL CONSERVATION DIVISION			5. Indicate		e	
District III 1220 South St. Francis Dr. 1000 Rio Brazos Rd., Aztec, NM 87410			STAT		FEE 🗌	
District IV Santa Fe, NM 8/505			6. State Oil	& Gas Lease	e No.	
1220 S. St. Francis Dr., Santa Fe, NM 87505						
	CES AND REPORT	S ON WELLS		7. Lease Na	me or Unit A	Agreement Name
(DO NOT USE THIS FORM FOR PROPOS				0-4'11		
DIFFERENT RESERVOIR. USE "APPLIC PROPOSALS.)	CATION FOR PERMIT	(FORM C-101) FO	R SUCH		ead Mesa	
1. Type of Well: Oil Well Gas Well X Other			8. Well Number 2			
2. Name of Operator Chaparral Energy 1.1.C			9. OGRID Number			
Chaparral Energy, L.L.C. 3. Address of Operator			004115 10. Pool name or Wildcat			
701 Cedar Lake Blvd., Oklahoma City, OK 73114				Wildcat		
4. Well Location	anoma City, OK 75	114		Aluka	vviideat	
Unit Letter E :	1980' feet from	the Nort	line and	660' fe	et from the	West line
Section 2	Townshi	p 4S Rai	 1ge 9E	NMPM So	_	nty
	11. Elevation (Sho		RKB, RT, GR, etc.,			
	5972 GL					
,						
12. Check A	appropriate Box t	o Indicate Na	iture of Notice,	Report or O	ther Data	
NOTICE OF IN	TENTION TO:	I	SUB	SEQUENT	REPORT	Γ OF·
PERFORM REMEDIAL WORK □	PLUG AND ABAN	DON []	REMEDIAL WOR			RING CASING 🔲
TEMPORARILY ABANDON	CHANGE PLANS		COMMENCE DRI		_	
PULL OR ALTER CASING	MULTIPLE COMP	1	CASING/CEMEN		$\overline{\Box}$	•
		_			_	
DOWNHOLE COMMINGLE		1				
-		_]				_
OTHER:			OTHER:	<u> </u>		
OTHER: 13. Describe proposed or compl			ertinent details, an			
OTHER: 13. Describe proposed or complete of starting any proposed wo			ertinent details, an			
OTHER: 13. Describe proposed or completion of starting any proposed work or recompletion.	rk). SEE RULE 110	03. For Multipl	ertinent details, an e Completions: At	tach wellbore	diagram of p	proposed completion
OTHER: 13. Describe proposed or compl of starting any proposed wo or recompletion. To Plug & Abandon th	rk). SEE RULE 110	03. For Multipl Service Unit. Lo	ertinent details, and completions: At pad csg w/73 BW	tach wellbore . Pressure te	diagram of p	roposed completion
OTHER: 13. Describe proposed or compl of starting any proposed we or recompletion. To Plug & Abandon th leak, RU wireline & RI	rk). SEE RULE 110 iis well we MIRU S H w/ 3-1/8" HSC.	33. For Multipl Service Unit. Lo Tag CIBP @ 2	ertinent details, and e Completions: At pad csg w/73 BW 598'. Perf 4 sque	tach wellbore . Pressure te eeze holes 12	diagram of p st to 600 ps 83-90'. NUI	roposed completion sig. Had slow BOP & TIH
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended.Put	rk). SEE RULE 110 his well we MIRU S H w/ 3-1/8" HSC. 1 mp & circ hole w/9	33. For Multipl service Unit. Lo Tag CIBP @ 2 0.5 #/gal mud.	ertinent details, and e Completions: At pad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/	tach wellbore 7. Pressure te peze holes 12 7. 14 its WS. S	diagram of p st to 600 ps 83-90'. NUI Spot 45 sx 0	roposed completion sig. Had slow BOP & TIH Class C cmt
OTHER: 13. Describe proposed or complete of starting any proposed were or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended.Put w/2% CaCl from 2000	rk). SEE RULE 110 his well we MIRU S 'H w/ 3-1/8" HSC. 1 mp & circ hole w/9 I' to 1900'. POOH v	33. For Multipl service Unit. Lo Tag CIBP @ 2 9.5 #/gal mud. w/ WS to 1000	ertinent details, and e Completions: At pad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/ " & WOC. RIH w/	tach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr	diagram of p st to 600 ps 83-90'. NUI Spot 45 sx C nt plau @ 1	sig. Had slow BOP & TIH Class C cmt 880'. POOH
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak. RU wireline & RI w/WS open ended.Purw/2% CaCl from 2000 w/WS to 1350' & Spot	rk). SEE RULE 110 is well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 ' to 1900'. POOH v : 100 sx Class C cr	O3. For Multiple Gervice Unit. Lost Tag CIBP @ 20.5 #/gal mud. W/ WS to 1000 mt plug w/2%C	ertinent details, and e Completions: At and csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W & WOC. RIH w/CaCl. POOH w/W	tach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr S to 500' & V	diagram of p st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w	sig. Had slow BOP & TIH Class C cmt 880'. POOH I/WS & tag
OTHER: 13. Describe proposed or complete of starting any proposed were or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended.Put w/2% CaCl from 2000	rk). SEE RULE 110 is well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 ' to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to	ervice Unit. Lo Tag CIBP @ 2 0.5 #/gal mud. w/ WS to 1000 nt plug w/2%0 surface. POO	ertinent details, and completions: At and completions: At 598'. Perf 4 sque SDON. POOH w. W. & WOC. RIH w. CaCl. POOH w/W. H w/WS to 900' 8	trach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr 8 to 500' & V 8 spot 45 sx (diagram of p st to 600 ps 83-90'. NUI 5pot 45 sx C nt plau @ 1 VOC. RIH w Class C cmt	sig. Had slow BOP & TIH Class C cmt 880'. POOH I/WS & tag
OTHER: 13. Describe proposed or complete of starting any proposed was or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended.Purw/2% CaCl from 2000 w/WS to 1350' & Spote cmt plug @ 1147'. Circle CaCl. From 800' to 90 w/2% CaCl from 63' to	rk). SEE RULE 110 is well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 ' to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 0'. POOH w/WS & c surface. POOH w	ervice Unit. Lo Tag CIBP @ 2 0.5 #/gal mud. w/ WS to 1000 nt plug w/2%0 surface. POO sSDON to WO WWS & fill top	ertinent details, and completions: At and completions: At 598'. Perf 4 sque SDON. POOH w. WOC. RIH w. CaCl. POOH w/W. H w/WS to 900' & C. RIH w/2 jts Woof hole w/cmt. Re	trach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr S to 500' & V 8 spot 45 sx (S S & spot 10 selease Service	st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD	sig. Had slow BOP & TIH Class C cmt 880'. POOH //WS & tag plug w/2% of Class C to WOC for
OTHER: 13. Describe proposed or complete of starting any proposed was or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Put w/2% CaCl from 2000 w/WS to 1350' & Spot cmt plug @ 1147'. Circ CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff	rk). SEE RULE 110 It well we MIRU S H w/ 3-1/8" HSC. It to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 10'. POOH w/WS & 5 surface. POOH w 1 surface pipe and	Gervice Unit. Lo Tag CIBP @ 2 0.5 #/gal mud. W/ WS to 1000 mt plug w/2%C surface. POO SDON to WO W/WS & fill top haul all junk fr	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W & WOC. RIH w/CaCl. POOH w/W H w/WS to 900' 8 C. RIH w/2 jts W of hole w/cmt. Resom location. Fille	trach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr S to 500' & V 8 spot 45 sx 0 S & spot 10 s elease Servic d pit and rest	st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD	sig. Had slow BOP & TIH Class C cmt 880'. POOH //WS & tag plug w/2% of Class C to WOC for
OTHER: 13. Describe proposed or complete of starting any proposed was or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended.Purw/2% CaCl from 2000 w/WS to 1350' & Spote cmt plug @ 1147'. Circle CaCl. From 800' to 90 w/2% CaCl from 63' to	rk). SEE RULE 110 It well we MIRU S H w/ 3-1/8" HSC. It to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 10'. POOH w/WS & 5 surface. POOH w 1 surface pipe and	Gervice Unit. Lo Tag CIBP @ 2 0.5 #/gal mud. W/ WS to 1000 mt plug w/2%C surface. POO SDON to WO W/WS & fill top haul all junk fr	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W & WOC. RIH w/CaCl. POOH w/W H w/WS to 900' 8 C. RIH w/2 jts W of hole w/cmt. Resom location. Fille	trach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr S to 500' & V 8 spot 45 sx 0 S & spot 10 s elease Servic d pit and rest	st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD	sig. Had slow BOP & TIH Class C cmt 880'. POOH //WS & tag plug w/2% of Class C to WOC for on. Set Dry
OTHER: 13. Describe proposed or complete of starting any proposed was or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Put w/2% CaCl from 2000 w/WS to 1350' & Spot cmt plug @ 1147'. Circ CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff	rk). SEE RULE 110 It well we MIRU S H w/ 3-1/8" HSC. It to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 10'. POOH w/WS & 5 surface. POOH w 1 surface pipe and	Gervice Unit. Lo Tag CIBP @ 2 0.5 #/gal mud. W/ WS to 1000 mt plug w/2%C surface. POO SDON to WO W/WS & fill top haul all junk fr	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W & WOC. RIH w/CaCl. POOH w/W H w/WS to 900' 8 C. RIH w/2 jts W of hole w/cmt. Resom location. Fille	trach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr S to 500' & V 8 spot 45 sx 0 S & spot 10 s elease Servic d pit and rest	st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD	sig. Had slow BOP & TIH Class C cmt 880'. POOH //WS & tag plug w/2% of Class C to WOC for on. Set Dry
OTHER: 13. Describe proposed or complete of starting any proposed was or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Put w/2% CaCl from 2000 w/WS to 1350' & Spot cmt plug @ 1147'. Circ CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff	rk). SEE RULE 110 It well we MIRU S H w/ 3-1/8" HSC. It to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 10'. POOH w/WS & 5 surface. POOH w 1 surface pipe and	Gervice Unit. Lo Tag CIBP @ 2 0.5 #/gal mud. W/ WS to 1000 mt plug w/2%C surface. POO SDON to WO W/WS & fill top haul all junk fr	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W & WOC. RIH w/CaCl. POOH w/W H w/WS to 900' 8 C. RIH w/2 jts W of hole w/cmt. Resom location. Fille	trach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr S to 500' & V 8 spot 45 sx 0 S & spot 10 s elease Servic d pit and rest	st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD	sig. Had slow BOP & TIH Class C cmt 880'. POOH //WS & tag plug w/2% of Class C to WOC for on. Set Dry
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Pure w/2% CaCl from 2000 w/WS to 1350' & Spote cmt plug @ 1147'. Circ CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff Hole marker and finish	rk). SEE RULE 110 his well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 0'. POOH w/WS & o surface. POOH w f surface pipe and o restoration of loc	ervice Unit. Lo Tag CIBP @ 2 0.5 #/gal mud. W/ WS to 1000 mt plug w/2%C surface. POO SDON to WC W/WS & fill top haul all junk fr ation. Well is F	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W & WOC. RIH w. CaCl. POOH w/W H w/WS to 900' & W. C. RIH w/2 jts W of hole w/cmt. Reson location. Fille P&A'd as of 9/23/	trach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr S to 500' & V 8 spot 45 sx 0 S & spot 10 s elease Servic d pit and rest	st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD	sig. Had slow BOP & TIH Class C cmt 880'. POOH //WS & tag plug w/2% of Class C to WOC for on. Set Dry
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Put w/2% CaCl from 2000 w/WS to 1350' & Spot cmt plug @ 1147'. Circ CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff	rk). SEE RULE 110 his well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 0'. POOH w/WS & o surface. POOH w f surface pipe and o restoration of loc	Gervice Unit. Lo Tag CIBP @ 2 0.5 #/gal mud. W/ WS to 1000 mt plug w/2%C surface. POO SDON to WO W/WS & fill top haul all junk fr	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W & WOC. RIH w. CaCl. POOH w/W H w/WS to 900' & W. C. RIH w/2 jts W of hole w/cmt. Reson location. Fille P&A'd as of 9/23/	trach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr S to 500' & V 8 spot 45 sx 0 S & spot 10 s elease Servic d pit and rest	st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD	sig. Had slow BOP & TIH Class C cmt 880'. POOH //WS & tag plug w/2% of Class C to WOC for
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Pure w/2% CaCl from 2000 w/WS to 1350' & Spote cmt plug @ 1147'. Circ CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff Hole marker and finish	rk). SEE RULE 110 his well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 0'. POOH w/WS & o surface. POOH w f surface pipe and o restoration of loc	ervice Unit. Lo Tag CIBP @ 2 0.5 #/gal mud. W/ WS to 1000 mt plug w/2%C surface. POO SDON to WC W/WS & fill top haul all junk fr ation. Well is F	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W & WOC. RIH w. CaCl. POOH w/W H w/WS to 900' & W. C. RIH w/2 jts W of hole w/cmt. Reson location. Fille P&A'd as of 9/23/	trach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr S to 500' & V 8 spot 45 sx 0 S & spot 10 s elease Servic d pit and rest	st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD	sig. Had slow BOP & TIH Class C cmt 880'. POOH //WS & tag plug w/2% of Class C to WOC for on. Set Dry
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Pure w/2% CaCl from 2000 w/WS to 1350' & Spote cmt plug @ 1147'. Circle CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff Hole marker and finish	rk). SEE RULE 110 his well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 10'. POOH w/WS & o surface. POOH w f surface pipe and o restoration of loc	Gervice Unit. Lo Tag CIBP @ 2 0.5 #/gal mud. W/ WS to 1000 mt plug w/2%C surface. POO SDON to WC W/WS & fill top haul all junk fr ation. Well is F	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W WOC. RIH w/CaCl. POOH w/W H w/WS to 900' 8 WC. RIH w/2 jts W of hole w/cmt. Reproduction. Fille P&A'd as of 9/23/2 te:	tach wellbore 7. Pressure te teze holes 12 7. 14 jts WS. S 7. WS & tag cr 8. to 500' & V 8. spot 45 sx (9. S & spot 10 s elease Servic d pit and rest 2008.	st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD	sig. Had slow BOP & TIH Class C cmt 880'. POOH //WS & tag plug w/2% of Class C to WOC for on. Set Dry
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Pure w/2% CaCl from 2000 w/WS to 1350' & Spote cmt plug @ 1147'. Circ CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff Hole marker and finish	rk). SEE RULE 110 his well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 10'. POOH w/WS & o surface. POOH w f surface pipe and o restoration of loc	Gervice Unit. Lo Tag CIBP @ 2 0.5 #/gal mud. W/ WS to 1000 mt plug w/2%C surface. POO SDON to WC W/WS & fill top haul all junk fr ation. Well is F	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W WOC. RIH w/CaCl. POOH w/W H w/WS to 900' 8 WC. RIH w/2 jts W of hole w/cmt. Reproduction. Fille P&A'd as of 9/23/2 te:	tach wellbore 7. Pressure te teze holes 12 7. 14 jts WS. S 7. WS & tag cr 8. to 500' & V 8. spot 45 sx (9. S & spot 10 s elease Servic d pit and rest 2008.	st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD	sig. Had slow BOP & TIH Class C cmt 880'. POOH //WS & tag plug w/2% of Class C to WOC for on. Set Dry
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Pure w/2% CaCl from 2000 w/WS to 1350' & Spote cmt plug @ 1147'. Circle CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff Hole marker and finish	rk). SEE RULE 110 his well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 10'. POOH w/WS & o surface. POOH w f surface pipe and o restoration of loc	Gervice Unit. Lotage CIBP @ 20.5 #/gal mud. W/ WS to 1000 Interpretation of the control of the	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W & WOC. RIH w/CaCl. POOH w/W to 900' 8 WC. RIH w/2 jts W of hole w/cmt. Reform location. Fille P&A'd as of 9/23/2 te:	trach wellbore 7. Pressure te teze holes 12 7. 14 jts WS. S 7. WS & tag cr 8 to 500' & W 8 spot 45 sx 0 8 spot 10 s 9 elease Service d pit and rest 2008.	st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD	sig. Had slow BOP & TIH Class C cmt 880'. POOH I/WS & tag I plug w/2% of Class C to WOC for on. Set Dry
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Pure w/2% CaCl from 2000 w/WS to 1350' & Spote cmt plug @ 1147'. Circle CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff Hole marker and finish	rk). SEE RULE 110 his well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 10'. POOH w/WS & o surface. POOH w f surface pipe and o restoration of loc	Gervice Unit. Lotage CIBP @ 20.5 #/gal mud. W/ WS to 1000 Interpretation of the control of the	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W WOC. RIH w/CaCl. POOH w/W H w/WS to 900' 8 WC. RIH w/2 jts W of hole w/cmt. Reproduction. Fille P&A'd as of 9/23/2 te:	trach wellbore 7. Pressure te teze holes 12 7. 14 jts WS. S 7. WS & tag cr 8 to 500' & W 8 spot 45 sx 0 8 spot 10 s 9 elease Service d pit and rest 2008.	st to 600 ps 83-90'. NUI 5pot 45 sx 0 nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD	sig. Had slow BOP & TIH Class C cmt 880'. POOH //WS & tag plug w/2% of Class C to WOC for on. Set Dry
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Pure w/2% CaCl from 2000 w/WS to 1350' & Spote cmt plug @ 1147'. Circ CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff Hole marker and finish. Spud Date: I hereby certify that the information and significant starting and starting and significant starting and star	ais well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 0'. POOH w/WS & o surface. POOH w f surface pipe and on restoration of loc	ervice Unit. Lotage CIBP @ 20.5 #/gal mud. w/ WS to 1000 mt plug w/2%C surface. POO SDON to WC w/WS & fill top haul all junk fration. Well is FRig Release Damplete to the bear TITLE Man	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W acl. POOH w/W tw/WS to 900' 8 acl. POOH w/2 its W of hole w/cmt. Reform location. Fille P&A'd as of 9/23/2 ite:	trach wellbore 7. Pressure te teze holes 12 7. 14 jts WS. S 7. WS & tag cr 8 to 500' & W 8 spot 45 sx 0 8 spot 10 s 9 elease Service d pit and rest 2008.	st to 600 ps 83-90'. NUI 5pot 45 sx C nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD ored location	sig. Had slow BOP & TIH Class C cmt 880'. POOH I/WS & tag plug w/2% of Class C to WOC for on. Set Dry
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Pure w/2% CaCl from 2000 w/WS to 1350' & Spote cmt plug @ 1147'. Circ CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff Hole marker and finish. Spud Date: I hereby certify that the information and significant starting and payid P. Sperits of the starting and proposed and propo	ais well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 0'. POOH w/WS & o surface. POOH w f surface pipe and on restoration of loc	Gervice Unit. Lotage CIBP @ 20.5 #/gal mud. W/ WS to 1000 Interpretation of the control of the	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W acl. POOH w/W tw/WS to 900' 8 acl. POOH w/2 its W of hole w/cmt. Reform location. Fille P&A'd as of 9/23/2 ite:	trach wellbore 7. Pressure te teze holes 12 7. 14 jts WS. S 7. WS & tag cr 8 to 500' & W 8 spot 45 sx 0 8 spot 10 s 9 elease Service d pit and rest 2008.	st to 600 ps 83-90'. NUI 5pot 45 sx C nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD ored location	sig. Had slow BOP & TIH Class C cmt 880'. POOH I/WS & tag I plug w/2% of Class C to WOC for on. Set Dry
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Pure w/2% CaCl from 2000 w/WS to 1350' & Spote cmt plug @ 1147'. Circ CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff Hole marker and finish. Spud Date: I hereby certify that the information and significant starting and starting and significant starting and star	is well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 0'. POOH w/WS & c surface. POOH w surface pipe and n restoration of loc	ervice Unit. Lo Tag CIBP @ 2 9.5 #/gal mud. W/ WS to 1000 mt plug w/2%C surface. POO SDON to WO W/WS & fill top haul all junk fration. Well is F Rig Release Da mplete to the be TITLE Man E-mail address	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W & WOC. RIH w/C. RIH w/C. RIH w/C. RIH w/2 jts W of hole w/cmt. Reform location. Fille P&A'd as of 9/23/2 te:	trach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr 8 to 500' & W 8 spot 45 sx 0 8 spot 10 s elease Servic d pit and rest 2008. The and belief. The and belief.	st to 600 ps 83-90'. NUI 5pot 45 sx C nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD ored location	sig. Had slow BOP & TIH Class C cmt 880'. POOH I/WS & tag plug w/2% of Class C to WOC for on. Set Dry
OTHER: 13. Describe proposed or complete of starting any proposed work or recompletion. To Plug & Abandon the leak, RU wireline & RI w/WS open ended. Pure w/2% CaCl from 2000 w/WS to 1350' & Spote cmt plug @ 1147'. Circ CaCl. From 800' to 90 w/2% CaCl from 63' to two days. Then Cutoff Hole marker and finish. Spud Date: I hereby certify that the information and significant starting and payid P. Sperits of the starting and proposed and propo	is well we MIRU S H w/ 3-1/8" HSC. mp & circ hole w/9 to 1900'. POOH v 100 sx Class C cr c 9.5 #/gal mud to 0'. POOH w/WS & c surface. POOH w surface pipe and n restoration of loc	ervice Unit. Lo Tag CIBP @ 2 9.5 #/gal mud. W/ WS to 1000 mt plug w/2%C surface. POO SDON to WO W/WS & fill top haul all junk fration. Well is F Rig Release Da mplete to the be TITLE Man E-mail address	ertinent details, and e Completions: At bad csg w/73 BW 598'. Perf 4 sque SDON. POOH w/W acl. POOH w/W tw/WS to 900' 8 acl. POOH w/2 its W of hole w/cmt. Reform location. Fille P&A'd as of 9/23/2 ite:	trach wellbore 7. Pressure te eeze holes 12 7 14 jts WS. S 7 WS & tag cr 8 to 500' & W 8 spot 45 sx 0 8 spot 10 s elease Servic d pit and rest 2008. The and belief. The and belief.	st to 600 ps 83-90'. NUI 5pot 45 sx C nt plau @ 1 VOC. RIH w Class C cmt sx cmt plug e Unit. SD ored location	sig. Had slow BOP & TIH Class C cmt 880'. POOH I/WS & tag plug w/2% of Class C to WOC for on. Set Dry



October 6, 2008

Mr. Ed Martin - Director New Mexico Oil Conservation Division District #4 1220 S. St. Francis Drive Santa Fe, NM 87505

Re:

Subsequent Report Form C-103

Lease Name:

Cat Head Mesa

Well No.:

Location:

Unit Letter "E"

1980' FNL & 660' FWL Sec 2-T04S-R09E Socorro County

Dear Mr. Martin:

Submitted in Triplicate is the Plugging & Abandonment Notice for the referenced well. All work has been completed on this well and the landowner is quite happy with our site restoration of this area. If you have any questions or need further data, please contact us at the address listed below.

Sincerely,

David P. Spencer

Manager of Regulatory Affairs

CC:

Bureau of Land Management, Socorro Field Office, Socorro, New Mexico Mr. Ben Donnegan, Representing Primero Energy, Roswell, New Mexico

The Carlo Community of the Artist Community Carlos Says (1997) and the first of the resident for the second second second the second of the register of the first of the first of the stability of the properties of the remaining of the section of the continuence of

TO STATE WESTERN

