## **SEQUENCE OF EVENTS**

Workover Objective: Add Blinebry perfs in order to inject into Blinebry

Date: Dec 8 – Dec 27, 2011

[Note: Paddock is squeezed off; only Tubb and Drinkard intervals are open prior to workover.]

Dec 8	Perf and Acidize Blinebry from 6134-6460 through selected intervals
Dec 9-12	Acid communicated to squeezed Paddock perfs and broke them down
	Set plug between Paddock & Blinebry and between Blinebry & Tubb
	Re-squeezed Paddock perfs
1	Drilled out cement and plug and noticed entire Blinebry interval was squeezed off; drilled out
	cement in Blinebry.
Dec 16	Re-perf Blinebry from 6178-6460 through selected intervals
	Acidized interval with 12-stage PPI (pin-point injection)
Dec 27	Drilled out plug over Tubb and noticed almost entire Tubb interval was squeezed off
	Drilled out cement in Tubb (no cement was in Drinkard)
	Test casing to 500 # and lost 40# in 20 min



Conditions of Approval (if any)

Submit 3 Copies To Appropriate District Office  State of New Mexico	Form C-103			
District I HOBBS OF Minerals and Natural Resources	June 19, 2008 WELL API NO.			
1625 N French Dr , Hobbs, NM 88240  District II	30-025-07767			
District III  District III  District III  District III	5. Indicate Type of Lease			
1000 Rio Brazos Rd , Aztec, NM 87410	STATE FEE X			
District IV 1220 S St. Francis Dr., Santa Fe, NM  RECEIVED	6. State Oil & Gas Lease No.			
87505				
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name			
DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)	BLANKENSHIP			
1. Type of Well: Dil Well Gas Well Other Office Off	8. Well Number <sub>002</sub>			
2. Name of Operator APACHE CORPORATION	9. OGRID Number 873			
3. Address of Operator	10. Pool name or Wildcat			
303 VETERANS AIRPARK LANE, STE 3000; MIDLAND, TX 79705	HOUSE; TUBB/DRINKARD/PADDOCK			
4. Well Location				
Unit Letter L : 2075 feet from the S line and 555	feet from the W line			
Section 12 Township 20S Range 38E	NMPM County LEA			
11. Elevation (Show whether DR, RKB, RT, GR, etc.)				
(1) (1) (1) (1) (1) (1) (1) (1) (1) (1)	International Court of Environment & Street Court Street Court Street			
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data				
NOTICE OF INTENTION TO: SUB	SEQUENT REPORT OF:			
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WOR	-			
TEMPORARILY ABANDON	LLING OPNS. P AND A			
PULL OR ALTER CASING	JOB			
DOWNHOLE COMMINGLE				
	bry Perfs to Tubb & Drinkard WIW pg 2 of 2			
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date				
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At	ach wellbore diagram of proposed completion			
or recompletion.				
12-16-11: DO CMT TO CBP @6480' CIRC CLEAN. ENTIRE BLINEBRY INTERVAL SQ 12-19-11: RIH W/CIBP SET @6478'. PERF BLINEBRY @6178-6180, 6182-6184, 6197	UEEZED DURING PADDOCK SQUEEZE. .6199 6204-6206 6234-6236 6290-6298			
6314-6320, 6324-6326, 6329-6331, 6333-6335, 6342-6344, 6346-6348, 6362-6364, 639	8-6400, 6411-6413, 6420-6422, 6425-6427,			
6458-6460. 3 STAGE PPI acid job w/LITTLE SUCCESS. NEW PPI TOOLS: STG 1 645	3-6460 BRK @4167#, STG 2 6420-6427 BRK			
BRK @200#, STG 7 6324-6335 BRK @3250#, STG 8 6314-6320 BRK @ 2975#, STG 9	@3340#, STG 3 6411-6413 BRK @4300#, STG 4 6398-6400 BRK @4100#, STG 5 6362-6364 BRK @3480#, 6TH STG 6342-6348 BRK @200#, STG 7 6324-6335 BRK @3250#, STG 8 6314-6320 BRK @ 2975#, STG 9 6290-6298 BRK @2575# STG10 6234-6236			
BROKE @ 4530#, STG 11 6197-6206 BRING UP 3500# w/NO BRK. START STG 12 6178-6184 BRING UP 3500# W/ NO BREAK.				
BROKE @ 4530#, 51G 11 6197-6208 BRING UP 3500# WIND BRA. START 51G 12 01	78-6184 BRING UP 3500# W/ NO BREAK.			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN, TSTD GOOD! POH LD PKR,PU BIT	78-6184 BRING UP 3500# W/ NO BREAK. * & 6 DC RIH DO CIBP @ 6478' RIH DO CBP			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. I	78-6184 BRING UP 3500# W/ NO BREAK. * & 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT O 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. I LOST 40# IN 20 MIN. BLED DWN CSG TO PIT. TST CSG TO 300#, LOST 30# IN 20 M	78-6184 BRING UP 3500# W/ NO BREAK. * & 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT O 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500 IN BLED CSG TO PIT. PKR @ 6076' LD &			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. I	78-6184 BRING UP 3500# W/ NO BREAK. * & 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT O 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500 IN BLED CSG TO PIT. PKR @ 6076' LD &			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. I LOST 40# IN 20 MIN. BLED DWN CSG TO PIT. TST CSG TO 300#, LOST 30# IN 20 M TEST CSG TO 500#, LOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to I	78-6184 BRING UP 3500# W/ NO BREAK. C& 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT O 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500 IN BLED CSG TO PIT. PKR @ 6076' LD &			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. I LOST 40# IN 20 MIN. BLED DWN CSG TO PIT. TST CSG TO 300#, LOST 30# IN 20 M	78-6184 BRING UP 3500# W/ NO BREAK. C& 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT O 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500 IN BLED CSG TO PIT. PKR @ 6076' LD &			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. I LOST 40# IN 20 MIN. BLED DWN CSG TO PIT. TST CSG TO 300#, LOST 30# IN 20 M TEST CSG TO 500#, LOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to I	78-6184 BRING UP 3500# W/ NO BREAK. * & 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT O 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500 IN BLED CSG TO PIT. PKR @ 6076' LD &			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. ILLOST 40# IN 20 MIN. BLED DWN CSG TO PIT. TST CSG TO 300#, LOST 30# IN 20 M TEST CSG TO 500#, LOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock 40 MIN. SD SI WELL. Check 40 MIN	78-6184 BRING UP 3500# W/ NO BREAK.  * & 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT TO 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500 IN BLED CSG TO PIT. PKR @ 6076' LD & njection Permit.			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. I LOST 40# IN 20 MIN. BLED DWN CSG TO PIT. TST CSG TO 300#, LOST 30# IN 20 M TEST CSG TO 500#, LOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to I	78-6184 BRING UP 3500# W/ NO BREAK.  * & 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT TO 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500 IN BLED CSG TO PIT. PKR @ 6076' LD & njection Permit.			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. ILLOST 40# IN 20 MIN. BLED DWN CSG TO PIT. TST CSG TO 300#, LOST 30# IN 20 M TEST CSG TO 500#, LOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock 40# IN 20 MIN. SD SI WELL. Check on adding Paddock 40# IN 20 MIN. SD SI WELL. Check on adding Paddock 40# IN 20 MIN. SD SI WELL. Check 40# IN 20 MIN. SD SI WEL	78-6184 BRING UP 3500# W/ NO BREAK.  * & 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT TO 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500 IN BLED CSG TO PIT. PKR @ 6076' LD & njection Permit.			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. ILLOST 40# IN 20 MIN. BLED DWN CSG TO PIT. TST CSG TO 300#, LOST 30# IN 20 M TEST CSG TO 500#, LOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILLOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock 40 MIN. SD SI WELL. Check 40 MIN	78-6184 BRING UP 3500# W/ NO BREAK.  * & 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT TO 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500 IN BLED CSG TO PIT. PKR @ 6076' LD & njection Permit.			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. ILL LOST 40# IN 20 MIN. BLED DWN CSG TO PIT. TST CSG TO 300#, LOST 30# IN 20 MIN TEST CSG TO 500#, LOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILL LOST 40# IN 20 MIN. SD SI WELL LO	78-6184 BRING UP 3500# W/ NO BREAK.  * & 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT TO 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500 IN BLED CSG TO PIT. PKR @ 6076' LD & njection Permit.  **and belief.**  **Y TECH DATE 02/07/2012*			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. ILOST 40# IN 20 MIN. BLED DWN CSG TO PIT. TST CSG TO 300#, LOST 30# IN 20 M TEST CSG TO 500#, LOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to I Rig Release Date:  Spud Date:  O9/01/1957  Rig Release Date:  TITLE SR. STAFF REGULATOR  Type or print name BEV HATFIELD  E-mail address: beverly hatfield@apact  For State Use Only	78-6184 BRING UP 3500# W/ NO BREAK.  * & 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT TO 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500 IN BLED CSG TO PIT. PKR @ 6076' LD & njection Permit.  **and belief.**  Y TECH DATE 02/07/2012  **thecorp com PHONE: 432-818-1906			
12-27-11 TSTD PADDOCK SQZ TO 500# - 30 MIN. TSTD GOOD! POH LD PKR,PU BIT @6480. CIRC CLEAN. TAG CMT @6517 TUBB PERF'S 6517-6762 BRK CIRC DO CM' CLEAN. RIH ON 188 JTS 2 7/8 IPC TBG. CIRC 130 BBLS PKR FL, SET PKR @ 6108. ILL LOST 40# IN 20 MIN. BLED DWN CSG TO PIT. TST CSG TO 300#, LOST 30# IN 20 MIN TEST CSG TO 500#, LOST 40# IN 20 MIN. SD SI WELL. Check on adding Paddock to ILL LOST 40# IN 20 MIN. SD SI WELL LO	78-6184 BRING UP 3500# W/ NO BREAK.  * & 6 DC RIH DO CIBP @ 6478' RIH DO CBP IT TO 6758'. RIH TAGGED UP @7015' CIRC RU CHART REC. LD & TST CSG TO 500 IN BLED CSG TO PIT. PKR @ 6076' LD & njection Permit.  **and belief.**  Y TECH DATE 02/07/2012  Thecorp com PHONE: 432-818-1906			