

Operator SWR Operating Co.
Well Featherstone #1
Unit K Section 5 Township 19 Range 31
API # 30-015-05744

T. Salt 820
B. Salt 2160
Yates 2435
Glorieta _____
Delaware _____
Bone Sp. _____
Abo _____
Wolfcamp _____
Morrow _____
Devonian _____
Fusselman _____
Other _____

← Perf 8 5/8" & 5 1/2" @ 60' Place 60' of cement
inside & outside of both csg. strings
0' - 60'

← Place 100' of cement inside & outside of
csg. 770' - 870' - TAG

← Perf csg @ 870'

← Place 100' of cement inside & outside of
csg. 2200' - 2300' - TAG

← Perf csg @ 2300'

32 — TOC @ 50%

← 25 SX Plug @ 3200' - TAG

1-2252-Perfs

CTBD 4 1/4" cement - 3-86

1-3486-Perfs

3715'

363 SX

7 7/8" hole

- Contact OCD 24 hrs. prior to any work done.
- Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug
- Install dry hole marker as per rule 202.B.2
- Plugs are to be set from point indicated up. Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- Surface plug will be from 0' - 60'
- Where plugs are required cement must be placed inside and outside of all casing string(s), in the correct footage or sacks required, if no cement exists.
- Plugs to be tagged will be indicated.

