

**APPLICATION FOR AUTHORIZATION TO INJECT
WEST AIRPORT FEDERAL COM #1**

Section IX. Proposed Stimulation Program:

Current Conditions:

Well open hole from bottom of 9 5/8" casing @ 2304' to top of cut off 7" casing @ 2396'. Well P&A'd w/ cement plugs from 10,950' to 10,800', 9650' to 9500', 8100' to 7850', 6350' to 6200', 4400' to 4250', 4167' to 4011', 2330' to 2250', and 15' to surface.

Proposed Completion:

1. Reenter wellbore, drill out surface plug and plug from 2250' to 2330'. Tag up on 7" stub @ 2396'.
2. Run in hole with Tension packer or Model R-3 Single Grip Compression Packer and set at 2250'. Establish rates.

Note: If necessary acidize w/ 2500 gallons 15% NeFe and displace w/ 2% KCL or formation water.

Optional: Frac w/ 20,000 gallons 30# gel w/ 60,000# 20/40 sand down 2 7/8" tubing. If frac necessary, pull tubing and change packer to Baker Fullbore.