



STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT
OIL CONSERVATION DIVISION
HOBBS DISTRICT OFFICE

TONY ANAYA
GOVERNOR


PLUGGING PROCEDURE

POST OFFICE BOX 1980
HOBBS, NEW MEXICO 88240
(505) 393-6161

RAPID COMPANY, INC.
Ranger Well No. 1-SWD
Unit H, 1980/N & 660/E, Section 15, T-12-S, R-34-E

Contractors will furnish tubing, mud, water and cement, and will construct pits as necessary. All plugs will be set through tubing.

1. Displace hole to mud -- all fluid to be displaced into pit and properly disposed of.
2. Set CIBP at 2770⁺ and dump 35' of cement over top of CIBP.
3. Set 100' plug inside of 8 5/8" casing at approximately 2100' (Top of Anhydrite)
4. Set 10 sack cap with regulation marker as prescribed by OCD Rules and Regulations.
5. Proper clean up will be made and all salvaged equipment will be moved to a place to be designated.
6. Return surface to as near normal conditions as possible.
7. All work will be supervised by an Oil Conservation Division Representative.

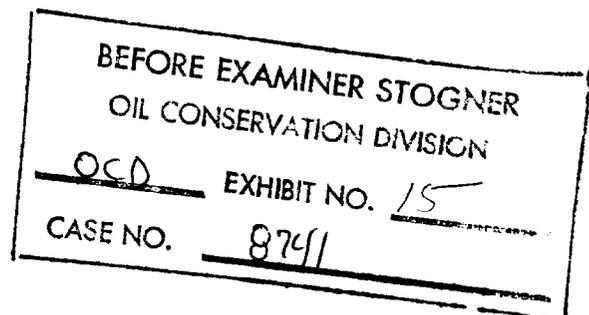

PRESUMED DOWNHOLE CONDITION

Ranger SWD Well No. 1-H
1980' FNL and 660' FEL of Section 15,
Township 12 South, Range 34 East,
Lea County, New Mexico

Well capped with 1/4" steel plate

13 3/8" casing set at 335' with 350 Sx of NGET
cement.
Hole size 17 1/2" cmt circ.

Perfs. 2802-2907

25 Sx Plug at 4183-4268'
8 5/8" casing set at 4225' cemented with
1700 Sx of cement.
Hole size 11" cmt. circ.

Total depth 12,940'

