District I - (575) 393-6161	State of N	THE COLUMN TWO IS NOT THE OWNER.	NMOCD-REC'D: 09/08	8/2020 Form C-103	
1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals ar	nd Natural Resources	WELL API NO.	Revised July 18, 2013	
District II – (575) 748-1283	OIL CONSERVATION DIVISION		30-015-30897		
811 S. First St., Artesia, NM 88210			5. Indicate Type of	of Lease	
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.		STATE 2		
District IV – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe,	NM 87505	6. State Oil & Gas VO-4861	s Lease No.	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH				7. Lease Name or Unit Agreement Name Sourthern Cross 20 State Com	
PROPOSALS.)	_	C-101) FOR SUCH	8. Well Number	1	
Type of Well: Oil Well Name of Operator	Gas Well Other		9. OGRID Numbe	or .	
Mack Energy Corporation			013837		
3. Address of Operator			10. Pool name or	10. Pool name or Wildcat	
P.O. Box 960 Artesia,NM 88210			Rio Penasco Wol	Rio Penasco Wolfcamp	
4. Well Location	1000 6 . 6 . 1	0 " 1 1	100 6 6	P. Una	
Unit Letter P:	feet from the		100 feet from the		
Section 20	Township 18S 11. Elevation (Show whee	Range 24E		ounty Eddy	
	11. Elevation (Show when	iner DR, KKD, KI, GK,	eic.)		
Local de la constant					
12. Check	Appropriate Box to Ind	icate Nature of Noti	ce, Report or Other	Data	
NOTICE OF I	NITENTION TO:		I IDSECTIENT DE	DORT OF:	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON x REMEDIAL WORK ALTERING CASING [
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ COMMENCE DRILLING OPNS.☐ P AND A					
PULL OR ALTER CASING		☐ CASING/CEN			
DOWNHOLE COMMINGLE					
CLOSED-LOOP SYSTEM]				
OTHER:		OTHER:	1.1 .1 .1.	1 1 1 1	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of					
	JORKI SEE KILLE 19 13 / 1	4 INIVIAL. FOR WILLIDIE	Completions. Attach w	TEILINGIE GIARIAIII OI	
		· · · · · · · · · · · · · · · · · · ·		onour angram	
proposed completion or re	ecompletion.				
proposed completion or re 1. 08/26/20 MIRU.	ecompletion. RIH w/ gauge ring on wireli	ine and tag CIBP with 3	5' cmt @ 6200'. 08/27/	20 RIH w/ bailer and	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @	ecompletion.	ine and tag CIBP with 3 I tag @ 6165'. POH. RI	5' cmt @ 6200'. 08/27/ H and set 4.5 CIBP @ 5	20 RIH w/ bailer and 495'. Circulate hole with	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @	ecompletion. RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme	ine and tag CIBP with 3 I tag @ 6165'. POH. RI ssure. Spot 25 sx cement ent @ 1763-1385. Perf	5' cmt @ 6200'. 08/27/ H and set 4.5 CIBP @ 5 t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1	20 RIH w/ bailer and 495'. Circulate hole with 0 Tagged cement @ 5045. 276-1176. WOC.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu	ecompletion. RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd	ine and tag CIBP with 3 It tag @ 6165'. POH. RI sure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 – s	5' cmt @ 6200'. 08/27/ H and set 4.5 CIBP @ 5 t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/2	20 RIH w/ bailer and 495'. Circulate hole with 0 Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu	ecompletion. RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme	ine and tag CIBP with 3 It tag @ 6165'. POH. RI sure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 – s	5' cmt @ 6200'. 08/27/ H and set 4.5 CIBP @ 5 t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/2	20 RIH w/ bailer and 495'. Circulate hole with 0 Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu	ecompletion. RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd	ine and tag CIBP with 3 It tag @ 6165'. POH. RI sure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 – s	5' cmt @ 6200'. 08/27/ H and set 4.5 CIBP @ 5 t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/2	20 RIH w/ bailer and 495'. Circulate hole with 0 Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu	ecompletion. RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A	ine and tag CIBP with 3 I tag @ 6165'. POH. RI sure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 – s Above Ground Dry Hole	5' cmt @ 6200'. 08/27/ H and set 4.5 CIBP @ 5 t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/2	20 RIH w/ bailer and 495'. Circulate hole with 0 Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu	ecompletion. RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme ag @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A	ine and tag CIBP with 3 I tag @ 6165'. POH. RI sure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 - s Above Ground Dry Hole of for plugging of well bore only. Lial of C-103 (Subsequent Report of Well	5' cmt @ 6200'. 08/27/2 H and set 4.5 CIBP @ 5 t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/2 e Marker". Back fill cells	20 RIH w/ bailer and 495'. Circulate hole with 0 Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu	ecompletion. RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme ag @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A	ine and tag CIBP with 3 I tag @ 6165'. POH. RI sure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 - s Above Ground Dry Hole	5' cmt @ 6200'. 08/27/2 H and set 4.5 CIBP @ 5 t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/2 e Marker". Back fill cells	20 RIH w/ bailer and 495'. Circulate hole with 0 Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu	ecompletion. RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme ag @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A	ine and tag CIBP with 3 I tag @ 6165'. POH. RI sure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 - s Above Ground Dry Hole of for plugging of well bore only. Lial of C-103 (Subsequent Report of Well	5' cmt @ 6200'. 08/27/2 H and set 4.5 CIBP @ 5 t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/2 e Marker". Back fill cells	20 RIH w/ bailer and 495'. Circulate hole with 0 Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu welder. Cut off wellh	ecompletion. RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A	ine and tag CIBP with 3 I tag @ 6165'. POH. RI sure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 – s Above Ground Dry Hole of for plugging of well bore only. Lial of C-103 (Subsequent Report of Well to Page under Forms, www.emnrd.s)	5' cmt @ 6200'. 08/27/2 H and set 4.5 CIBP @ 5 t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/2 e Marker". Back fill cells	20 RIH w/ bailer and 495'. Circulate hole with 0 Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu	ecompletion. RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A	ine and tag CIBP with 3 I tag @ 6165'. POH. RI sure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 - s Above Ground Dry Hole of for plugging of well bore only. Lial of C-103 (Subsequent Report of Well	5' cmt @ 6200'. 08/27/2 H and set 4.5 CIBP @ 5 t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/2 e Marker". Back fill cells	20 RIH w/ bailer and 495'. Circulate hole with 0 Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu welder. Cut off wellh	ecompletion. RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A	ine and tag CIBP with 3 I tag @ 6165'. POH. RI sure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 – s Above Ground Dry Hole of for plugging of well bore only. Lial of C-103 (Subsequent Report of Well to Page under Forms, www.emnrd.s)	5' cmt @ 6200'. 08/27/2 H and set 4.5 CIBP @ 5 t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/2 e Marker". Back fill cells	20 RIH w/ bailer and 495'. Circulate hole with 0 Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu welder. Cut off wellh	RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A Approver receipt o OCD wel	ine and tag CIBP with 3 it tag @ 6165'. POH. RI itsure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 – stable of the following of well bore only. Liai of C-103 (Subsequent Report of Well to Page under Forms, www.emnrd.stable of the Page under Forms, www.emnrd.stable elease Date:	5' cmt @ 6200'. 08/27/H and set 4.5 CIBP @ 5.1 t @ 5495-5112. 08/28/20 t @ 5495-5112. 08/28/20 t @ 5495-5112. 08/31/20 t @ Marker". Back fill cells to the control of the c	20 RIH w/ bailer and 495'. Circulate hole with 0 Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu welder. Cut off wellh	RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A Approver receipt o OCD wel	ine and tag CIBP with 3 it tag @ 6165'. POH. RI itsure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 – stable of the following of well bore only. Liai of C-103 (Subsequent Report of Well to Page under Forms, www.emnrd.stable of the Page under Forms, www.emnrd.stable elease Date:	5' cmt @ 6200'. 08/27/H and set 4.5 CIBP @ 5- t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/2 e Marker". Back fill cells billity under bond is retained pendin. Plugging) which may be found at tate.nm.us	20 RIH w/ bailer and 495'. Circulate hole with D Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu welder. Cut off wellh Spud Date:	RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A Approver receipt o OCD wet	ine and tag CIBP with 3 it tag @ 6165'. POH. RI issure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 - state of the control o	5' cmt @ 6200'. 08/27/H and set 4.5 CIBP @ 5- t @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/2 e Marker". Back fill cells billity under bond is retained pendin. Plugging) which may be found at tate.nm.us	20 RIH w/ bailer and 495'. Circulate hole with D Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu welder. Cut off wellh	RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A Approver receipt o OCD well Rig Re	ine and tag CIBP with 3 it tag @ 6165'. POH. RI issure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 - state of the control o	5' cmt @ 6200'. 08/27/H and set 4.5 CIBP @ 54 @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/20 Marker". Back fill cells polity under bond is retained pending Plugging) which may be found at tate.nm.us	20 RIH w/ bailer and 495'. Circulate hole with D Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu welder. Cut off wellh Spud Date: I hereby certify that the information SIGNATURE	RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A Approver receipt o OCD well Rig Re	ine and tag CIBP with 3 it tag @ 6165'. POH. RI issure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 - state of the control o	5' cmt @ 6200'. 08/27/H and set 4.5 CIBP @ 54 @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/20 Marker". Back fill cells polity under bond is retained pending Plugging) which may be found at tate.nm.us	20 RIH w/ bailer and 495'. Circulate hole with D Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu welder. Cut off wellh Spud Date:	RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A Approver receipt o OCD well Rig Re	ine and tag CIBP with 3 it tag @ 6165'. POH. RI issure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 - state of the control o	5' cmt @ 6200'. 08/27/H and set 4.5 CIBP @ 54 @ 5495-5112. 08/28/20 & Sqz 25 sx cement @ 1 surface. RDMO. 08/31/20 Marker". Back fill cells polity under bond is retained pending Plugging) which may be found at tate.nm.us	20 RIH w/ bailer and 495'. Circulate hole with D Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	
proposed completion or re 1. 08/26/20 MIRU. dump 35' cement @ mud laden fluid. Pres Spot 25 sx cement @ 08/31/20 Tagged plu welder. Cut off wellh Spud Date: I hereby certify that the information SIGNATURE Type or print name Jerry W.	RIH w/ gauge ring on wireli 6200 – 6165. RIH w/ tbg and sure up to 500 psi. Held pres 3820-3442. Spot 25 sx ceme g @ 1037'. Perf'd & Sqz'd ead and anchors. Installed "A Approver receipt o OCD well Rig Re	ine and tag CIBP with 3 it tag @ 6165'. POH. RI issure. Spot 25 sx cement ent @ 1763-1385. Perf & 40 sx cement @ 100 – stabove Ground Dry Hole of for plugging of well bore only. Liai of C-103 (Subsequent Report of Well to Page under Forms, www.emnrd.stable of the best of my known it to the best of my known it address:	5' cmt @ 6200'. 08/27/H and set 4.5 CIBP @ 5.1 @ 5495-5112. 08/28/20. Sqz 25 sx cement @ 1 surface. RDMO. 08/31/20. Marker". Back fill cells of the college	20 RIH w/ bailer and 495'. Circulate hole with D Tagged cement @ 5045. 276-1176. WOC. 20 Move in backhoe and ar and clean location.	