

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals, and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-021-20052

5. Indicate Type of Lease
STATE FEE

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name
BRAVO DOME CO2 GAS UNIT

1. Type of Well
OIL WELL GAS WELL OTHER CO2

2. Name of Operator
AMOCO PRODUCTION COMPANY

8. Well No.
1932-241G

3. Address of Operator
P.O. Box 303, AMISTAD, NEW MEXICO 88410

9. Pool name or Wildcat
BRAVO DOME CO2 GAS UNIT

4. Well Location
Unit Letter G : 1980 Feet From The North Line and 1980 Feet From The East Line
Section 24 Township 19N Range 32E NMPM Harding County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4690.9 GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work)
SEE RULE 1103.

10/26/99
MIRUSU, kill well with fresh water, NUBOP, release packer, lay down 2 3/8" production tubing and packer, run cast iron bridge plug with wireline, set CIBP at 2,266 feet, run workstring and tag CIBP at 2266 feet, shut down for crew days off.

11/1/99
Displace casing with fresh water and corrosion inhibitor, pressure test casing to 500 psi, ok. Cap CIBP with 5 sacks of Class C cement from 2266' - 2194', pull workstring to 1,870 feet, spot 10 sacks of cement from 1870' - 1726', pull workstring to 30 feet, spot 5 sacks of cement from 30' - 3', NDBOP, shut down due to high winds.

11/2/99
Cut off wellhead, install PXA marker, RDMOSU, cut off well anchors and clean location.

2/7/00
OK
Reg

I hereby certify that the information above is true and complete to the best of my knowledge and belief.
SIGNATURE DJ Holcomb TITLE Field Foreman DATE 11-4-99

TYPE OR PRINT NAME Danny J. Holcomb TELEPHONE NO. (505) 374-3010

(This space for State Use)
APPROVED BY [Signature] TITLE DISTRICT SUPERVISOR DATE 2/10/00

CONDITIONS OF APPROVAL, IF ANY