

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals, and Natural Resources Department

Form C-103
Revised 1-1-89

OIL CONSERVATION DIVISION

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

P.O. Box 2088

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

Santa Fe, New Mexico 87504-2088

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.

30-021-20072

5. Indicate Type of Lease

STATE ☐

FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

BRAVO DOME CO2 GAS UNIT

8. Well No.

1831-121F

9. Pool name or Wildcat

BRAVO DOME CO2 GAS UNIT

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well

OIL
WELL ☐

GAS
WELL ☐

OTHER

CO2

2. Name of Operator

AMOCO PRODUCTION COMPANY

3. Address of Operator

P.O. Box 303, AMISTAD, NEW MEXICO 88410

4. Well Location

Unit Letter F : 1980 Feet From The North Line and 1980 Feet From The West Line
Section 12 Township 18N Range 31E NMPM Harding County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4458 GR

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations

SEE RULE 1103.

(Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work)

7/7/2000

MIRUSU, kill well with fresh water, NUBOP, release packer, lay down production tubing and packer, SDON.

7/8/2000

Kill well with fresh water, run cast iron bridge plug with wireline, set CIBP at 2,104 feet, run workstring, tag CIBP at 2,104 feet, displace casing with corrosion inhibited fluid, pressure test casing to 500 psi, cap CIBP with 5 sacks of class C cement from 2140' - 2055', pull workstring to 1,716 feet, spot 10 sacks of cement from 1716' - 1618', pull workstring to 30 feet, fill casing with cement, NDBOP, RDMOSU, cut off wellhead, install PXA marker, cut off well anchors and clean location.

OK
8/17/00

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE D. J. Holcomb

TITLE Field Foreman

DATE 7-12-2000

TYPE OR PRINT NAME Danny J. Holcomb

TELEPHONE NO. (505) 374-3010

(This space for State Use)

APPROVED BY [Signature]

TITLE DISTRICT SUPERVISOR

DATE 8/18/00

CONDITIONS OF APPROVAL, IF ANY: