

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised May 08, 2003

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30.015.01556
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. 657
7. Lease Name or Unit Agreement Name: Empire Abo Unit 'C'
8. Well No. 40
9. OGRID Number 000778
10. Pool name or Wildcat Empire Abo

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
RECEIVED AUG 10 2004 OOD-ARTESIA	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator BP America Production Company	
3. Address of Operator P.O. Box 1089 Emice NM 88231	
4. Well Location Unit Letter I : 1650 feet from the S line and 660 feet from the E line Section 26 Township 17S Range 28E NMPM County EDDY	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3656' GR	

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

TD: 6317' PED: 6222' PERFS: 5674-6210'

05.13.04: MIRUPU. UNHANG WELL. RU AND HOT OIL ON CSG.
05.14.04: POH & LD RODS. NDWH. UNSET TAC. NUBOP. START POH W/RODS.
05.15.04: FINISH POH W/RODS & TBG WHILE HOT OILING TBG TO CLEAN OUT PARAFFIN.
05.18.04: RIH W/BIT & SCRAPER. TAG BOTTOM @ 6222'. POH.
05.19.04: RUWL & RIH W/GADGE RING. POH. RIH W/PLUG & SET @ 6032'. RDWL. RIH & SET SN @ 5984'.
LOAD & TEST CSG TO 500# PSI. HOLDING GOOD. RU SWAB.
05.20.04: MAKE 26 SWAB RUNS. LEFT FL @ 5750'.
05.24.04: RUWL & LOG WELL.
05.25.04: RIH W/PERF GUN & PERF WELL @ 5676 - 5985'. 20 HOLES. RIH W/CIBP. SET @ 6017'. PU
SWAB & TAG FL @ 5675'. DROP SV.
05.26.04: RIH W/SWAB & TAG FL @ 5800'. (OVER)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kellie D. Murrish TITLE Staff Support DATE 04.01.04

Type or print name Kellie D. Murrish Telephone No. 505.394.1649

(This space for State use)

APPROVED BY FOR RECORDS ONLY TITLE DATE AUG 11 2004
Conditions of approval, if any:

05.27.04: RU TUBING TESTERS. RIH W/PKR, SN & TBG. TEST TBG IN HOLE TO 5556'. SET PKR. RU ACID TRUCKS & ACIDIZE PERFS W/4000 GALS 15% HCL. . OPEN TBG TO TEST TANK & FLOW BACK 10 BBLS FOR 20 MINS.

05.28.04: RIH W/SWAB. TAG FL @ 2500'. UNSET PKR. RIH W/TBG TO 6017'. KNOCK DOWN FRAC BALLS. POH TO ABOVE PERFS @ 5678'. LEAVE PKR HANGING. RIH W/SWAB. TAG FL @ 5200'. DROP SV. RIH W/SWAB & TAG FL @ 5250'. SWAB & TAG FL F/06.01.04 – 06.02.04.

06.03.04: IRH W/FISHING TOOL & SAND LINE. FISH SV. POH. PU SANDLINE DRILL & RIH TO KNOCK DOWN ON PLUG F/6032' TO 6222'. POH.

06.04.04: RIH W/PROD. ASSY. SET 2-3/8" TBG @ 6194' SN @ 62.04'. NDBOP. SET TAC. NUWH. RTP. IN 24 HRS WELL PROD. 9.4 MCF, 15 BO, 61.5 BW.