

Oil Cons.
N.M. DIV-Dist. 2
UNITED STATES 1301 W. Grand Avenue
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Alamosa, NM 88210

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

Oil Well ☐ Gas Well ☒ Other ☐

2. Name of Operator

STRATA PRODUCTION COMPANY

3. Address and Telephone No.

P. O. Box 1030
Roswell, New Mexico 88202-1030
505-622-1127

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1980' FSL and 1980' FWL
Section 14-16S-30E

5. Lease Designation and Serial No.

NM - 11327

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

20-015-22748

8. Well Name and No.

Norman Federal

9. API Well No.

#1

10. Field and Pool, or Exploratory Area

Henshaw Q-G-SA

11. County or Parish, State

Eddy

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log Form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

03/20/03: Notify OCD. MIRU. Kill well w/30 bbls brine. NUBOP. POOH w/81 jnts 2 3/8" tbg. RIH w/5 1/2" CIBP & set @ 2200'. Dump 35' cmt on top. SI.

03/21/03: RIH w/tbg. Mix 10# mud. POOH. NDWH. Weld on pull nipple. Csg was parted. Called BLM. POOH w/csg 451'. RIH & perf @ 1400'. RIH w/tbg & stack out @ 1051'. Call BLM. RIH & perf @ 1007' thru tbg. Spot 25 sxs @ 1007'. POOH. SI.

03/24/03: RIH & tag @ 976'. Reset plug w/25 sxs @ 976' - 700'. POOH. RIH & attempt to perf. POOH. RIH w/tbg to 478'. Perf thru tbg @ 501'. Lower tbg & spot 35 sxs @ 501'. POOH. WOC. RIH & tag @ 311'.

03/27/03: Spot 15 sxs @ 30' to surface. Dig out & cut off wellhead & anchors. RD. Install dry hole marker.

Received as to plugging of the well bore.
Liability under bond is retained until
surface restoration is completed.

APPROVED

APR 22 2003

14. I hereby certify that the foregoing is true and correct.

Signed

Title

Production Records

Date

04/21/03

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any: