Submit 1 Copy To Appropriate District Office	State of New Mexico	Form C-103
District I – (575) 393-6161	Energy, Minerals and Natural Resou	rces Revised August 1, 2011
1625 N. French Dr., Hobbs, NM 88240		WELL API NO.
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION	ON 30-015-41090 5 Indicate Type of Legge
<u>District III</u> – (505) 334-6178	1220 South St. Francis Dr.	5. Indicate Type of Lease STATE FEE FEE
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460	Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM	,	o. State on & Gas Boase 110.
87505	ICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
1	DSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO	,
DIFFERENT RESERVOIR. USE "APPL	ICATION FOR PERMIT" (FORM C-101) FOR SUCH	JOSEY WALES 16 STATE COM
PROPOSALS.) 1. Type of Well: Oil Well	Gas Well Other	8. Well Number 3H
2. Name of Operator	Gas Well Guiel	9. OGRID Number
Devon Energy Production Compa	nv. L.P.	6137
3. Address of Operator		10. Pool name or Wildcat
333 W. Sheridan Avenue, Oklah	oma City, Oklahoma 73102-5010 (405) 53	52-7848 Wildcat G-02 S2427030; BONE SPRING
4. Well Location		
Unit Letter O	: 150 feet from the S line	and 1980 feet from the E line
Section 16	Township 24S Range 2	7E NMPM Eddy County, New Mexico
100	11. Elevation (Show whether DR, RKB, RT,	
	3206.4'	
12. Check	Appropriate Box to Indicate Nature of	Notice, Report or Other Data
NOTICE OF I	ALTERITION TO:	CURCEOUENT DEPORT OF
	NTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK TEMPORARILY ABANDON	-	AL WORK ☐ ALTERING CASING ☐ NCE DRILLING OPNS.☐ P AND A ☐
PULL OR ALTER CASING		/CEMENT JOB
DOWNHOLE COMMINGLE		JOEMEN TOO
OTHER:		Completion Report
13. Describe proposed or com	pleted operations. (Clearly state all pertinent d	etails, and give pertinent dates, including estimated date
13. Describe proposed or com of starting any proposed w	pleted operations. (Clearly state all pertinent d ork). SEE RULE 19.15.7.14 NMAC. For Mu	
13. Describe proposed or com	pleted operations. (Clearly state all pertinent d ork). SEE RULE 19.15.7.14 NMAC. For Mu	etails, and give pertinent dates, including estimated date
13. Describe proposed or com of starting any proposed w proposed completion or re	pleted operations. (Clearly state all pertinent dyork). SEE RULE 19.15.7.14 NMAC. For Mucompletion.	etails, and give pertinent dates, including estimated date
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 - 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min.	pleted operations. (Clearly state all pertinent d/ork). SEE RULE 19.15.7.14 NMAC. For Mu completion. 1 & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged D	etails, and give pertinent dates, including estimated date ltiple Completions: Attach wellbore diagram of
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WH	pleted operations. (Clearly state all pertinent d/ork). SEE RULE 19.15.7.14 NMAC. For Mu completion. 1 & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged D	etails, and give pertinent dates, including estimated date litiple Completions: Attach wellbore diagram of DV Tool @ 4,522'; DO DV Tool and run down to 4,532'.
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun.	pleted operations. (Clearly state all pertinent d/ork). SEE RULE 19.15.7.14 NMAC. For Muccompletion. 1 & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Econt. RIH and tagged @ 12,018, CO to 12,022; circles.	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of DV Tool @ 4,522'; DO DV Tool and run down to 4,532'. c. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g	pleted operations. (Clearly state all pertinent d/ork). SEE RULE 19.15.7.14 NMAC. For Mu completion. 1 & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Econt. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 light.	etails, and give pertinent dates, including estimated date litiple Completions: Attach wellbore diagram of DV Tool @ 4,522'; DO DV Tool and run down to 4,532'.
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30	pleted operations. (Clearly state all pertinent d/ork). SEE RULE 19.15.7.14 NMAC. For Mu completion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged E. Cont. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 is SiberProp, & 41,531 bbls Slick water. Set kill plug	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a V Tool @ 4,522'; DO DV Tool and run down to 4,532'. c. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @ holes. POOH. Frac 12 stages w/2,470,164# 20/40 Sand, @ 6,000' & TOOH. SWI. RD & release frac crew and WL.
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow	pleted operations. (Clearly state all pertinent d/ork). SEE RULE 19.15.7.14 NMAC. For Mu completion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged E. Cont. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 is SiberProp, & 41,531 bbls Slick water. Set kill plug	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of DV Tool @ 4,522'; DO DV Tool and run down to 4,532'. c. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @ holes. POOH. Frac 12 stages w/2,470,164# 20/40 Sand,
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30	pleted operations. (Clearly state all pertinent d/ork). SEE RULE 19.15.7.14 NMAC. For Mu completion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged E. Cont. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 is SiberProp, & 41,531 bbls Slick water. Set kill plug	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a V Tool @ 4,522'; DO DV Tool and run down to 4,532'. c. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @ holes. POOH. Frac 12 stages w/2,470,164# 20/40 Sand, @ 6,000' & TOOH. SWI. RD & release frac crew and WL.
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow	pleted operations. (Clearly state all pertinent d/ork). SEE RULE 19.15.7.14 NMAC. For Mu completion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged E. Cont. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 is SiberProp, & 41,531 bbls Slick water. Set kill plug	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a V Tool @ 4,522'; DO DV Tool and run down to 4,532'. c. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @ holes. POOH. Frac 12 stages w/2,470,164# 20/40 Sand, @ 6,000' & TOOH. SWI. RD & release frac crew and WL.
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure.	pleted operations. (Clearly state all pertinent dyork). SEE RULE 19.15.7.14 NMAC. For Muccompletion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Econt. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 to SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a V Tool @ 4,522'; DO DV Tool and run down to 4,532'. C. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @ holes. POOH. Frac 12 stages w/2,470,164# 20/40 Sand, @ 6,000' & TOOH. SWI. RD & release frac crew and WL. 94'; circ. sweep and POOH w/CTU. RU flowback and opened
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure.	pleted operations. (Clearly state all pertinent dyork). SEE RULE 19.15.7.14 NMAC. For Muccompletion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Econt. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 to SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a V Tool @ 4,522'; DO DV Tool and run down to 4,532'. c. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @ holes. POOH. Frac 12 stages w/2,470,164# 20/40 Sand, @ 6,000' & TOOH. SWI. RD & release frac crew and WL. 94'; circ. sweep and POOH w/CTU. RU flowback and opened landed tbg @ 7,207'; intake @ 6,834'. Turn well over to
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure. 8/22/13 – 8/26/13 - MIRU PU. ND fra	pleted operations. (Clearly state all pertinent dyork). SEE RULE 19.15.7.14 NMAC. For Muccompletion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Econt. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 to SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a V Tool @ 4,522'; DO DV Tool and run down to 4,532'. C. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @ holes. POOH. Frac 12 stages w/2,470,164# 20/40 Sand, @ 6,000' & TOOH. SWI. RD & release frac crew and WL. 94'; circ. sweep and POOH w/CTU. RU flowback and opened
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure. 8/22/13 – 8/26/13 - MIRU PU. ND fra	pleted operations. (Clearly state all pertinent dyork). SEE RULE 19.15.7.14 NMAC. For Muccompletion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Econt. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 to SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a V Tool @ 4,522'; DO DV Tool and run down to 4,532'. c. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @ holes. POOH. Frac 12 stages w/2,470,164# 20/40 Sand, @ 6,000' & TOOH. SWI. RD & release frac crew and WL. 94'; circ. sweep and POOH w/CTU. RU flowback and opened landed tbg @ 7,207'; intake @ 6,834'. Turn well over to RECEIVED
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure. 8/22/13 – 8/26/13 - MIRU PU. ND fra	pleted operations. (Clearly state all pertinent dyork). SEE RULE 19.15.7.14 NMAC. For Muccompletion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Econt. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 to SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a V Tool @ 4,522'; DO DV Tool and run down to 4,532'. c. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @ holes. POOH. Frac 12 stages w/2,470,164# 20/40 Sand, @ 6,000' & TOOH. SWI. RD & release frac crew and WL. 94'; circ. sweep and POOH w/CTU. RU flowback and opened landed tbg @ 7,207'; intake @ 6,834'. Turn well over to
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure. 8/22/13 – 8/26/13 - MIRU PU. ND fra	pleted operations. (Clearly state all pertinent dyork). SEE RULE 19.15.7.14 NMAC. For Muccompletion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Econt. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 to SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a V Tool @ 4,522'; DO DV Tool and run down to 4,532'. c. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @ holes. POOH. Frac 12 stages w/2,470,164# 20/40 Sand, @ 6,000' & TOOH. SWI. RD & release frac crew and WL. 94'; circ. sweep and POOH w/CTU. RU flowback and opened landed tbg @ 7,207'; intake @ 6,834'. Turn well over to RECEIVED
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure. 8/22/13 – 8/26/13 - MIRU PU. ND fra production; well test.	pleted operations. (Clearly state all pertinent d/ork). SEE RULE 19.15.7.14 NMAC. For Mu completion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Econt. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 to SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09 to sleeve, NU BOP; PU & RIH w/2-7/8" tbg & ESP;	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a V Tool @ 4,522'; DO DV Tool and run down to 4,532'. c. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @ holes. POOH. Frac 12 stages w/2,470,164# 20/40 Sand, @ 6,000' & TOOH. SWI. RD & release frac crew and WL. 94'; circ. sweep and POOH w/CTU. RU flowback and opened landed tbg @ 7,207'; intake @ 6,834'. Turn well over to RECEIVED OCT 1 0 2013
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure. 8/22/13 – 8/26/13 - MIRU PU. ND fra production; well test.	pleted operations. (Clearly state all pertinent dyork). SEE RULE 19.15.7.14 NMAC. For Muccompletion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Econt. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 to SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a V Tool @ 4,522'; DO DV Tool and run down to 4,532'. c. 420 bbls KCL. POOH. RU WL & run RCBL (TOC @ holes. POOH. Frac 12 stages w/2,470,164# 20/40 Sand, @ 6,000' & TOOH. SWI. RD & release frac crew and WL. 94'; circ. sweep and POOH w/CTU. RU flowback and opened landed tbg @ 7,207'; intake @ 6,834'. Turn well over to RECEIVED OCT 1 0 2013
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure. 8/22/13 – 8/26/13 - MIRU PU. ND fra production; well test.	pleted operations. (Clearly state all pertinent d/ork). SEE RULE 19.15.7.14 NMAC. For Mu completion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Econt. RIH and tagged @ 12,018', CO to 12,022'; circles and perf intervals from 7,466' – 12,021' w/ 360 to SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09 to sleeve, NU BOP; PU & RIH w/2-7/8" tbg & ESP;	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a completions: Attach wellbore diagram of a completions: Attach wellbore diagram of a complete completions: Attach wellbore diagram of a complete co
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure. 8/22/13 – 8/26/13 - MIRU PU. ND fra production; well test.	pleted operations. (Clearly state all pertinent dyork). SEE RULE 19.15.7.14 NMAC. For Mulcompletion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Decent. RIH and tagged @ 12,018', CO to 12,022'; circle and perf intervals from 7,466' – 12,021' w/ 360 by SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09 c sleeve, NU BOP; PU & RIH w/2-7/8" tbg & ESP; TITLE_Regulatory Specific and some strue and complete to the best of my labore is true and complete to the labore is true and complete to the best of my labore is true and complete to the	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a completion and a completion
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure. 8/22/13 – 8/26/13 - MIRU PU. ND fra production; well test.	pleted operations. (Clearly state all pertinent dyork). SEE RULE 19.15.7.14 NMAC. For Mulcompletion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Decent. RIH and tagged @ 12,018', CO to 12,022'; circle and perf intervals from 7,466' – 12,021' w/ 360 by SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09 c sleeve, NU BOP; PU & RIH w/2-7/8" tbg & ESP; TITLE_Regulatory Special complete to the best of my labove is true and compl	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a completion and a completion
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure. 8/22/13 – 8/26/13 - MIRU PU. ND fra production; well test.	pleted operations. (Clearly state all pertinent dyork). SEE RULE 19.15.7.14 NMAC. For Mulcompletion. It & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Decent. RIH and tagged @ 12,018', CO to 12,022'; circle and perf intervals from 7,466' – 12,021' w/ 360 by SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09 c sleeve, NU BOP; PU & RIH w/2-7/8" tbg & ESP; Tabove is true and complete to the best of my land address:david.complete	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a completion and a completion
13. Describe proposed or com of starting any proposed w proposed completion or re 7/23/13 – 7/25/13 - MIRU PU, ND WF CHC and PT csg @ 1,500psi/15min. C 1,686'. RDWL; TIH w/TCP gun. 7/26/13 – 8/1/13 - Finish TIH w/TCP g 37,165 gals 15% HCL, 519,497# 16/30 8/4/13 – 8/17/13 – MIRU CTU & flow to flowback. Well died. SWI. 8/18/13 – 8/21/13 – Monitor pressure. 8/22/13 – 8/26/13 - MIRU PU. ND fra production; well test.	pleted operations. (Clearly state all pertinent dyork). SEE RULE 19.15.7.14 NMAC. For Mulcompletion. A & NU BOP. PU 4-3/4" bit & tbg; TIH & tagged Decent. RIH and tagged @ 12,018', CO to 12,022'; circle and perf intervals from 7,466' – 12,021' w/ 360 by SiberProp, & 41,531 bbls Slick water. Set kill plug back equipment. DO kill plug & frac plugs to 12,09 c sleeve, NU BOP; PU & RIH w/2-7/8" tbg & ESP; TITLE_Regulatory Specific and some strue and complete to the best of my labore is true and complete to the labore is true and complete to the best of my labore is true and complete to the	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a completion and a completion