	1	OCD Artesia								
	Form 3160-5 (August 2007) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010 5. Lease Serial No.				
						NMNM16104				
						6. If Indian, Allottee or Tribe Name				
	SUBMIT IN TRIPLICATE - Other instructions on reverse side.					7. If Unit or CA/Agreement, Name and/or No.				
	I. Type of Well Gas Well Other					8. Well Name and No. MALAGA 13 DM FEDERAL COM 1H				
	2. Name of Operator MEWBOURNE OIL COMPAN	HAN	y	9. API Well No. 30-015-41556-00-X1						
	. F			. (include area code 3-5905)	10. Field and Pool, or Exploratory WILLOW LAKE				
	HOBBS, NM 88241 Fx: 4. Location of Well (Footage, Sec., T., R., M., or Survey Description)			x: 575-397-6252		11. County or Parish, and State				
	Sec 12 T25S R28E SWSW 3 32.081726 N Lat, 104.024250	00FSL 1170FWL	φπου)			EDDY COUNTY, NM				
	12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA									
	TYPE OF SUBMISSION		TYPE OF ACTION							
	□ Notice of Intent							Water Shut-Off		
	🛛 Subsequent Report	□ Alter Casing □ Casing Repair	 New Construction Recor Plug and Abandon Temp 		 Reclamation Recomplete 		☐ wen megnty ☑ Other	 Well Integrity Other 		
	Final Abandonment Notice	Change Plans			□ Tempor □ Water I	arily Abandon Disposal	Well Spud			
	13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)									
	10/29/13 Spud 17 1/2" hole. TD hole @ 405'. Ran 405' of 13 3/8" 48# H40 ST&C csg. Cemented with 450 sks Class C w/2% CaCl2. Mixed @ 14.8 #/g w/1.35 yd. Plug down @ 11:45 AM 10/30/13. Tested BOPE & anular to 1500#. At 1:15 P.M. 10/31/13, tested csg to 1250# for 30 minutes, held OK. Circ 107 sks of cement to pit.									
	Chart & schematic attached.			(RD)	12/17/12		DEIVED	1		
	Bonds on file: NM1693 nationwide & NMB000919			Accepted for Acchie NNIBCD		DEC 17 2013				
	14. I hereby certify that the foregoing is true and correct. Electronic Submission #228566 verified by the BLM Well Information System									
	For MEWBOURNE OIL COMPANY, sent to the Carlsbad Committed to AFMSS for processing by JOHNNY DICKERSON on 12/12/2013 (14JLD1713SE)									
	Name (Printed/Typed) JACKIE I	LATHAN		Title AUTHC	ORIZED REF	PRESENTATIVE				
	Signature (Electronic Submission) Date 12/04/2013									
	THIS SPACE FOR FEDERAL OR STATE OFFICE USE									
	Approved By ACCEPT	ED		JAMES A TitleSUPERVI			Date 12/15	<u>5/2013</u>		
	Conditions of approval, if any, are attach certify that the applicant holds legal or ex which would entitle the applicant to conc	quitable title to those rights in the		Office Carlsba	d					
	Title 18 U.S.C. Section 1001 and Title 4 States any false, fictitious or fraudulent	3 U.S.C. Section 1212, make it a t statements or representations as	crime for any p to any matter w	erson knowingly and vithin its jurisdiction	l willfully to m	ake to any department or	agency of the United			
		¹				· · ·				

** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **

4

•

, C	NAN WELDING SERVICES, M	х х
	North Stranger	
	MAL	24 1
and a start		** ** **
,		2
Con	npany Meu/borneDateDate	
Leas	se Malacle 15 County Edily NM	
j	n te na set e presentation per la set parte de la set e construir de la set e presentation de la set de la set A de la set	UB all
Dril	ling Contractor 14 Her Soc Ub Plug & Drill Pipe Size 12 L-22-	<u>1-1-2×14</u>
	Accumulator Function Test - OO&GO#2	ч с
То С	Check - USABLE FLUID IN THE NITROGEN BOTTLES (III.A.2.c.i. or ii or iii)	
. : _ :**		
	 Make sure all rams and annular are open and if applicable HCR is closed. Ensure accumulator is pumped up to working pressure! (Shut off all pumps) 	т. Т.
a superior	· Ensure accumulator is pumped up to working pressure: (Shut on, an pumps)	
	1. Open HCR Valve. (If applicable)	، ۴.
	2. Close annular.	
· · · ·	3. Close all pipe rams.	*3
۰۰ ۲	4. Open one set of the pipe rams to simulate closing the blind ram.	a ta star a
	5. For 3 ram stacks, open the annular to achieve the 50+ % safety factor. (5M and greater	systems).
	6. Record remaining pressure 1294 psi. Test Fails if pressure is lower than requi	ired.
, 8	a {950 psi for a 1500 psi system} b. {1200 psi for a 2000 & 3000 psi system }	. ¹⁴ 1. ••
	7. If annular is closed, open it at this time and close HCR.	
ТоС	Theck - PRECHARGE ON BOTTLES OR SPHERICAL (III.A.2.d.)	1
LU, C	SHEER - A RECHARGE ON DOI IDES ON SI HERICAE (III.A.Z.U.)	* .
	Start with manifold pressure at, or above, maximum acceptable pre-charge pressure:	
	a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system}	
		e e Charles e Ch
	1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pre-	ssure)
	2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps i	ip to.
·	3. Record pressure drop <u>675</u> psi. Test fails if pressure drops below minimum.	
* °©	Minimum: a. {700 psi for a 1500 psi system } b. {900 psi for a 2000 & 3000 psi system	n}
		· · · · ·
1		
То С	Check - THE CAPACITY OF THE ACCUMULATOR PUMPS (III.A.2.f.)	
0	Isolate the accumulator bottles or spherical from the pumps & manifold.	
•	Open the bleed off valve to the tank, {manifold psi should go to 0 psi} close bleed valve.	
•	1 Open the HCP value (if applicable)	
	 Open the HCR valve, {if applicable} Close annular 	
,	2. Close annular 3. With pumps only, time how long it takes to regain the required manifold pressure.	
	 4. Record elapsed time 1. 7.56. Test fails if it takes over 2 minutes. 	
6	a. $\{950 \text{ psi for a } 1500 \text{ psi system}\}$ $\{1200 \text{ psi for a } 2000 \& 3000 \text{ psi system}\}$	
~	a (see por tor a rece por system) and par for a zooo to sooo par system)	
	and the second	

WELDING • BOP TESTING 7 NIPPLE UP SERVICE . BOP LIFTS . TANL MUD AND GAS SEPARATORS of > WELDING SERVICES Pg, ____ Lovington, NM . 575-398-4540 Company: Mew DUME Date: 10 11 im COM Drilling Contractor: Rig Lease: Drill Pipe Size Plug Size & Type: Required BOP: installed BOP * Check Valve Must Be Open/Disabled To Test Kill Line Valves * *Appropriate Casing Valvo Must Be Open During BOP Test * #26 ------Dart Valve #19 0 0 0 0 0 0 Stand Pipe Valve Kelly/ #24 Annular #15 Тор ເປົ້າ Drive - Th MANDADO m #22 #23 tiw Pipe Rams #12 IBOP Valve -----248 #3 #18 â17 Blind Rams #13 #8B Manual 1600 Mud Gauge IBOP **OTTAN** Pump Valve Valve **Pump Valve** #16 #20 #21 #11 #10 #9 .#7 #8 #25 Pipe Rams #14 Super Choke Casing. Ł TEST TEMS TESTED TEST LENGTH LOW PSI HIGH PSI - REMARKS : "Ì \mathcal{I} \mathcal{N} win D-10 40 (7).... ? 20 0 10 A 175 217 \mathcal{L}_{j} r.\$.9 Į. · * 14 ; 1. 1. 1. ۰ ۲ Ŀ. 3 A. ٠, , re έ. : • • 1 è ۰. J. . . - 10 . r Š



