Form 3160-5 (August 2007)

OCD Artesia

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

	OMIDIN	O. 10	$\nu \tau$	UI.
	Expires:	July	31,	20
Lease Seri	al No			

SUNDRY NOTICES AND REPORTS ON WELLS

NINANIA ACCOTTO	
NMNM60773	
11/1/1/1/100770	

Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.			6. If India	6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRI	PLICATE - Other instructions on re	verse side.	7. If Unit	or CA/Agreement, Nan	ne and/or No.	
Type of Well Oil Well Gas Well	ner: INJECTION	<u> </u>		ame and No. RAL AZ 1		
Name of Operator RKI EXPLORATION & PROD	Contact: JODY NOE UCTIONE-Mail: jnoerdlinger@rkixp.com	RDLINGER	9. API W 30-01	ell No. 5-23324		
3a. Address 210 PARK AVE. SUITE 900 OKLAHOMA CITY, OK 7310	Ph: 405-9	o. (include area code 96-5774) 10. Field UNDE	and Pool, or Explorator ESIGNATED	y .	
4. Location of Well (Footage, Sec., 7	., R., M., or Survey Description)		11. Count	y or Parish, and State		
Sec 29 T26S R30E Mer NMP	NESE 2080FSL 660FEL		EDDY	COUNTY, NM		
12. CHECK APPI	ROPRIATE BOX(ES) TO INDICAT	E NATURE OF I	NOTICE, REPORT, C	OR OTHER DATA		
TYPE OF SUBMISSION		ТҮРЕ О	F ACTION	• .		
Notice of Intent	☐ Acidize ☐ De	epen	☐ Production (Start/F	Resume) 🔲 Wat	er Shut-Off	
	☐ Alter Casing ☐ Fra	cture Treat	■ Reclamation	□ Wel¹	l Integrity	
☐ Subsequent Report	☐ Casing Repair ☐ Ne	w Construction	□ Recomplete	□ Othe	er .	
☐ Final Abandonment Notice	🗖 Change Plans ' 🔀 Plu	g and Abandon	□ Temporarily Aband	don		
	Convert to Injection . 🗖 Plu	g Back	■ Water Disposal			
determined that the site is ready for f RKI Exploration and Production the Delaware from 3,555 fe Proposed procedures: Pump 300 sacks Class C cem CIBP at 3,275 feet. Pump 25 With tubing in hole at 2,450 fe Minimum TOC plug at 2,350 fe With tubing in hole at 1,050 fe Minimum TOC plug at 900 feet With tubing in hole at 150 feet circulate to surface.	on seeks approval to plug the subject et to 4,480 feet. nent for plug from 3,475 feet to 4,480 feets Class C cement. Circulate hole et, pump 50 sacks Class C cement. Seet. et, pump 80 sacks Class C cement. Set. pump 50 sacks Class C cement from the feet above ground level, set 4 inches	eet. Flush with he with he with heavy mud. what down for 4 he hat down for 4 he as 150 feet to 150 feet	eavy mud. Set ONE purs. Tag plug. Set ours. Tag plug. Set, and clean	ATTACHED F DITIONS OF A	OR APPROVAL	
14. I hereby certify that the foregoing is	true and correct.	NMOCD	NI NI	W OIL CONSE		
	Electronic Submission #244409 verifie For RKI EXPLORATION & PRO Committed to AFMSS for processing	PUCTION , sent to	the Carlsbad	ARTESIA DISTI		
Name(Printed/Typed) JODY NC	DERDLINGER	Title REGUL	ATORY ANALYST	JUN 0 2 21	J14	
Signature (Electronic S		Date 05/05/2		RECEIVE	D	
	THIS SPACE FOR FEDERA	AL OR STATE	OFFICE USE			
Approved By fames (d. Approval of this notice does not warrant or itable title to those rights in the subject lease	Title SE.	5.	Da	5-28-14	
hich would entitle the applicant to condu	ect operations thereon.	Office CFC			· · · · · · · · · · · · · · · · · · ·	
Itle 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s	U.S.C. Section 1212, make it a crime for any p statements or representations as to any matter w	erson knowingly and ithin its jurisdiction.	willfully to make to any de	partment or agency of the	he United	

Additional data for EC transaction #244409 that would not fit on the form

32. Additional remarks, continued

up surface location.

See attached procedure, as well as current and proposed wellbore diagrams for the subject well.

RKI Exploration and Production, LLC

Federal AZ 1 (Revised)

Section 29 T26S R30E Eddy County, New Mexico API No. 30-015-23324



· KB - 2,996' 5/1/14; JLM GL - 2,981'17/2" hole 9 5/8" topped off with 100 sx "C" Pump 50 sx cmt from 150'-surface TOC from 0'-150' 12/89 NOTE: Mechanical cut casing twice TOC @ 400' per report (CBL) / @ 400' and 320' prior to 100 sx top-off in 12/89. 13 3/8" 48#@ 950' / 1100 SX Circ. 216 SX Pump 80 sx cmt from 1,050'-800' Pump 50 sx cmt from 2,450'-2,300' CIBP @ 3,275' w/ 25 sx cmt on plug Delaware 3,350'-3,396'. Squeezed / off w/ 250 sx Class "H" in 11/85. Tested to 500 psi for 15 minutes. 9 5/8" Watson Lok-set pkr w/ 95/8" 36#@3,555' 1900 sx . TOC 400 (T/s on/off tool @ 3,498'. Pump 300 sx cmt from 3,475'-4,480' **OPEN HOLE: 3,555'-4,480'**


TD 4,480'

RKI Exploration and Production, LLC

Federal AZ 1

Section 29 T26S R30E Eddy County, New Mexico API No. 30-015-23324



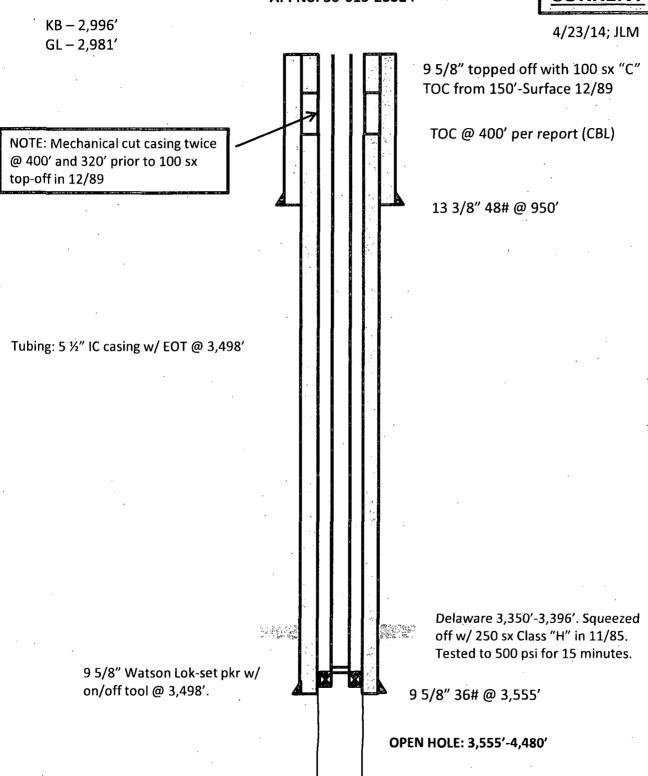

TD 4,480'

RKI Exploration & Production, LLC Federal AZ SWD 1 (Revised)

Plugging & Abandonment Procedure

Section 29 T26S R30E Eddy County, New Mexico API # 30-015-23324 Property No. 159100

> Prepared By: Jaime McAlpine, P.E. Email: jmcalpine@rkixp.com

Disposal Formation: Delaware 3,555'-4,480' Open Hole

Spud Date: 6/18/80

Comp Date: 11/8/82 **Reentry date:** 11/6/85

KB Elev: 2,996' GL Elev: 2,981'

TD: 3,555' **PBTD:** 3,510'

TUBULAR SUMMARY:

Surface:

13 3/8" 48#: 0' - 950'- TOC @ surface

Production:

9 5/8" 36#: 0' - 3,555' - TOC @ 400' per report (CBL). Topped off from 0-150' w/ 100 sx "C" cmt

Tubing:

5½" 15.5#: 0'-3,498' - Watson Lok-set packer w/ on/off tool @ 3,498'

OBJECTIVE: Plug and abandon per Federal BLM requirements.

RKI REQUIRES THAT HARD HATS, STEEL TOE BOOTS, FIRE RETARDANT CLOTHING, AND SAFETY GLASSES BE WORN ON LOCATION

HOLD SAFETY MEETING PRIOR TO COMMENCING DAILY OPERATIONS

NO IGNITION SOURCES WITHIN 100 FT OF THE WELLHEAD, TANKS OR MANIFOLD.

PROCEDURE:

- 1) Test safety anchors.
- 2) MI RU Service Unit. Set frac tank and lay flowline to tank.
- 3) ND flange. NU BOP.
- 4) MI RU casing crew. Unlatch on/off tool, POH, LD 5½" IC casing. RD MO casing crew.
- 5) Deliver, unload and tally 3,600' 2 7/8" 6.5# J-55 EUE workstring.
- 6) TIH w/ on/off tool, tubing to 3,498'. Latch into on/off tool.
- 7) MI RU cementers. Pump 300 sx Class C cement (14.8 ppg, 6.3 gps, 1.32 cfs). Flush w/ 20 bbls. heavy mud. Unlatch from on/off tool. TOH w/ tubing.
- 8) TIH w/ mechanical set CIBP and set at 3,275'. POH w/ 1 jt tubing. Circulate wellbore with 250 bbls heavy mud. Pump 25 sxs Class C cement (14.8 ppg, 6.3 gps, 1.32 cfs). Flush w/ 18 bbls. heavy mud.
- 9) POH w/ tubing to 2,450', LD 825' tubing.
- 10) Pump 50 sxs Class C cement (14.8 ppg, 6.3 gps, 1.32 cfs). Flush w/ 13 bbls. heavy mud. POH w/ 20 stds tubing. SI well 4 hours WOCT. RIH and tag plug (minimum TOC plug @ 2,350').

- 11) POH w/ tubing to 1,050'. LD 900' tubing.
- 12) Pump 80 sxs Class C cmt (14.8 ppg, 6.3 gps, 1.32 cfs). Flush w/ 4½ bbls. heavy mud. POH w/ 20 stds tubing. SI well 4 hours WOCT. RIH and tag plug (minimum TOC plug @ 900').
- 13) POH w/ tubing to 150', LD 900' tubing.
- 14) Pump 50 sx Class C cmt (14.8 ppg/6.3 gps/1.32 cfs) and circulate cement to surface.
- 15) TOH, LD tubing.
- 16) RD MO Service Unit.
- 17) Set from top of casing to minimum 4' above ground level, a 4" in diameter marker with WO cap with operator, well name/number and date. Remove all equipment, pull safety anchors and clean up surface location.

RKI Contact List:

RKI	Title	Office	Cell
Brent Umberham	Manager-Drlg & Prod Ops	405-996-5748	405-623-5080
Ken Fairchild	Production Manager	405-996-5764	469-693-6051
Gene Thompson	Production Superintendent	575-885-1313	817-908-9219
Paul Munding	Production Engineer	405-987-2140	405-820-2825
Jaime McAlpine	Engineering Consultant	405-996-5741	405-850-6685

Emergency Contacts - New Mexico:

Hospital:

Carlsbad Medical Center

(575) 887-4100

2430 W. Pierce St., Carlsbad, NM 88220

Sheriff's Office:

Lea County Sheriff Dept

(575) 396-3611

Eddy County Sheriff Dept

(575) 887-7551

Emergency Contacts - Texas:

Hospital:

Reeves County Hospital

(432) 447-3551

2323 Texas St, Pecos TX 79772

Sheriff's Office:

Reeves County Sheriff Dept

(432) 445-4901

Loving County Sheriff Dept

(432) 377-2411

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet, and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
 - 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Solomon Hughes Natural Resource Specialist 575-234-5951

Jeffery Robertson Natural Resource Specialist 575-234-2230

Duncan Whitlock Environmental Protection Specialist 575-234-5926

Jennifer Van Curen Environmental Protection Specialist 575-234-5905

Linda Denniston Environmental Protection Specialist 575-234-5974 Cody Layton Natural Resource Specialist 575-234-5959

Trishia Bad Bear Natural Resource Specialist 575-393-3612

Amanda Lynch Natural Resource Specialist 575-234-5922

Jessie Rice Natural Resource Specialist 575-234-5913

Indra Dahal Natural Resource Specialist 575-234-5996