Submit 1 Copy To Appropriate District Office	State of New Me		Form C-103
<u>District I</u> – (575) 393-6161	Energy, Minerals and Natu	ral Resources	Revised July 18, 2013 WELL API NO.
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283			30-015-22307
811 S. First St., Artesia, NM 88210	OIL CONSERVATION		5. Indicate Type of Lease
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Fran		STATE STATE STATE
District IV - (505) 476-3460	Santa Fe, NM 87	7505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM			
87505 SUNDRY NOTICE	ES AND REPORTS ON WELLS		7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSA	LS TO DRILL OR TO DEEPEN OR PL	UG BACK TO A	Bogle State Com
DIFFERENT RESERVOIR. USE "APPLICA PROPOSALS.)	TION FOR PERMIT" (FORM C-101) FO	OR SUCH	
	as Well 🛛 Other		8. Well Number
	_		1H
2. Name of Operator			9. OGRID Number
Devon Energy Production Compa	any, LP 405-228-	7203	6137
3. Address of Operator 333 West. Sheridan Avenue	·		10. Pool name or Wildcat
Oklahoma City, OK 73102-5015	5 405-228-7203		Diamond Mound; Upper Penn (G)
			Diamond Wound, Opper Felin (G)
4. Well Location		1	
Unit Letter : _2560	<del></del>	— —	<del></del>
Section 2	Township 16S Ra  11. Elevation (Show whether DR)	nge 27E	NMPM Eddy County
	3578' GL	, KKD, K1, GK, elc.,	
是一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个	3010 35		a to complete the part of the complete the c
12. Check Ap	propriate Box to Indicate N	ature of Notice.	Report or Other Data
•	•	1	•
NOTICE OF INT			SEQUENT REPORT OF:
	PLUG AND ABANDON	REMEDIAL WOR	<del>-</del>
<del></del>	CHANGE PLANS ☐ MULTIPLE COMPL ☐	COMMENCE DRI	
PULL OR ALTER CASING DOWNHOLE COMMINGLE	MULTIPLE COMPL	CASING/CEMENT	I JOB L
CLOSED-LOOP SYSTEM			
		OTHER:	· 🗖
OTHER: Recomplete			
	• • • • •		d give pertinent dates, including estimated date
		C. For Multiple Cor	mpletions: Attach wellbore diagram of
proposed completion or recon	ipietion.		
		to Recomplete the	subject well. Please see Procedure and
Schematics attached, thank yo	ou.		
			NM OIL CONSERVATION
			ARTESIA DISTRICT
			JUN 1 2 2014
0			3011 1 2 2014
			DECET/ED
Prinide C-102			RECEIVED
I hereby certify that the information ab	ove is true and complete to the bo	est of my knowledge	e and belief.
	$\wedge$	,	
1 - (1.1	′しょ人 ノ		
SIGNATURE 1	TITL	E: Regulatory As	<u>ssociate</u> DATE <u>6/11/2014</u>
Type or print name: Trina C. Couc	h E-mail address: trina.	couch@dvn.com	PHONE: 405-228-7203
For State Use Only	2 man address. uma.		
	141	"Geolo	oist" 6-17-20/11
APPROVED BY:	TITLE		DATE VILLOUT
Conditions of Approval (if any):			,

## **DVN: Bogle St Com #1**

## API #30-015-22307

Lat/Long: 32° 57"27.648" N, 103° 14' 32.064" W Sec 2-T16S-R27E Eddy County, NM

WBS: TBD

Purpose: Recomplete uphole

GLM: 3,578'

KBM: 3,590°

KB: 12

T.D. 8,780°

Well spud: 12/22/1977

PBTD: 6,440'

Casing and Tubing Data:

Size	Wt. lb/ft	Grade	Interval	(75% S.F.) Collapse	(75% S.F.) Burst	Drift	Capacity (bbls/ft)
13-3/8"	72	H-40	0 –345'	577	1,297	12.56"	-
8-5/8"	24	K-55	0 – 1632'	1,027	2,212	7.97	-
4-1/2"	11.6	K-55	0 – 1571'	3,720	4,012	3.875"	0.0155
4-1/2"	10.5	K-55	1571 - 6164'	3,007	3,592	3.927"	0.0159
4-1/2"	11.6	K-55	6164 - 8780'	3,720	4,012	3.875"	0.0155
2-3/8"	4.7	J-55	0 - 6340'	6,075	5,775	1.9"	.00387

Safety:

All personnel will wear hard hats, safety glasses with side shields, and steel toed boots while on location. Assess wellhead working height for safety. If needed, use work platform or man-lift for fall protection.

## Bogle St Com #1

Procedure:

- 1. Notify all regulatory agencies prior to initiation of work (if required) and Devon EHS personnel. Hold tailgate safety meetings prior to RU each morning and before each operational change or event.
- 2. Test and/or install anchors. MIRU WSU. Spot necessary enclosed tanks, flare stack and temporary flow lines to equipment. Record pressures on tbg, and csg.
- 3. Well TA'd. If WH pressure present, blow down to frac tanks. If well continues to flow, circulate 2% KCl or 10# brine if necessary. After well is in static conditions continue to step 4.

1

- 4. ND well cap, NU 10K BOPE and test. Wolfcamp formation could be over pressured.
- 5. PU tubing and RIH to tag plug at 6,440'. TOH tbg tally and visually inspect.
- 6. PU 2-3/8" work string and 3-7/8" bit and scraper, RIH to PB (+/-6,440'). TOH LD bit/scraper
- 7. PU packer RIH on 2-3/8" set at 50'. Pressure test below packer to 500 psi. POH packer. PU 4-1/2" RBP, RIH set at +/-50', dump 2 sx of sand on top of RBP.
- 8. There is a very shallow hole in the 4-1/2" csg, 2' below the wellhead. Disassemble wellhead down to prod 4-1/2" production csg and report status of TOC and location of hole to Artesia and OKC. Discuss with completions foremen best way to repair or sqz this hole. Hole must pressure test before continuing with workover. Dump bail or spot cement from surface and drill out if necessary. Do NOT attempt to sqz cement down 4-1/2" x 8-5/8" annulus without approval. Drill out cement and circulate out sand. RIH to retrieve RBP. Once shallow hole is repaired, continue with recompletion.
- 9. RU WL, RIH with CBL, CCL, GR. Log from PB to surface at 0 psi. Verify cement top at surface.
- 10. PU rental 4-1/2" packer TIH on work string to 6,330'. Pressure test csg to 3,500 psi. Assuming the pressure test passes, unseat packer. TOH.
- 11. RU TCP guns on 2-3/8" tbg RIH to 6,364', perf 4-1/2" csg at 6,364'-6,360' 6 SPM, 60 degree phasing. Drop bar to remove guns from tbg. Leave spent guns in rat hole.
- 12. RU acid crew and breakdown perfs with 2,000 gal 7.5% HCl NEFE. **Max pressure is 3,500 psi**. Estimated treating pressure is 3,175 psi @ 3 bpm. Displace and overflush with 80 bbl 2% KCl. Record ISIP, 5, 10, 15 min pressures. RD acid crew. Wait on acid 4 hrs.
- 13. Flow well back if pressure at surface. Once well static, circulate with 2% KCl. PU and TOH 2-3/8" tbg. Keep hole full while tripping out.
- 14. PU and RIH production string as follows, test tbg to 5000 psi while RIH.
  - a. 2-3/8" nipple with pump off plug set at +/-6,310'
  - b. X-Nipple 1.791" profile
  - c. 202 jts 2-3/8" 4.6# J-55 tbg.
- 15. Land tbg ND BOPE, NU WH. RU swab line to kick off well. Swab rest of work day plus 1 more day. Leave SI overnight. If well does not kick off on second day, RDMOL WSU, RU swab rig.
- 16. Once well kicked off, turn over to production.

Note: Any future slickline tools need to have a smooth surface to prevent coating damage.

Contact Company Office # Mobile #
-----------------------------------

Ronnie Carre	Completions Foreman	(575)748-0179	(575)748-5528
Tony Bunch	Completions Foreman	(575) 746-5581	(575) 499-5432
Trevor Klaassen	Engineer	(405) 552-5069	(405) 850-5870
Roy White	Production Foreman	(575)748-0194	(575)513-1741



