

CONSTITUTION Mexico Submit 1 Copy To Appropriate District Form C-103 Office Energy Minerals and Natural Resources Revised July 18, 2013 District I - (575) 393-6161 WELL API NO. 1625 N. French Dr., Hobbs, NM 88240 CMARCONSERVATION DIVISION District 1 - (575) 748-1283 30-015-26919 811 S. First St., Artesia, NM 88210 5. Indicate Type of Lease 1220 South St. Francis Dr. District III - (505) 334-6178' STATE 🖂 **FEE** 1000 Rio Brazos Rd., Aztec, NM 87410. RECEMEPFe, NM 87505 6. State Oil & Gas Lease No. District IV - (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM LG-1525 87505 SUNDRY NOTICES AND REPORTS ON WELLS 7. Lease Name or Unit Agreement Name (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A State CO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH 8. Well Number PROPOSALS.) 1. Type of Well: Oil Well Gas Well Other 2. Name of Operator 9. OGRID Number Yates Petroleum Corporation 025575 3. Address of Operator 10. Pool name or Wildcat 105 South Fourth Street, Artesia, NM 88210 Dagger Draw; Upper Penn, North 4. Well Location feet from the 1780 Unit Letter 660 North line and feet from the East line Township 19S 24E Section Range **NMPM** Eddy County 11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3598'GR 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: ALTERING CASING □ PERFORM REMEDIAL WORK PLUG AND ABANDON 🛛 REMEDIAL WORK \Box TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. P AND A MULTIPLE COMPL PULL OR ALTER CASING **CASING/CEMENT JOB** DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. Yates Petroleum Corporation plans to plug and abandon this well as follows: 1. NU BOP. RU all safety equipment as needed. No casing recovery will be attempted as production casing is cemented to surface. 2. Set a CIBP at 7608' and cap it with 25 sx Class "H" cement. 3. Spot a 30 sx Class "C" cement plug from 5631'-5801'. This will place a plug across stage tool. WOC and tag, reset if necessary.
4. Spot a 30 sx Class "C" cement plug from 5257'-5427'. This will place a plug across Wolfcamp top. 5. Spot a 30 sx Class "C" cement plug from 3137'-3307'. This will place a plug across Bone Spring top. 6. Spot a 30 sx Class "C" cement plug from 1944'-2114'. This will place a plug across Glorieta top. 7. Spot a 30 sx Class "C" cement plug from 1047'-1217'. WOC and tag, reset if necessary. This will place a plug across surface casing shoe 8. Spot a 35 sx Class "C" cement plug from 0-220'. WOC and tag, reset if necessary. This will form surface plug and casing shoe plug. Approved for plugging of well bore only. 9. Remove all surface equipment and weld dry hole marker per regulations. Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging) Wellbore schematics attached which may be found at OCD Web Page under CONDITIONS OF APPROVAL ATTACHED Forms, www.cmnrd.state.nm.us/ocd Rig Release Date: Approval Granted providing work is Completed by is true and complete to the best of my knowledge and belief. TITLE Regulatory Reporting Supervisor DATE March 17, 2015 Type or print name Tina Huerta E-mail address: tinah@vatespetroleum.com 575-748-4168 For State Use Only APPROVED BY: Conditions of Approval (if any): \$ 500 Attendid COA's

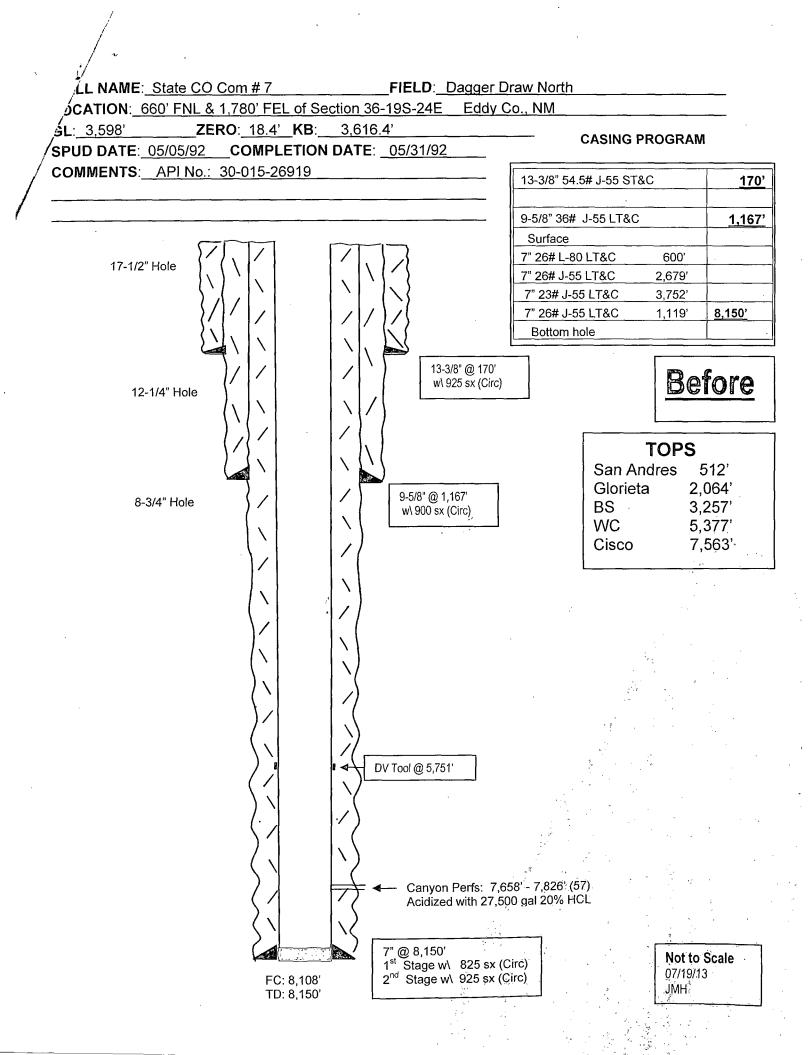

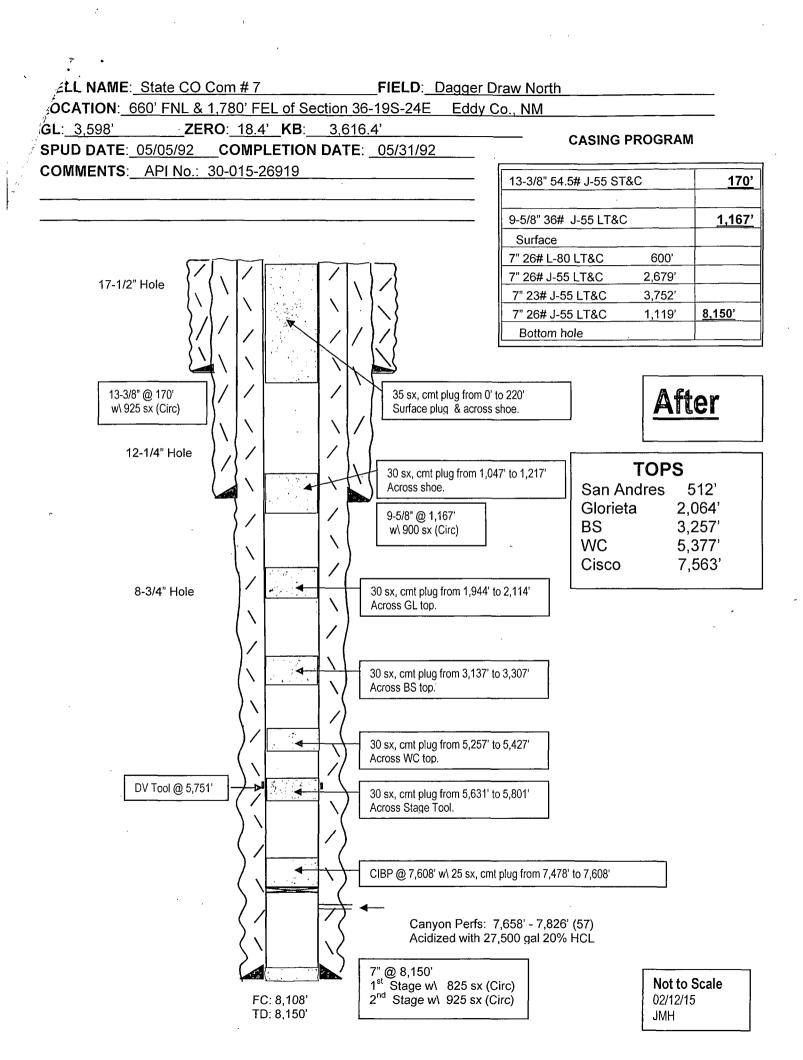

NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator: Vates Perloceum	
Well Name & Number: State Co #7	
API #: 30-015-26919	

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- **6.** If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.
- 9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
- 10. Plugs may be combined after consulting with and getting approval from NMOCD.
- 11. Minimum WOC time for tag plugs will be 4 Hrs.

DATE: 3/24/2015

APPROVED BY:

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - o Fusselman
 - o Devonian
 - o Morrow
 - o Wolfcamp
 - o Bone Spring
 - o Delaware
 - o Any Salt Section (Plug at top and bottom)
 - o Abo
 - o Glorieta
 - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).