128293031	
State of New Mexico Sopropries State of New Mexico Energy, Minerals and Natural Resources Department Diam's Original Office of New Mexico Energy, Minerals and Natural Resources Department Office of New Mexico	Form C-103 ' Revised 1-1-09
Diamiz Orted JUL 2003 67	
DISTRICTION RECEIVED ON CONSERVATION DIVISION	WELL API NO. 30-015-22333
DISTRICTII (%) P.O. Drawer DD, Organia, NM 12210 Santa Fe, New Mexico 87504-2088	S. Indicate Type of Lance
DISTRICT III 1000 Rio Bruca R4. Asia (101 90 1)	6. Sain OI & Gue Loue No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRIFL OR TO DEEPEN OR PUTG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lead Name or Unit Agrocment Name
1. Type of Well:	Marquess Com
AUT OUNCX	·
L Nume of Operator Kaiser-Francis Oil Company	& Well Na 1
1. Address of Operator	9. Pool same or Wildcut
P.O. Box 21468, Tulsa, OK 74121-1468	Carlsbad, South (Wolfcamp)
Unit Leaser N : 660 Food From The South Line and 1980) Food Froom The West Line
Socion 9 Township 23S Range 27E	NAMPM Eddy County
10. Berraica (Show whether DF, RKB, RT, GR, ac.)	
Charles A amount to Bours to Latines Name of Nation Reports on Other Date	
11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING
TEMPORMRILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT X	
PULL OR ALTER CASING CEMENT JOB CASING TEST AND CEMENT JOB	
OTHER:	C
12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and fine pertinent dates, including extinated date of starting any proposed work). SEE RULE 1103.	
Well was plugged back to 9870'. 6-30-03 Set 4-1/2" CIBP @ 9775' w/ 35' cmt. on top. TOC @ 9740'. Circ. w/ 9.5# mud gel. 7-01-03 Spot 25 sx cmt. from 8970' to 8608'. Spot 60 sx cmt. from 5650' to 5419', WOC & tag @ 5423'. 7-02-03 Spot 60 sx cmt. from 2110' to 1912'.	
Spot 60 sx cmt. from 1845' to 1647', WOC & tag @ 1638'.	
Spot 125 sx cmt. from 430' to surface, circulated. RDMO. Cut off wellhead, install dry hole marker, & cleaned location.	
Note: Found free-point on $4\frac{1}{2}$ " casing @ 5600'. Cut casing @ 5601' & POOH.	
I hereby cartify that the informatific above in true and complete to the best of my temperature and belief.	
7/02/03	
THEORIENT NAME TELEPHONE NO.	
Field Supervisor NOV 1 6 2005	
ATTOMOTET	ONTE 1 0 ZUUS

UNDUDING OF MILHOVAL IE WAS



NEW MEXICO ENERGY, MINERALS and NATURAL RESOURCES DEPARTMENT

BILL RICHARDSON Governor

Title

Joanna Prukop
Cabinet Secretary

1/1 OK TU Relan Lori Wrotenbery Director 30 July 2003 Kaiser-Prancis Oil Co. P.O. Box 21468 Tulsa, OK. 74121 Form C-103 Report of Plugging for your Marquez Com # 1 N-9-23-27 API 30-015-22333 Cannot be approved until an NMOCD representative has made an inspection of the location and found it to be cleared to comply with OCD rules and regulations. Please check each item in the space provided to indicate that the work has been accomplished and the location is ready for final inspection. 1. All pits have been filled and leveled. 2. Rat hole and cellar have been filled and leveled. 3. A steel marker 4" in diameter and approximately 4' above mean ground level has been set in concrete to mark the exact location of the plugged well. (Marker must have operator name, lease name, well number and location including quarter/quarter section or unit letter, section, township, range and API well ID number permanently welded, stamped or otherwise engraved into the metal marker.) 4. The location has been leveled as nearly as possible to original top ground contour and has been cleared of all junk and equipment. 5. The dead men and tie downs have been cut and removed. 6. If a one well lease or last remaining well on lease, the battery and burn pit locations have been leveled and cleared of all junk & equipment. 7. All environmental concerns have been addressed as per OCD guidelines. The above are minimum requirements and no plugging bond will be cancelled until all locations for plugged and abandoned wells have been inspected and Form C-103 approved. When all of the work outlined above has been done, please notify this office by completing, signing and returning this letter to us so that our representative will not have to make more than one trip to the location. I certify that the above work has been done and the above-mentioned lease is ready for OCD inspection and approval. Name