

Operator Southeastern Petroleum Inc.
Well Pogo State #1
Unit P Section 16 Township 7 Range 28
API # 30-005-60915

TOPS

T. Salt _____
B. Salt _____
Yates _____
Glorieta Ocean 1212
Delaware San Andres 1660
Bone Sp. _____
Abo _____
Wolfcamp _____
Morrow _____
Devonian _____
Fusselman _____
Other _____

- Perf & Sguz. @ 100'
Spot cement plug IN & OUT.
TO Surface.

8 5/8" 250'
- Perf. & Sguz. @ 325'
Spot 150' cement plug IN & OUT (325' - 175')
WOC TAG

TOC 1654'
Up SA 1660'

- Set 4 1/2" CIPP @ 2243
w/ 35' cement on top.

Perfs. 2253'

4 1/2" 2523'

- Contact OCD 24 hrs. prior to any work done.
- Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug
- Install dry hole marker as per rule 202.B.2
- Plugs are to be set from point indicated up. Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- Surface plug will be from 0' - 60'
- Where plugs are required cement must be placed inside and outside of all casing string(s), in the correct footage or sacks required, if no cement exists.
- Plugs to be tagged will be indicated.