

Operator Reuben Monsen
Well North State #1
Unit G Section 23 Township 18 Range 27
API # 30-015 -- 00931

TOPS

T. Salt _____
B. Salt _____
Yates 190
Glorieta 7 Rivers 580
Delaware Bowers 910
Bone Sp. Queens 1170
Abo Grayburg 1600
Wolfcamp _____
Morrow _____
Devonian _____
Fusselman _____
Other _____

Perf + Sguz. @ 240'
Cement Plug In + Out
to Surface.

Perf + Sguz. Spot 100' cement
plug In + Out. WOC TAG.

- Contact OCD 24 hrs. prior to any work done.
- Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug
- Install dry hole marker as per rule 202.B.2
- Plugs are to be set from point indicated up.
Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- Surface plug will be from 0' - 60'
- Where plugs are required cement must be placed inside and outside of all casing string(s), in the correct footage or sacks required, if no cement exists.
- Plugs to be tagged will be indicated.

Perf + Sguz. @ 1700'
100' cement plug In + Out WOC TAG.

T. O 2035'
O H