	State of New Mexico Office	Form C-103						
	Office  District I – (575) 393-616 OIL CONSERVATION Minerals and Natural Resource 1625 N. French Dr., Hobbs, NM 8824 ESIA DISTRICT District II – (575) 748-1283	Revised July 18, 2013 WELL API NO.						
	District II – (575) 748-1283	30-015-29420						
	811 S. First St., Artesia, NM 88210CCP 2 & 2013L CONSERVATION DIVISION	5. Indicate Type of Lease						
	1000 Pio Benzos Pd. Autos NM 97410	STATE FEE 🔀						
	<u>District IV</u> = (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NMRECEIVED	6. State Oil & Gas Lease No.						
	87505 SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name						
	(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	Gaines 28						
,	1. Type of Well: Oil Well 🔀 Gas Well 🗌 Other	8. Well Number 2						
	2. Name of Operator	9. OGRID Number						
	OXY USA Inc.  3. Address of Operator	16696 10. Pool name or Wildcat						
	P.O. Box 50250 Midland, TX 79710	Cedar Canyon Delaware						
	4. Well Location							
	Unit Letter A : 330 feet from the NONTH line and	600 feet from the east line						
	Section 28Township 245 Range 29E							
	11. Elevation (Show whether DR, RKB, RT, GR	, etc.)						
l	2924	Line of the state of the state of						
	12. Check Appropriate Box to Indicate Nature of Not	ice, Report or Other Data						
	NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:						
	PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL V	<u> </u>						
		DRILLING OPNS. P AND A						
	PULL OR ALTER CASING	MENT JOB						
	DOWNHOLE COMMINGLE							
	CLOSED-LOOP SYSTEM	П						
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated dat of starting any proposed work). SEE RULE 19.15.7 11 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.								
	,							
	13-3/8" 54.5# csg @ 525' w/ 600sx, 17-1/2" hole, TOC-Surf-Circ 8-5/8" 24# csg @ 1410' w/ 700sx, 11" hole, TOC-Surf-Circ							
	5-1/2" 15.5# csg @ 5350' DVT @ 3993' w/ 635sx, 7-7/8" hole, TOC-2680'-CBL							
	1. RIH & tag CIBP @ 5186', M&P 25sx cmt to 5006'	3x, 7 770 Hole, 100 2000 CDE						
	2. M&P 25sx cmt @ 4085-3905' WOC-Tag							
	Approved for plugging of well boro both							
	4. Perf @ 1460', sqz 35sx cmt to 1360' WOC-Tag	Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging)						
	5. Perf @ 575' sqz 180sx cmt to surface	I which may be found at OCD Web Page and a 1						
	10# MLF between plugs	Forms, www.cmnrd.state.nm.us/oed.						
	Above ground steel tanks will be utilized							
6	Spud Date: Rig Release Date:							
_		طار						
]	I hereby certify that the information above is true and complete to the best of my know	rledge and belief.						
	SIGNATURE TITLE Sr. Regulatory A	dvisor DATE 9/24/15						
F	Type or print name <u>David Stewart</u> E-mail address: <u>david_stewart@oxy.com</u> PHONE: <u>432-685-5717</u>							
1	For State Hee Only							
<u>!</u>	For State Use Only  A  A  A  A  A  A  A  A  A  A  A  A  A							
	APPROVED BY: NOW TITLE DIST HOD	2WISO DATE 10/1/2015						
(	Conditions of Approval (if any):	,						
	See Attached COA's							

المعا لمر

OXY USA Inc. - Proposed ~ Gaines 28 #2 API No. 30-015-29420

180sx @ 575'-Surface

\_⊋ \_\_\_\_\_ Perf @ 575'

17-1/2" hole @ 525' 13-3/8" csg @ 525' w/ 600sx-TOC-Surf-Circ

35sx @ 1460-1360' WOC-Tag

Perf @ 1460'

11" hole @ 1410' 8-5/8" csg @ 1410' w/ 700sx-TOC-Surf-Circ

35sx @ 2955-2700' WOC-Tag

25sx @ 4085-3905' WOC-Tag

25sx @ 5186-5006' 3/12-CIBP @ 5186'


PB-5302'

TD-5350'





OXY USA Inc. - Current Gaines 28 #2 API No. 30-015-29420

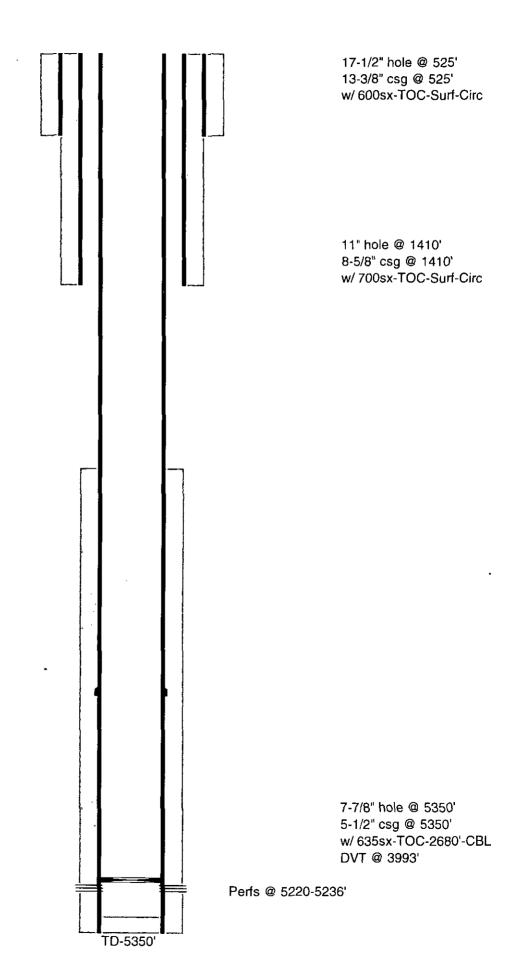

3/12-CIBP @ 5186'

PB-5302'

## NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

## CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator:	C	xy (	)5A	<del></del>	
Well Name &	& Number:_	Gain	es 28	<b>8</b> 2	
API #:	30.0	15-	29420		

- 1. Produced water will not be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- 6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.
- 9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
- 10. Plugs may be combined after consulting with and getting approval from NMOCD.
- 11. Minimum WOC time for tag plugs will be 4 Hrs.

800 10/1/2015

## GUIDELINES FOR PLUGGING AND ABANDONMENT

## DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub
  plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
  - o Fusselman
  - o Devonian
  - o Morrow
  - o Wolfcamp
  - Bone Spring
  - o Delaware
  - o Any Salt Section (Plug at top and bottom)
  - o Abo
  - o Glorieta
  - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing
  must be cut and pulled with plugs set at these depths or casing must be perforated and cement
  squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).