
	UNITED STATES PARTMENT OF THE IN	ITERIOR OCD	Artesla	ON Exp	RM APPROVED IB No. 1004-0137 pires: July 31, 2010
/ BUR	REAU OF LAND MANA	GEMENT		5. Lease Serial No.	1829
Do not use this	NOTICES AND REPOR form for proposals to Use Form 3160-3 (AP	drill or to re-enter a		6. If Indian, Allottee or	
SUBMIT IN TRIPLICATE – Other instructions on page 2.         1. Type of Well         Oil Well         Oil Well         Oil Well			7. If Unit of CA/Agreement, Name and/or No. 8. Well Name and No. Chaparral OZ Fed # 001		
					2. Name of Operator Vanguard Operating LLC         3a. Address         3b. Phone No. (include area code)         5847 San Felipe St., Suite. 3000, Houston, TX 77057         4. 'Location of Well (Footage, Sec., T.,R.,M., or Survey Description)         LAT (27) 32.5760088         2310 FNL & 660 FEL         UL-H Sec 17, T24S, R24E
11. Country or Parish, State Eddy County, NM					
12. CHE	CK THE APPROPRIATE BOX	(ES) TO INDICATE NATUR	RE OF NOTI	CE, REPORT OR OTHE	
TYPE OF SUBMISSION		די ד	YPE OF AC	FION	· · · · · · · · · · · · · · · · · · ·
Notice of Intent Subsequent Report	Acidize Alter Casing Casing Repair Change Plans	Deepen Fracture Treat New Construction Plug and Abandon	Rec	luction (Start/Resume) lamation omplete oporarily Abandon	Water Shut-Off Well Integrity Other
Final Abandonment Notice	Convert to Injection	Plug Back	U Wat	er Disposal	
testing has been completed. Final determined that the site is ready for Note: A closed loop system will 1. Notified BLM 24 hours prior	ved operations. If the operation Abandonment Notices must be or final inspection.) I be used for all fluids from th to MIRU to P&A.	results in a multiple completi filed only after all requirement nis wellbore and disposed o	ion or recomp nts, including of required b	pletion in a new interval, g reclamation, have been o	orts must be filed within 30 days a Form 3160-4 must be filed once completed and the operator has
<ol> <li>testing has been completed. Final determined that the site is ready for Note: A closed loop system will</li> <li>Notified BLM 24 hours prior</li> <li>RIH tag RBP @ 9964' spot</li> <li>Circ hole with mud laden fluit tag</li> <li>Perf &amp; sqz 50x class c cmt (6)</li> <li>Perf &amp; sqz 120 x class c cmt (7)</li> <li>Perf @ 190' circ cmt to surf (8)</li> <li>RD cut off wellhead below get</li> </ol>	ved operations. If the operation Abandonment Notices must be or final inspection.) I be used for all fluids from th to MIRU to P&A. 20x cmt on top POH set CIB d, spot 20x on cibp @ 9726' 25 9 4300'-4200' (3000' diff plug @3287'-3187' (Bone Springs : @ 2515' - 2196' (8 5/8 " sho w/40x class c cmt via 4 1/2" ( round level weld on steel pla	results in a multiple completi filed only after all requirement his wellbore and disposed of P @ 9726' RIH tag cibp PUH spot 30x class "c" cm (m'n 140' Plus) Tag WOC & Tag (m n 130 be & Delaware sand) woc & & 4 1/2" x 8 5/8" csg ann (1 te, cut anchors clean locatio	ion or recom nts, including of required b <b>8030</b> it @ <del>7550</del> '-7 <b>1 <i>Plug</i></b> ) tag 3 3/8" cond	pletion in a new interval, g reclamation, have been o by OCD Rule 19.15.17 '300' (wolfcamp) perfs t uctor pipe) woc ensure	a Form 3160-4 must be filed once completed and the operator has that were sqz'd in 12/99 woc & toc @ surf
<ol> <li>testing has been completed. Final determined that the site is ready for Note: A closed loop system will</li> <li>Notified BLM 24 hours prior</li> <li>RIH tag RBP @ 9964' spot</li> <li>Circ hole with mud laden fluit tag</li> <li>Perf &amp; sqz 50x class c cmt (6)</li> <li>Perf &amp; sqz 120 x class c cmt (7)</li> <li>Perf @ 190' circ cmt to surf (8)</li> <li>RD cut off wellhead below get</li> </ol>	ved operations. If the operation Abandonment Notices must be or final inspection.) I be used for all fluids from th to MIRU to P&A. 20x cmt on top POH set CIB d, spot 20x on cibp @ 9726' 25 @ 4300'-4200' (3000' diff plug @3287'-3187' (Bone Springs @ 2515' - 2196' (8 5/8 " sho w/40x class c cmt via 4 1/2" &	results in a multiple completi filed only after all requirement his wellbore and disposed of P @ 9726' RIH tag cibp PUH spot 30x class "c" cm (m'n 140' Plus) Tag WOC & Tag (m n 130 be & Delaware sand) woc & & 4 1/2" x 8 5/8" csg ann (1 te, cut anchors clean locatio	ion or recom nts, including of required b <b>BO3D</b> it @ <b>7550'-7</b> if <b>Plug</b> ) it ag 3 3/8" cond on install dr	pletion in a new interval, g reclamation, have been o by OCD Rule 19.15.17 '300' (wolfcamp) perfs t uctor pipe) woc ensure y hole marker	a Form 3160-4 must be filed once completed and the operator has that were sqz'd in 12/99 woc & toc @ surf
testing has been completed. Final determined that the site is ready for Note: A closed loop system wil 1. Notified BLM 24 hours prior 2. RIH tag RBP @ 9964' spot 3. Circ hole with mud laden fluit tag 4. Perf & sqz 50x class c cmt ( 5. Perf & sqz 50x class c cmt ( 6. Perf & sqz 120 x class c cmt ( 7. Perf @ 100' circ cmt to surf ( 8. RD cut off wellhead below g	ved operations. If the operation Abandonment Notices must be or final inspection.) I be used for all fluids from the to MIRU to P&A. 20x cmt on top POH set CIB d, spot 20x on cibp @ 9726' 213 @ 4300'-4200' (3000' diff plug @ 3287'-3187' (Bone Springs :@ 2515' - 2196' (8 5/8 " sho w/40x class c cmt via 4 1/2" & round level weld on steel pla	results in a multiple completi filed only after all requirement his wellbore and disposed of P @ 9726' RIH tag cibp PUH spot $30^{\circ}$ class "c" cm (m'n 140' plug) Tag (m'n 140' plug) Tag WOC & Tag (m 130' e & Delaware sand) woc & & 4 1/2" x 8 5/8" csg ann (1 te, cut anchors clean location of the plug of the plug of the plug plug of the plug of the plug of the plug plug of the plug of the plug of the plug of the plug of the plug of the plug of the plug of the plug of th	ion or recom nts, including of required b <b>8630</b> t @ <b>7550'-7</b> <b>1 Alug</b> ) tag 3 3/8" cond on install dr	pletion in a new interval, g reclamation, have been o by OCD Rule 19.15.17 '300' (wolfcamp) perfs t uctor pipe) woc ensure	a Form 3160-4 must be filed once completed and the operator has that were sqz'd in 12/99 woc & toc @ surf FOR ARTESIA DISTRIC FOR JUN 28 200 F APPROVAL
testing has been completed. Final determined that the site is ready for Note: A closed loop system wil 1. Notified BLM 24 hours prior 2. RIH tag RBP @ 9964' spot 3. Circ hole with mud laden fluit tag 4. Perf & sqz 50x class c cmt ( 5. Perf & sqz 50x class c cmt ( 6. Perf & sqz 120 x class c cmt ( 7. Perf @ 100' circ cmt to surf ( 8. RD cut off wellhead below g	ved operations. If the operation Abandonment Notices must be or final inspection.) I be used for all fluids from the to MIRU to P&A. 20x cmt on top POH set CIB d, spot 20x on cibp @ 9726' 213 @ 4300'-4200' (3000' diff plug @ 3287'-3187' (Bone Springs :@ 2515' - 2196' (8 5/8 " sho w/40x class c cmt via 4 1/2" & round level weld on steel pla	results in a multiple completi filed only after all requirement his wellbore and disposed of P @ 9726' RIH tag cibp PUH spot $30^{\circ}$ class "c" cm (m'n 140' plug) Tag (m'n 140' plug) Tag WOC & Tag (m 130' e & Delaware sand) woc & & 4 1/2" x 8 5/8" csg ann (1 te, cut anchors clean location of the plug of the plug of the plug plug of the plug of the plug of the plug plug of the plug of the plug of the plug of the plug of the plug of the plug of the plug of the plug of th	ion or recom nts, including of required b <b>8630</b> t @ <b>7550'-7</b> <b>1 Alug</b> ) tag 3 3/8" cond on install dr	pletion in a new interval, g reclamation, have been on by OCD Rule 19.15.17 (300' (wolfcamp) perfs to uctor pipe) woc ensure y hole marker	a Form 3160-4 must be filed once completed and the operator has that were sqz'd in 12/99 woc & toc @ surf FOR ARTESIA DISTRIC FOR JUN 28 200 F APPROVAL
testing has been completed. Final determined that the site is ready for Note: A closed loop system wil 1. Notified BLM 24 hours prior 2. RIH tag RBP @ 9964' spot 3. Circ hole with mud laden flui tag 4. Perf & sqz 50x class c cmt ( 5. Perf & sqz 50x class c cmt ( 6. Perf & sqz 120 x class c cmt ( 7. Perf @ 100' circ cmt to surf ( 8. RD cut off wellhead below g 1500' - Surface REC 4. I hereby certify that the foregoing is to Jimmy Bagley	ved operations. If the operation Abandonment Notices must be or final inspection.) I be used for all fluids from the to MIRU to P&A. 20x cmt on top POH set CIB d, spot 20x on cibp @ 9726' 213 @ 4300'-4200' (3000' diff plug @ 3287'-3187' (Bone Springs :@ 2515' - 2196' (8 5/8 " sho w/40x class c cmt via 4 1/2" & round level weld on steel pla	results in a multiple completi filed only after all requirement his wellbore and disposed of P @ 9726' RIH tag cibp PUH spot 30% class "c" cm (m,'n 140' plug) Tag WOC & Tag (m, n 130 be & Delaware sand) woc & & 4 1/2" x 8 5/8" csg ann (1 te, cut anchors clean location (n) for record for record for record	ion or recom nts, including of required b <b>BO3D</b> it @ <b>7550'-7</b> if <b>Alug</b> 3 3/8" cond on install dr <b>S</b> [ <b>C</b> (	pletion in a new interval, g reclamation, have been on by OCD Rule 19.15.17 (300' (wolfcamp) perfs to uctor pipe) woc ensure y hole marker	a Form 3160-4 must be filed once completed and the operator has that were sqz'd in 12/99 woc & toc @ surf FOR ARTESIA DISTRIC FOR JUN 28 200 F APPROVAL
testing has been completed. Final determined that the site is ready for Note: A closed loop system wil 1. Notified BLM 24 hours prior 2. RIH tag RBP @ 9964' spot 3. Circ hole with mud laden fluit tag 4. Perf & sqz 50x class c cmt ( 5. Perf & sqz 50x class c cmt ( 6. Perf & sqz 120 x class c cmt ( 7. Perf @ 100' circ cmt to surf ( 8. RD cut off wellhead below g	ved operations. If the operation Abandonment Notices must be or final inspection.) I be used for all fluids from the to MIRU to P&A. 20x cmt on top POH set CIB d, spot 20x on cibp @ 9726' 25 9 4300'-4200' (3000' diff plug @ 3287'-3187' (Bone Springs @ 2515' - 2196' (8 5/8 " sho w/40x class c cmt via 4 1/2" of cound level weld on steel play dwe for Cont CLAMATION PROCEDURE ATTACHED.	results in a multiple completi filed only after all requirement his wellbore and disposed of P @ 9726' RIH tag cibp PUH spot 30x class "c" cm (m,'n 140' plug) Tag WOC & Tag (m n 130 be & Delaware sand) woc & & 4 1/2" x 8 5/8" csg ann (1 te, cut anchors clean location of for fector for the for the for the for the for the definition of the definition of the for the definition of the	ion or recom nts, including of required b <b>SOJ</b> it @ 7550'-7 if <b>Phug</b> 3 3/8" cond on install dr <b>S</b> [ <b>C</b> ( 016	pletion in a new interval, g reclamation, have been on by OCD Rule 19.15.17 (300' (wolfcamp) perfs to uctor pipe) woc ensure y hole marker EE ATTACHED DNDITIONS O	a Form 3160-4 must be filed once completed and the operator has that were sqz'd in 12/99 woc & toc @ surf FOR OIL CONSERVA ARTESIA DISTRIC ARTESIA DISTRIC
testing has been completed. Final determined that the site is ready for Note: A closed loop system wil 1. Notified BLM 24 hours prior 2. RIH tag RBP @ 9964' spot 3. Circ hole with mud laden flui tag 4. Perf & sqz 50x class c cmt ( 5. Perf & sqz 50x class c cmt ( 6. Perf & sqz 120 x class c cmt ( 7. Perf @ 100' circ cmt to surf ( 8. RD cut off wellhead below g 1500' - Surface REC 4. I hereby certify that the foregoing is to Jimmy Bagley	ved operations. If the operation Abandonment Notices must be or final inspection.) I be used for all fluids from the to MIRU to P&A. 20x cmt on top POH set CIB d, spot 20x on cibp @ 9726' 25 9 4300'-4200' (3000' diff plug @ 3287'-3187' (Bone Springs @ 2515' - 2196' (8 5/8 " sho w/40x class c cmt via 4 1/2" of cound level weld on steel play dwe for Cont CLAMATION PROCEDURE ATTACHED.	results in a multiple completi filed only after all requirement is wellbore and disposed of P @ 9726' RIH tag cibp PUH spot 30% class "c" cm (m.'n 140 plug) Tag (WOC & Tag (m. 130 e & Delaware sand) woc & & 4 1/2" x 8 5/8" csg ann (1 te, cut anchors clean location (m.'n 140 plug) Tag (m.'n 140 plug) Tag (m. 130 plug) Tag (m. 130 plug) Tag (m.'n 140 plug) Tag (m.'n 140 plug) Tag (m.'n 140 plug) Tag (m.'n 140 plug) Tag (m. 130	ion or recom nts, including of required b <b>SOF</b> t @ <b>7550'-7</b> <b>P Alug</b> t ag 3 3/8" cond on install dr <b>SE</b> <b>C</b> (016 <b>TATE OF</b>	pletion in a new interval, g reclamation, have been on by OCD Rule 19.15.17 (300' (wolfcamp) perfs to uctor pipe) woc ensure y hole marker EE ATTACHED DNDITIONS O	a Form 3160-4 must be filed once completed and the operator has that were sqz'd in 12/99 woc & toc @ surf FOR ARTESIA DISTRIC FOR JUN 28 201 F APPROVAL
testing has been completed. Final determined that the site is ready for Note: A closed loop system wil 1. Notified BLM 24 hours prior 2. RIH tag RBP @ 9964' spot 3. Circ hole with mud laden flui- tag 4. Perf & sqz 50x class c cmt ( 5. Perf & sqz 50x class c cmt ( 6. Perf & sqz 120 x class c cmt ( 7. Perf @ 100' circ cmt to surf y 8. RD cut off wellhead below g 1500' - Surf face REC 4. I hereby certify that the foregoing is to Jimmy Bagley	ved operations. If the operation Abandonment Notices must be or final inspection.) I be used for all fluids from the to MIRU to P&A. 20x cmt on top POH set CIB id, spot 20x on cibp @ 9726' 25 @ 4300'-4200' (3000' diff plug @ 3287'-3187' (Bone Springs : @ 2515' - 2196' (8 5/8 " sho w/40x class c cmt via 4 1/2" for cound level weld on steel play dwc fb Comt CLAMATION PROCEDURE ATTACHED. THIS SPACE Fi d. Approval of this notice does not title to those rights in the subject I	results in a multiple completi filed only after all requirement his wellbore and disposed of P @ 9726' RIH tag cibp PUH spot 30% class "c" cm (m,'n 140' plug) Tag WOC & Tag (m, n 130 be & Delaware sand) woc & & 4 1/2" x 8 5/8" csg ann (1 te, cut anchors clean location of the foll fector be a belaware sand) woc & & 4 1/2" x 8 5/8" csg ann (1 te, cut anchors clean location of the foll fector be a belaware sand) woc & & 4 1/2" x 8 5/8" csg ann (1 te, cut anchors clean location of the foll fector be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 4 1/2" tag (m, n 130 be a belaware sand) woc & & 5/8" csg and (1 teg (m) tag (1 teg (	ion or recom nts, including of required b <b>SOJ</b> it @ 7550'-7 if <b>Phug</b> 3 3/8" cond on install dr <b>S</b> [ <b>C</b> ( 016	pletion in a new interval, g reclamation, have been on by OCD Rule 19.15.17 (300' (wolfcamp) perfs to uctor pipe) woc ensure y hole marker EE ATTACHED DNDITIONS O	a Form 3160-4 must be filed once completed and the operator has that were sqz'd in 12/99 woc & toc @ surf FOR


.

•

.

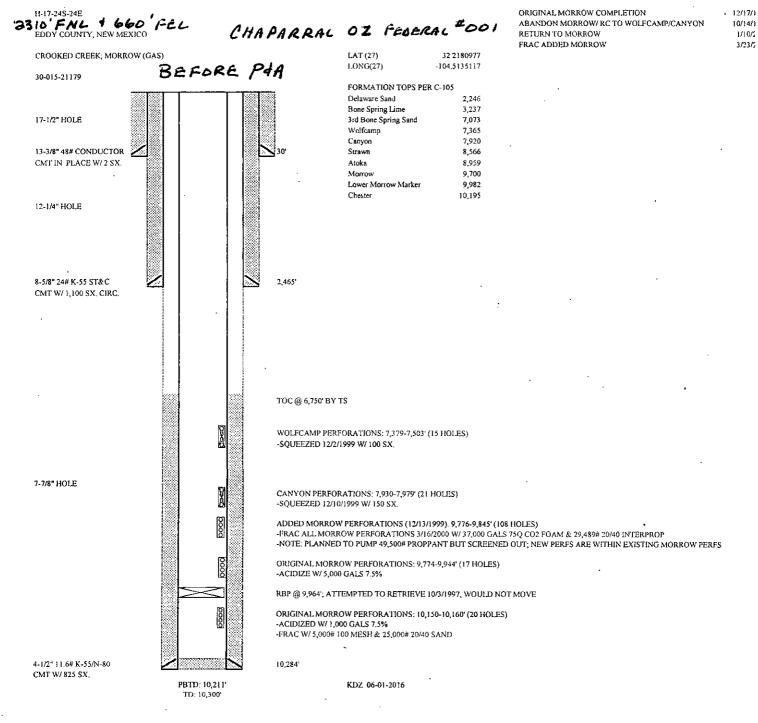

Э

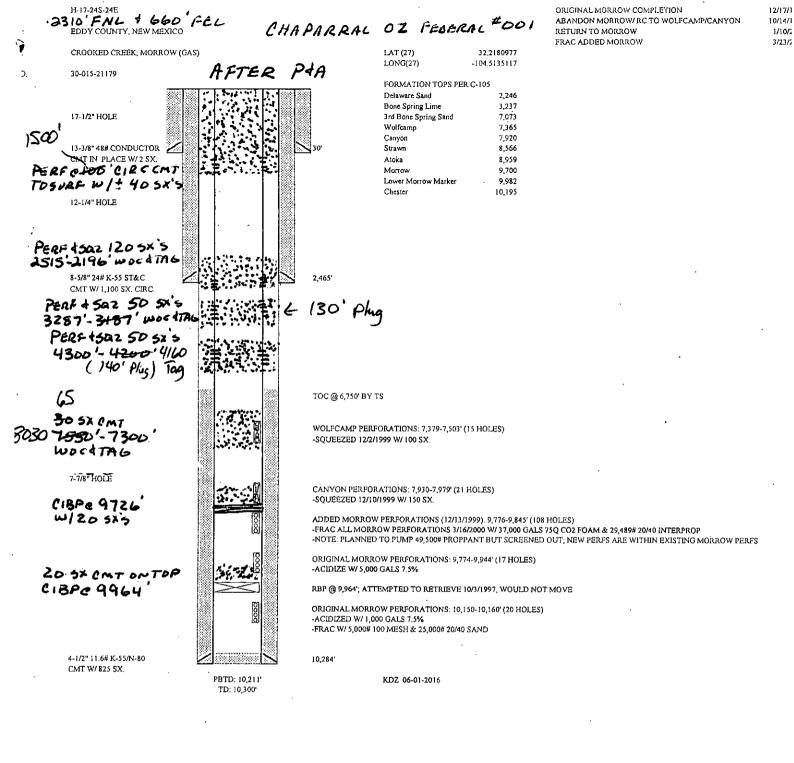

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

-

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

୍ଦ

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed; file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



## **United States Department of the Interior**

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

## **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active' support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.

- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.
- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Linda Denniston Environmental Protection Specialist 575-234-5974

Henryetta Price Environmental Protection Specialist 575-234-5951

Dara Glass Environmental Protection Specialist 575-234-5924

Shelly Tucker Environmental Protection Specialist 575-234-5979