

Form 3160-5 (June 2015)	DEPARTMENT OF THE	ARTESIA DISTRICT UNITED STATES EPARTMENT OF THE INTERIOR UREAU OF LAND MANAGEMENT OCT 24 2017		FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMNM0405444A			
SUNE	RY NOTICES AND REPO						
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re- DHAFEI VED abandoned well. Use form 3160-3 (APD) for such proposals.					6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRIPLICATE - Other instructions on page 2					7. If Unit or CA/Agreement, Name and/or No.		
1. Type of Well ☐ Gas Well ☐ Other					8. Well Name and No. TODD 26B FED 4		
2. Name of Operator Contact: RONNIE SLACK DEVON ENERGY PRODUCTION CONE-Mail: ronnie.slack@dvn.com					9. API Well No. 30-015-20599-00-S1		
3a. Address 6488 SEVEN RIVERS H ARTESIA, NM 88211	3b. Phone No. (include Ph: 405-552-4615	Phone No. (include area code) : 405-552-4615			10. Field and Pool or Exploratory Area INGLE WELLS-DELAWARE		
4. Location of Well (Footage, 2	ec., T., R., M., or Survey Descriptio	nn)			11. County or Parish	i, State	
Sec 26 T23S R31E NWN	E 660FNL 1980FEL				EDDY COUNTY, NM		
12. CHECK TH	E APPROPRIATE BOX(ES) TO INDICATE NA	TURE OI	F NOTICE	E, REPORT, OR OT	THER DATA	
TYPE OF SUBMISSION		TYPE OF ACTION					
Notice of Intent	Acidize	Deepen		🗖 Produ	ction (Start/Resume)	🗖 Water Shut	-Of
—	□ Alter Casing	🗖 Hydraulic F	racturing	🗖 Reclar	nation	🗖 Well Integr	ity
Subsequent Report	Casing Repair	🗖 New Constr	uction	🗖 Recon	nplete	Other	
🗖 Final Abandonment Noti	ce Change Plans	□ Change Plans ☑ Plug and Abandon □ Temporarily Abandon □ Convert to Injection □ Plug Back □ Water Disposal		orarily Abandon			
u							
 Describe Proposed or Complet If the proposal is to deepen dir Attach the Bond under which ti following completion of the im testing has been completed. Fi 	d Operation: Clearly state all pertin ctionally or recomplete horizontally ie work will be performed or provid olved operations. If the operation r hal Abandonment Notices must be f	ent details, including estim y, give subsurface locations le the Bond No. on file with results in a multiple comple	s and measur h BLM/BIA etion or reco	g date of any red and true . Required s mpletion in	proposed work and app vertical depths of all per ubsequent reports must a new interval, a Form 3	tinent markers and zo be filed within 30 da 160-4 must be filed o	nes. /s nce
 13. Describe Proposed or Complet If the proposal is to deepen dir Attach the Bond under which ti following completion of the in- testing has been completed. Fi determined that the site is readu 1. MIRU P&A unit. 2. POOH W/rod pump as 3. Set CIBP @ 5,960'. Ta 4. Spot 25 sx (245') CI C 5. Spot 200 sx (1975') CI inside R-111P.) 	d Operation: Clearly state all pertin ctionally or recomplete horizontally ie work will be performed or provid olved operations. If the operation r hal Abandonment Notices must be f for final inspection. sembly and 2-3/8" production g CIBP. Circulate w/10# salt @ 5,960' - 5,715'. C @ 4,400' - 2,425'. Tag TO C @ 2,425' - 550'. (continue 45' to surface.	the ent details, including estim y, give subsurface locations le the Bond No. on file with results in a multiple comple filed only after all requirem in tubing from ~6,032'. gel mud. C. (T.Delaware @ 43	s and measu h BLM/BIA etion or reco lents, includ 376'; B.Sa on; T.Salt	g date of any red and true . Required s mpletion in ing reclamat ' R. !t 4147'; w @ 1065';	proposed work and app vertical depths of all per ubsequent reports must a new interval, a Form 3 ion, have been complete (11-P''_50): Actach/Sc ell RECLAMAT AT	tinent markers and ze be filed within 30 day 160-4 must be filed of d and the operator ha d p(m the d filed d filed d filed for filed for filed for filed for filed for filed filed filed for filed for filed filed filed for filed for filed for filed for filed filed for filed for filed filed for filed for filed for filed for filed for filed for for filed for filed for filed for for filed for for for for for filed for for for for for for for for for for	nes. /s nce s E
 Describe Proposed or Complet If the proposal is to deepen dirin Attach the Bond under which to following completion of the in- testing has been completed. Fi determined that the site is read- 1. MIRU P&A unit. POOH W/rod pump as 3. Set CIBP @ 5,960'. Ta 4. Spot 25 sx (245') CI C 5. Spot 200 sx (1975') CI inside R-111P.) Spot 190 sx (1875') CI surf shoe @ 618') Spot 25 sx CI C from 2 8. Cut wellhead off 3' BG 	d Operation: Clearly state all pertin citonally or recomplete horizontally ie work will be performed or provide olved operations. If the operation r hal Abandonment Notices must be f for final inspection. sembly and 2-3/8" production g CIBP. Circulate w/10# salt @ 5,960' - 5,715'. C @ 4,400' - 2,425'. Tag TO C @ 2,425' - 550'. (continue 45' to surface. Set dry hole marker.	ent details, including estim y, give subsurface locations le the Bond No. on file with results in a multiple comple filed only after all requirem n tubing from ~6,032'. gel mud. C. (T.Delaware @ 43 plug across salt section Accepted for re	s and measu h BLM/BIA etion or reco lents, includ 376'; B.Sa on; T.Salt	g date of any red and true . Required s mpletion in ing reclamat ' R. !t 4147'; w @ 1065';	proposed work and app vertical depths of all per ubsequent reports must a new interval, a Form 3 ion, have been complete 111 - P'' - Sol: fotesch / Sol: ell RECLAMAT AT	tinent markers and ze be filed within 30 day 160-4 must be filed of d and the operator ha d p(m the d filed d filed d filed for filed for filed for filed for filed for filed filed filed for filed for filed filed filed for filed for filed for filed for filed filed for filed for filed filed for filed for filed for filed for filed for filed for for filed for filed for filed for for filed for for for for for filed for for for for for for for for for for	enes. S S E
 Describe Proposed or Complet If the proposal is to deepen dir Attach the Bond under which ti following completion of the im testing has been completed. Fi determined that the site is read? MIRU P&A unit. POOH W/rod pump as Set CIBP @ 5,960'. Ta Spot 25 sx (245') CI C Spot 200 sx (1975') CI inside R-111P.) Spot 190 sx (1875') CI surf shoe @ 618') Spot 25 sx CI C from 2 Cut wellhead off 3' BG 	d Operation: Clearly state all pertin ctionally or recomplete horizontally ie work will be performed or provide olved operations. If the operation r hal Abandonment Notices must be f for final inspection. sembly and 2-3/8" production g CIBP. Circulate w/10# salt @ 5,960' - 5,715'. C @ 4,400' - 2,425'. Tag TO C @ 2,425' - 550'. (continue 45' to surface. Set dry hole marker.	aent details, including estim y, give subsurface locations le the Bond No. on file with results in a multiple comple filed only after all requirem tubing from ~6,032'. gel mud. C. (T.Delaware @ 43 plug across salt section Accepted for re- Maccepted for re- #391732 verified by the GY PRODUCTION COM	s and measu h BLM/BIA etion or reco ents, includ 376'; B.Sa on; T.Salt Cord - N BLM Wel LP, sent	g date of any g date of any ered and true . Required s ing reclamat If 4147'; w @ 1065'; MOCD	proposed work and app vertical depths of all per ubsequent reports must a new interval, a Form 3 ion, have been complete iii-P' Sol: Actach/Sol ell RECLAMAT AT SEE ATTACI CONDITION	tinent markers and ze be filed within 30 day 160-4 must be filed of d and the operator ha d p(m the d filed d filed d filed for filed for filed for filed for filed for filed filed filed for filed for filed filed filed for filed for filed for filed for filed filed for filed for filed filed for filed for filed for filed for filed for filed for for filed for filed for filed for for filed for for for for for filed for for for for for for for for for for	enes. S S E
 Describe Proposed or Complet If the proposal is to deepen dir Attach the Bond under which ti following completion of the im- testing has been completed. Fi determined that the site is read? MIRU P&A unit. POOH W/rod pump as Set CIBP @ 5,960'. Ta Spot 25 sx (245') CI C Spot 25 sx (245') CI C Spot 200 sx (1975') CI inside R-111P.) Spot 190 sx (1875') CI surf shoe @ 618') Spot 25 sx CI C from 2 Cut wellhead off 3' BG 	d Operation: Clearly state all pertin ctionally or recomplete horizontally ie work will be performed or provide olved operations. If the operation r hal Abandonment Notices must be f for final inspection. sembly and 2-3/8" production g CIBP. Circulate w/10# salt @ 5,960' - 5,715'. C @ 4,400' - 2,425'. Tag TO C @ 2,425' - 550'. (continue 45' to surface. Set dry hole marker. ing is true and correct. Electronic Submission For DEVON ENERG	aent details, including estim y, give subsurface locations le the Bond No. on file with results in a multiple comple filed only after all requirem tubing from ~6,032'. gel mud. C. (T.Delaware @ 43 plug across salt section Accepted for re- Maccepted for re- #391732 verified by the GY PRODUCTION COM	s and measu h BLM/BIA etion or reco lents, includ 376'; B.Sa on; T.Salt 	g date of any reed and true . Required s ing reclamat It 4147'; w @ 1065'; MOCD	proposed work and app vertical depths of all per ubsequent reports must a new interval, a Form 3 ion, have been complete iii-P' Sol: Actach/Sol ell RECLAMAT AT SEE ATTACI CONDITION	tinent markers and ze be filed within 30 day 160-4 must be filed of d and the operator ha d p(m the d filed d filed d filed for filed for filed for filed for filed for filed filed filed for filed for filed filed filed for filed for filed for filed for filed filed for filed for filed filed for filed for filed for filed for filed for filed for for filed for filed for filed for for filed for for for for for filed for for for for for for for for for for	enes. S S E
 13. Describe Proposed or Complet If the proposal is to deepen dirr Attach the Bond under which ti following completion of the in- testing has been completed. Fi determined that the site is ready 1. MIRU P&A unit. 2. POOH W/rod pump as 3. Set CIBP @ 5,960'. Ta 4. Spot 25 sx (245') CI C 5. Spot 200 sx (1975') CI inside R-111P.) 6. Spot 190 sx (1875') CI surf shoe @ 618') 7. Spot 25 sx CI C from 2 8. Cut wellhead off 3' BG Automatical Action of the state	d Operation: Clearly state all pertin ctionally or recomplete horizontally ie work will be performed or provide olved operations. If the operation re all Abandonment Notices must be for for final inspection. seembly and 2-3/8" production g CIBP. Circulate w/10# salt @ 5,960' - 5,715'. C @ 4,400' - 2,425'. Tag TO C @ 2,425' - 550'. (continue 45' to surface. Set dry hole marker. ing is true and correct. Electronic Submission For DEVON ENERG Committed to AFMSS for p	aent details, including estim y, give subsurface locations le the Bond No. on file with results in a multiple comple filed only after all requirem tubing from ~6,032'. gel mud. C. (T.Delaware @ 43 plug across salt section Accepted for re- de Machee H391732 verified by the GY PRODUCTION COM rocessing by JAMES A	s and measu h BLM/BIA etion or reco lents, includ 376'; B.Sa on; T.Salt 	g date of any g date of any reed and true . Required s mpletion in ing reclamat "R- "R- "R- "R- "R- "R- "R- "R- "R- "R-	proposed work and app vertical depths of all per ubsequent reports must a new interval, a Form 3 ion, have been complete (1.1-P' _50): Actach / Sol: Actach / Sol: Actach / Sol: CONDITION SEE ATTACI CONDITION	tinent markers and ze be filed within 30 day 160-4 must be filed of d and the operator ha d p(m) the d . TION PROCEDUR TACHED HED FOR	enes. Nos Sistemation E
 13. Describe Proposed or Complet If the proposal is to deepen dirr Attach the Bond under which ti following completion of the in- testing has been completed. Fi determined that the site is ready 1. MIRU P&A unit. 2. POOH W/rod pump as 3. Set CIBP @ 5,960'. Ta 4. Spot 25 sx (245') CI C 5. Spot 200 sx (1975') CI inside R-111P.) 6. Spot 190 sx (1875') CI surf shoe @ 618') 7. Spot 25 sx CI C from 2 8. Cut wellhead off 3' BG Automatical Action of the state	d Operation: Clearly state all pertin d Operation: Clearly state all pertin te work will be performed or provid olved operations. If the operation r nal Abandonment Notices must be f for final inspection. sembly and 2-3/8" production g CIBP. Circulate w/10# salt @ 5,960' - 5,715'. C @ 4,400' - 2,425'. Tag TO C @ 2,425' - 550'. (continue 45' to surface. Set dry hole marker. <i>Leur Ory for the constant of the committed to AFMSS for p</i> NIE SLACK	ent details, including estim y, give subsurface locations le the Bond No. on file with results in a multiple comple filed only after all requirem tubing from ~6,032'. gel mud. C. (T.Delaware @ 43 plug across salt section Accepted for re- Accepted for re- #391732 verified by the GY PRODUCTION COM rocessing by JAMES A Title	s and measu h BLM/BIA etion or reco ents, includ 376'; B.Sa on; T.Salt cord - N BLM Wel LP, sent MOS on 1 PRODU 10/12/20	g date of any red and true . Required s ing reclamation ing reclamation ing reclamation ing reclamation ing reclamation ing reclamation (1065'; MOCD (1065'; MOCD (1065'; MOCD (1065')	proposed work and app vertical depths of all per ubsequent reports must a new interval, a Form 3 ion, have been complete (11-P' _Sol: Actach/Sol: Actach/Sol: Bell RECLAMAT AT SEE ATTACI CONDITION on System sbad (18JA0033SE) ECHNOLOGIST	tinent markers and ze be filed within 30 day 160-4 must be filed of d and the operator ha d p(m) the d . TION PROCEDUR TACHED HED FOR	enes. Nos Sistemation E
 13. Describe Proposed or Complet If the proposal is to deepen dirr Attach the Bond under which ti following completion of the in- testing has been completed. Fi determined that the site is ready 1. MIRU P&A unit. 2. POOH W/rod pump as 3. Set CIBP @ 5,960'. Ta 4. Spot 25 sx (245') CI C 5. Spot 200 sx (1975') CI inside R-111P.) 6. Spot 190 sx (1875') CI surf shoe @ 618') 7. Spot 25 sx CI C from 2 8. Cut wellhead off 3' BG Automatical Action of the state	d Operation: Clearly state all pertin d Operation: Clearly state all pertin te work will be performed or provid olved operations. If the operation r nal Abandonment Notices must be f for final inspection. sembly and 2-3/8" production g CIBP. Circulate w/10# salt @ 5,960' - 5,715'. C @ 4,400' - 2,425'. Tag TO C @ 2,425' - 550'. (continue 45' to surface. Set dry hole marker. <i>Leur Ory for the constant of the committed to AFMSS for p</i> NIE SLACK	ent details, including estim y, give subsurface locations le the Bond No. on file with results in a multiple comple filed only after all requirem in tubing from ~6,032'. gel mud. C. (T.Delaware @ 43 plug across salt section Accepted for read accepted for read for read for read for read and the file of the file and the file of the file of the file and the file of the file of the file and the file of the file of the file of the file and the file of the file of the file of the file and the file of the file of the file of the file and the file of the file of the file of the file of the file and the file of the file of the file of the file of the file and the file of the file and the file of th	s and measu h BLM/BIA etion or reco ents, includ 376'; B.Sa on; T.Salt cord - N BLM Wel LP, sent MOS on 1 PRODU 10/12/20	g date of any red and true . Required s ing reclamation ing reclamation ing reclamation ing reclamation ing reclamation ing reclamation (1065'; MOCD (1065'; MOCD (1065'; MOCD (1065')	proposed work and app vertical depths of all per ubsequent reports must a new interval, a Form 3 ion, have been complete (11-P' _Sol: Actach/Sol: Actach/Sol: Bell RECLAMAT AT SEE ATTACI CONDITION on System sbad (18JA0033SE) ECHNOLOGIST	tinent markers and ze be filed within 30 day 160-4 must be filed of d and the operator ha d p(m) the d . TION PROCEDUR TACHED HED FOR	E
 13. Describe Proposed or Complet If the proposal is to deepen dirivative the proposal is the proposal is to deepen dirivative the proposal is to dirivative the proposal is to dirivative t	d Operation: Clearly state all pertin d Operation: Clearly state all pertin te work will be performed or provid olved operations. If the operation r hal Abandonment Notices must be f for final inspection. sembly and 2-3/8" production g CIBP. Circulate w/10# salt @ 5,960' - 5,715'. C @ 4,400' - 2,425'. Tag TO C @ 2,425' - 550'. (continue 45' to surface. Set dry hole marker. Lectronic Submission For DEVON ENER Committed to AFMSS for p NIE SLACK onic Submission) THIS SPACE F Lached. Approval of this notice doo or equitable title to those rights in the set of the submission for ended the submission for the submission.	ent details, including estim y, give subsurface locations le the Bond No. on file with results in a multiple comple filed only after all requirem in tubing from ~6,032'. gel mud. C. (T.Delaware @ 43 plug across salt section Accepted for real accepted for real agent for real a	s and measu h BLM/BIA etion or reco ents, includ 376'; B.Sa on; T.Salt Cord - N BLM Wel LP, sent MOS on 1 PRODU 10/12/20	g date of any red and true . Required s ing reclamation ing reclamation ing reclamation ing reclamation ing reclamation ing reclamation (1065'; MOCD (1065'; MOCD (1065'; MOCD (1065')	proposed work and app vertical depths of all per ubsequent reports must a new interval, a Form 3 ion, have been complete iii-A'	tinent markers and ze be filed within 30 da 160-4 must be filed of d and the operator ha d P(~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~	E

** BLM REVISED	** BLM REVISED *	* BLM REVISED **	[•] BLM REVISED *	* BLM REVISED **
----------------	------------------	------------------	----------------------------	------------------

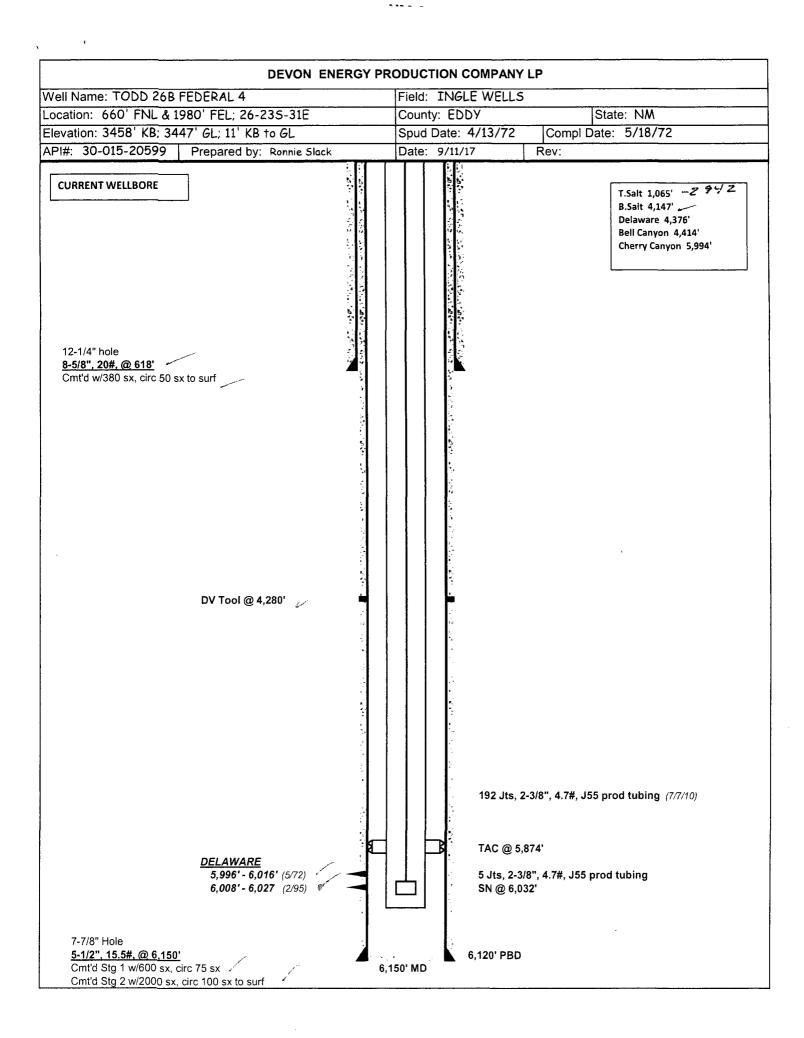

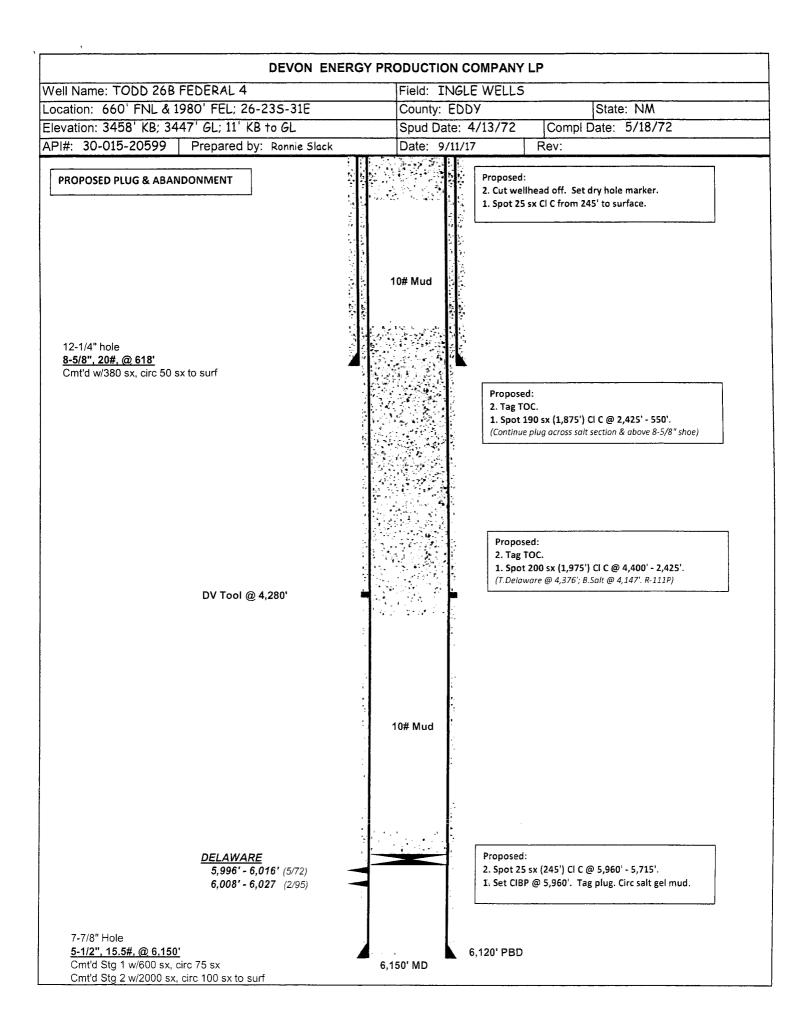

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Appropriate time for submittal would be when filing the Vell Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Henryetta Price Environmental Protection Specialist 575-234-5951

Shelly Tucker Environmental Protection Specialist 575-234-5979

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612